Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	001	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4140 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLE, CHRISTINE	Lynn Josse, Michael Allen, CRO	1/15/2010
4140 ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a one-story, flat-roofed painted brick house. The front elevation features an entrance bay with door opening (door has been replaced) accessed at a replacement porch consisting of a concrete block base, metal supports, and a gable roof. At the right is a window bay with a segmental-arch opening partly infilled with brick above a replacement window. An original stone sill remains. Part of the original wooden cornice remains above, although the top has been clad. There is a second entrance (now closed and covered with vinyl siding) recessed on the left (east) side of the house.

38.(cont.) History::

Permit# issued 2-17-1923 to repair frame shed, $50. Owner: M.C. Gordon
Permit##5277 issued 2-17-1923 to repair frame shed, $50. Owner is M.C. Gordon Architect: J.M.H.Dorsey, owner on certificate: John McBurney

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4140

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	CC 2	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4160 ALDINE AV		
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☐	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use: Multiple Dwelling		Sub-use: Multiple Dwelling	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Recessed 1-story	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1891		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HARRIS, ARTHUR L & HARRIS, MICHEL	Lynn Josse, Michael Allen, CRO	1/15/2010
P O BOX 78336		43. Date of revisions:
ST LOUIS MO 63178		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

Flat-roofed painted brick building built on concrete slab at rear of property; large garage opening facing Whittier Avenue to the left of two window openings and an entrance. Shaped parapet coped with clay tile.

28. (cont.) Further description of important architectural features:

This is a two-story, flat-roofed brick two-flat building. The front elevation has a painted rusticated limestone foundation and is divided into two bays. The left (east) bay features identical segmental arch window openings at each floor, divided by ornamented mullions into paired windows with transoms. Historic sash remains. The right (west) bay features a window opening on the second floor with historic sash and transom above a Roman arch entrance leading to a recessed stoop and two door openings. At the top of the elevation is a wooden cornice and a false mansard roof clad in asphalt shingles.

38.(cont.) History::

permit #I2012 3-14-1927 Alter shed, $50. Owner: Dr. T. M. Hart
Permit#K2143 11-9-1931 1-story frame shed, $100. Owner: Dr. T.M. Hart; owner Hermann Fischer ; thi is listed as address of Randall Ice & Coal in 1934 Negro Business Directory

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	003	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4201 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Tudor Revival	Load-bearing Brick	
(b) Composite		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2½	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
High Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Slate		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1931	Whittaker, F. L.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Whittaker, F. L.	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WHIGOM, CAROL J			Lynn Josse, Michael Allen, CRO	1/15/2010
4201 E ALDINE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This 2.5 story gabled brick building faces the side street rather than Aldine. The walls are clad in tan tapestry brick; window and door openings are trimmed in terra cotta. Gable ends feature a diaper pattern. The front elevation features a center first floor entrance accessed by curved steps with stone side walls. A pair of windows is in a quoined opening above. To each side of the entrance bay are projecting cross gabled bays; the left (south) has a projecting oriel window with copper roof under a triple window while the right (north) features centered double windows at each floor. Both bays terminate with single windows in the gable ends. At the north end is a basement garage entrance under a 1-story wing with a Tudor-arched window opening. The Aldine elevation is divided into 3 bays with single windows and a second entrance at the left (west).

38.(cont.) History::

According to the 1951 Sanborn map, this building was flats (probably two) at that time. Built as a single dwelling per permit. For Dr. Leo Commissiong, previously listed at 4219 Aldine

1927 Red-Blue Book: Reynolds Aaron (Hattie)
1934 Negro Business Directory: Dr. Commissiong is at 1701 Whittier, the second address for this same property.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	004	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4205 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1896		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Chadwick, James	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	1896 owner: Charles Brown	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DAWKINS, SHERRIESE L	Lynn Josse, Michael Allen, CRO	1/15/2010
2162 MILL VALLEY DR		43. Date of revisions:
FLORISSANT MO 63031		

FOR SHPO USE:

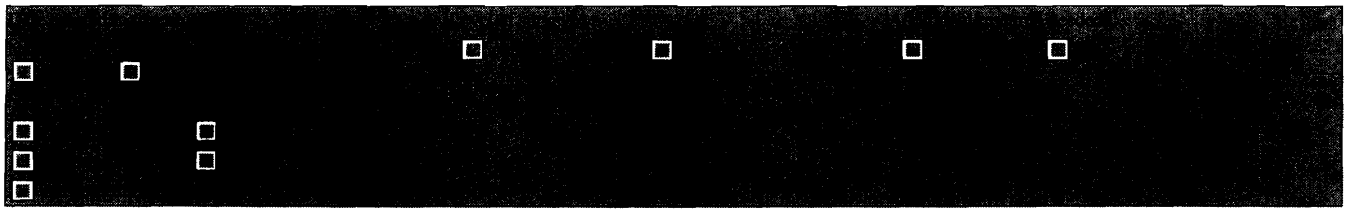

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a modern, one-story, gabled concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

This one-story flat-roofed brick house has two window bays (first floor windows boarded) under a false mansard roof (now clad in asphalt shingles). The two window openings have segmental arches, as do the two basement window openings. The recessed right bay includes a boarded door and a corner porch with frame supports and a brick and concrete base.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Ward Zachary (Sunnie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:		
SLCAS036	C05	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4207 ALDINE AV		
5. City/State:	Vicinity: ☒	6. UTM:	/	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO				
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Vacant/Not in Use	
	Sub-use:	Single Dwelling	Sub-use:	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop with hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1896		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Chadwick, James	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
DAWKINS, SHERRIESE			Lynn Josse, Michael Allen, CRO	1/15/2010
2162 MILL VALLEY DR				43. Date of revisions:
FLORISSANT	MO	63031		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This one-story flat-roofed brick house has two window bays (first floor and basement windows boarded) under a parapet wall. It is likely that the original roof profile resembled that next door at 4205 Aldine. At both bays, the first floor and basement window openings are topped with segmental arches. The recessed right bay includes a boarded front door accessed by concrete steps leading to a concrete block stoop. A shed hood shelters the entrance.

38.(cont.) History::

1896 owner: Charles Brown
1920 census: Fischer George Alvina and daughter, white renters, both parents of German ancestry, he's a horse shoer with own business.
1927 Red-Blue Book: Cooper, Willis (Virdella)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	006	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4210 ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III	Lynn Josse, Michael Allen, CRO	1/15/2010
10700 LANDSEER DR		43. Date of revisions:
ST LOUIS MO 63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a one-story, flat-roofed, raised-basement painted brick residence with a stone foundation. The entrance bay is recessed, left, and contains a door opening carrying a modern steel door. The corner porch has a brick and concrete base with concrete steps. A square column carries the hipped porch roof. There are two window bays, right. Under the segmental arched heads, the openings are partly infilled with board and contain small replacement windows. Over the window bays is a false mansard roof that retains slate shingles.

38.(cont.) History::

1920 census: Shulkon(??), Herman and Mathilda and two sons, white, renters, he is an edgesetter/shoeworker
1927 Red-Blue Book: Fearance, Wilson (Carrie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4210E
ALDINE

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	007	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4211 ALDINE AV		
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		

10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Public	Domestic		Vacant/Not in Use	
	Sub-use:	Single Dwelling	Sub-use:	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Limestone	
16. No. of bays (1st floor):	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by: Neglect
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

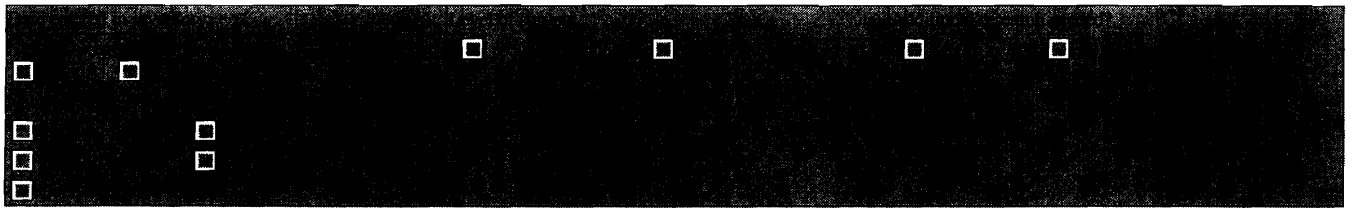

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This house is divided into two bays, with a (boarded) window opening at left (west) and a door opening (also boarded) at right (east) accessed by an unsheltered concrete block stoop. Limestone band courses are found at the base of the first floor level (painted) and at the head of the first floor openings, where the courses connect the brick segmental arches with limestone keystones. The window opening has an unpainted limestone sill and the basement window opening (boarded) is divided by a stone mullion. The upper third of the first floor window is filled in with brick, as is the transom level of the door opening. The brick parapet wall, not original, appear to be of the same vintage as the window infill.

38.(cont.) History::

1920 census: Markers, Frank and Anna and son and daughter and his 2 brothers, owners free, white, elder generation of German parentage, he works for car co, brothers are laborers
1927 Red-Blue Book: Tyler May Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	008	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4213 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b)		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
none		Endangered by: Deterioration
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NANCE III, EZELL	Lynn Josse, Michael Allen, CRO	1/15/2010
10700 LANDSEER DR		43. Date of revisions:
ST LOUIS MO 63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Condition is poor; this house is essentially a roofless shell. The parapet wall is severely deteriorated, with only an intact end block at left (west) indicating former appearance. There is a wooden hipped-roof porch retaining one decorative corner brace above a concrete foundation (possibly paged stone). The windows and doors are boarded.

38.(cont.) History::

1920 census:Schlueter, Henry and Katie, 2 kids, he's a plasterer, white, German parentage, own bldg with mortgage; 2nd household Reuter, Geo and Mary , renters, white, German parentage, he's a hatter in a factory
1927 Red-Blue Book: John, Raymond (Beulah)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	009	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4216 ALDINE AV
E. City/State:	Vicinity: ☒	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Chadwick, James	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
	Brown, Chas. (orig owner)	
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III			Lynn Josse, Michael Allen, CRO	1/15/2010
10700 LANDSEER DR				43. Date of revisions:
ST LOUIS	MO	63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a one-story, flat-roofed, raised-basement painted brick residence with a stone foundation. The entrance bay, left, is recessed and contains a door opening accessed by a wooden stoop. The door is a contemporary replacement, and the shed hood which supports it appears to date from the Craftsman era. There are two window bays, right; the segmental arched openings retain original 2/2 windows. Over the windows is a false mansard roof now clad in vinyl siding.

38.(cont.) History::

1920 census: August and Eliz Becker and grandson; Aug is nat German(Hesse), tailor; grandson is bread baker, renters, white
1927 Red-Blue Book: Davis Jas (Anna)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

216

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	OIC	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4219 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick (1st) and stucco (2nd)	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1927	Katz, Y. C.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sachar and Cantor	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
MCCLINTON, ROBERT			Lynn Josse, Michael Allen, CRO	1/15/2010
4219 E ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

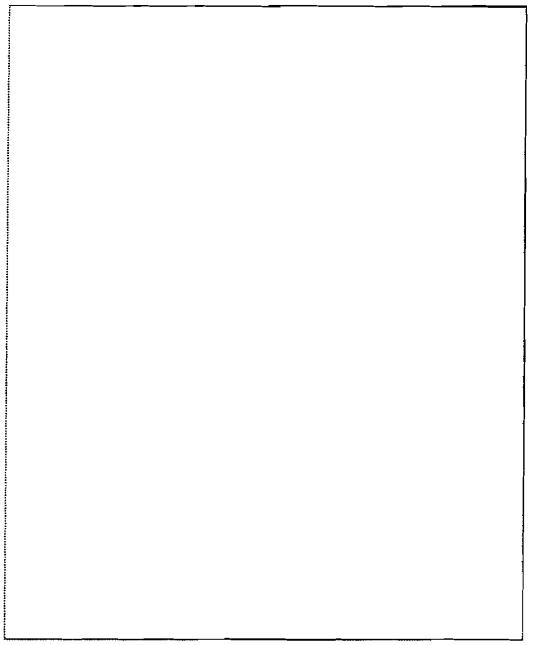

Site Map/plan (include north arrow):

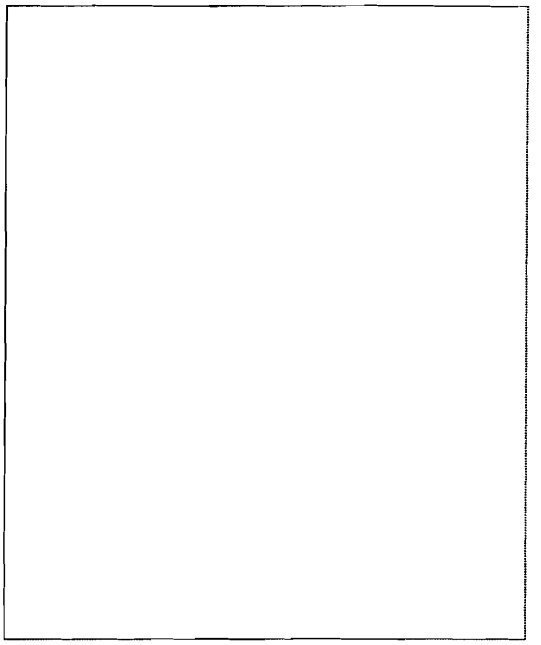

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This bungalow-inspired house has a side-ended gambrel roof with a high shed dormer facing front. The first floor exterior cladding is variegated brick. The side gambrel ends are stuccoed with imitation stickwork, and the dormer is also stuccoed. A high concrete stoop, right, leads to the entrance (a replacement door). Brackets support a gabled hood across the full width of the first floor. To the left (west) is a wide window opening containing two white replacement windows. The pair of windows in the dormer are also replacements.

38.(cont.) History::

M. Maloney was owner on permit. 1927 Red-Blue Book: no listing
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	011	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4223 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1927		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Rafferty Real Estate Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Moten, W. C. (orig owner)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III			Jan Cameron	
4223 E ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a side-gabled variegated brick bungalow with central shed-roofed brick dormer. Concrete steps lead up to the porch, which is set under a forward extension of the main roof and is slightly narrower. The entrance at left carries a wooden replacement door, while the window opening at right contains paired wooden three-over-one windows behind bars. The dormer opening carries a centered pair of three-over-one wooden windows.

38.(cont.) History::

1927 Red-Blue Book: not listed
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	012	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4233-5 ALDINE AV

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Wood undetermined	
(b) Duplex(Double House)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Partial	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by: deterioration

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Sanders, Charles B. (orig. own.)	
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HOPKINS, LEO F	Lynn Josse, Michael Allen, CRO	1/15/2010
4233 E ALDINE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this one-and-a-half story, side-gabled frame double house is divided into four bays with entrances on the outside bays and window openings at the inside bays. The left door and right window are boarded. The exposed window opening carries a replacement 1/1 window. At the right, a replacement door is in a historic wooden casement with transom window. There is a wooden shed-roofed porch over the left entrance. The two wood dormers have shallow hipped roofs and are missing windows. A wooden bracketed fascia runs across the front elevation. Some of the original weatherboard is exposed where the right porch is missing, revealing that the siding profile imitates the original. This building is considered potentially contributing because of the intact original wood detailing and compatible (and reversible) siding choice.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Flowers Chas (Sallie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	C13	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4315 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☐ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☐ Altered Date(s):
Flat	Full	☐ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☐ Other Date(s):
	Visible from public road? ☐	Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☐
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
JAQUESS SR, ELBERT & KATHRYN M			Lynn Josse, Michael Allen, CRO	1/15/2010
4315 ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This red brick two-story house has a full porch (a post-1909 historic addition), with battered brick piers and a gabled roof; its gable end is clad in masonite. Prior to the addition of the porch, the façade would have looked more like that of 4317 Aldine next door. The front door (left) is a wooden replacement and has a small side window. The 2nd story window above it and the two right side windows are wood sash 1/1s. Window openings have ornamental brick moldings and stone lugsills. Above a metal cornice, the front parapet wall has clay tile coping, and its end blocks have been shortened.

38.(cont.) History::

The porch appears to be a c.1915 - 1925 addition, although it is not shown on the 1951 Sanborn map (apparently a rare error).
1920 census:
1927 Red-Blue Book:
1930 census:
1943 Negro Directory:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4515

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0147	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4317 ALDINE AV
E. City/State:	Vicinity: ☒	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SEC OF HUD	Lynn Josse, Michael Allen, CRO	1/15/2010
1888 SHERMAN ST SHERMAN PLZ S		43. Date of revisions:
DENVER CO 80203		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this two bay, two story house has recently been painted mustard yellow. At a hipped frame porch, left, is a replacement front door a small side window. The 2nd story window above it and the two wider right bay windows are vinyl 1/1s. Window openings have ornamental brick moldings and stone lugsills. Above a metal cornice, the front parapet wall has metal coping except at its end blocks, which have been shortened.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:		
SLCAS036	C15	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4319 ALDINE AV		
E. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop with hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
	Hoover, C.G.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Mitchell, William H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SIMON, JO ANN	Lynn Josse, Michael Allen, CRO	1/15/2010
4319 ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

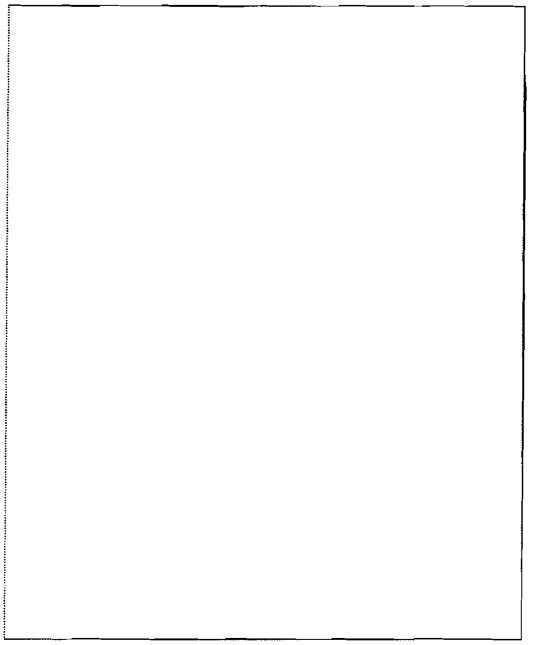

Site Map/plan (include north arrow):

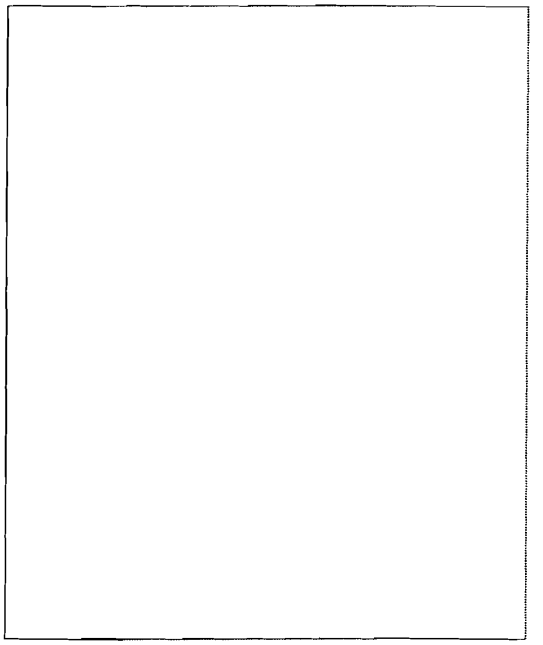

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this two bay, two story house is painted red. At a concrete stoop, left, a hipped-roof wooden hood with ornamental wooden brackets shelters a replacement front door and a small 1/1 wood sash side window. The 2nd story window above it and the two wider right bay windows are vinyl 1/1s. The parapet wall has stepped, projecting blocks at each end and terra cotta coping.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:
1943 Negro Directory: Elizabeth Bradford, Marshall School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	016	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4321 ALDINE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
High Gable	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1950	Hunter, Vincel	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Prosperity Construction Company	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Cox, Emma	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HERRON, JESSE L & ALLISON C BEASL	Lynn Josse, Michael Allen, CRO	1/15/2010
4321 ALDINE AV		43. Date of revisions.
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This building retains a bungalow-inspired form, without the Craftsman detailing. The full-width front porch is roofed by a low-pitched extension of the main side gable, with a wide gabled dormer above. (Almost the full width of the façade, the dormer counts as a full second story.) The façade is buff machine-raked brick with contrasting red brick sills. The first floor's left bay has a large Chicago-style window with center pane flanked by wooden two-over-two windows (with horizontal rather than vertical panes). The front door is a replacement. A pair of two-over-two windows (horizontal panes) is in the dormer face.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4321

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	017	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4325 ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hoover, C.G.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Mitchell, William H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
ALEXANDER, STEPHANIE			Lynn Josse, Michael Allen, CRO	1/15/2010
4325 ALDINE AVE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this two bay, two story house is painted brown. At a modern gabled frame porch, left, a replacement front door is next to a small 1/1 wood sash side window. The 2nd story window above it and the two wider right bay windows are wood sash 1/1s. Window openings have splayed brick headers with beaded ornamental brick courses below sills and atop headers. A course of chevron-patterned terra cotta or brick pieces runs across the sill level of the second floor openings. The brick corbelled cornice wraps each corner. Above it, the front parapet wall has been removed (see 4329 Aldine for a sibling property with a more intact parapet).

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	018	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4327 ALDINE AV
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1924	Hart, A.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hart, A.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Robinson, A.D.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
SMITH, RANDLE O & CATHERINE A			Lynn Josse, Michael Allen, CRO	1/15/2010
4327 ALDINE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a gabled frame garage clad in aluminum siding.

28. (cont.) Further description of important architectural features:

This single story house has a tapestry brick front elevation. A centered brick porch with brick piers has a gabled roof (the brick under the concrete porch deck appears added). The front door is a replacement. Wooden four-over-one windows remain in the two windows openings on the front elevation. Soldier brick forms the flat arch lintels and a panel over the porch. At the wide center step of the parapet wall, what appears to be a partial brick panel indicates some kind of alteration to the parapet profile.

38.(cont.) History::

1927 Red-Blue Book:
1930 census: In the 934 Negro Business Directory, Upholsterer H. D. Robinson is listed here.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4327

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	019	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4329 ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hoover, C.G.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Mitchell, William H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, JOANN BARNES			Lynn Josse, Michael Allen, CRO	1/15/2010
4329 ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this two bay, two story house is painted. At a shed-roofed brick porch, left, a replacement front door is next to a small 1/1 side window. The 2nd story window above it and the two wider right bay windows are new vinyl replacements. Ornamental brick courses run at label and sill levels of window openings, forming labels around the flat arches. Below the parapet wall is a corbelled brick and patterned terra cotta cornice. The parapet has a center step and end blocks, all with clay tile coping and apparently somewhat altered from the original.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4329

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C 2 0	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4331 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	
7. Township/Range/Section: Not Applicable		T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Full	■ Moved Date(s):
18. Roof Material	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1927	Catlin, C., Jr.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Catlin, C., Jr.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Wright, R.Z. (ground) and L. Gronber (bld	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BUTLER, M L & MILDRED C	Lynn Josse, Michael Allen, CRO	1/15/2010
4331 ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick. Shaped parapet. Full porch with brick piers forms balcony; metal railings. Concrete steps at each side of porch. Porch wall has center section of bakery brick composing a basket-weave pattern. First floor openings are boarded. Second floor has original one-over-one wooden windows in outside openings and replacement window in large center opening. Outline of removed hood or roof over second floor openings.

38.(cont.) History::

Negro Directory (1943): Frank B. Wilson, Booker T. Washington Technical High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	071	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4337 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1929	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen R.E. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Rosenstrom, S. (possibly Rosenstern)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
DAVIS, ANDREA J			Lynn Josse, Michael Allen, CRO	1/15/2010
3938 SHAW BLVD				43. Date of revisions:
ST LOUIS	MO	63110		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Tapestry brick. High raised basement. Porch has battered brick piers, concrete steps, timbered stucco gable end. Replacement front door is centered between original wooden six-over-one windows.

38.(cont.) History::

1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	022	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4339 ALDINE AV
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):	

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Three-Quarter	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
CENTEX HOME EQUITY CO LLC			Lynn Josse, Michael Allen, CRO	1/15/2010
350 HIGHLAND DR				43. Date of revisions:
LEWISVILLE	TX	75067		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation, replacement doors and windows. Ornamental brick courses run at header and sill levels of window openings. Parapet has elaborate cornice composed of corbelling and terra cotta tiles. 3/4 brick porch rises with brick piers to support gabled roof at entrance; rest is open with metal railing. Segmental arched window openings at second floor; the first floor is square headed.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4339

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	023	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4341 ALDINE AV		
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use: Single Dwelling		Sub-use: Single Dwelling	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Guth, H.W.	Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
	Liebert & Reilley	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Floun, Pearl	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CARR, CHESTER & JAMES EDWARD	Lynn Josse, Michael Allen, CRO	1/15/2010
2934 HEBERT ST #A		43. Date of revisions:
ST LOUIS MO 63107		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Concrete slab stoop with metal railing runs almost the full width of the façade. Brown brick facade; label course follows window and door. Triple window on first floor (left) has six-over-one windows. Two wooden brackets support projecting gable end; shed roof inside of closed pediment under window opening with wooden one-over-one window inside. Three wooden brackets support gable eaves.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	024	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4347 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☒	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Guth, H.W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Liebert & Reilley	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Floun, Pearl	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SEC OF HUD	Lynn Josse, Michael Allen, CRO	1/15/2010
5801 E 41ST ST STE 460		43. Date of revisions:
TULSA OK 74135		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☒

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story, gabled, frame garage clad in wooden weatherboard.

28. (cont.) Further description of important architectural features:

Concrete slab stoop with metal railing runs almost the full width of the façade. Brown brick facade; label course follows window and door. Two wooden brackets support projecting gable end; shed roof inside of closed pediment under window opening. Three wooden brackets support gable eaves. First floor openings boarded.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	025	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4349 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	■	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Open porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
HOLMES, RODNEY &			Lynn Josse, Michael Allen, CRO	1/15/2010
4349 ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of the two-story brick house is painted. Replacement doors and windows. Flat-roofed front porch (left) is brick. Ornamental brick courses at sill level on each floor; splayed brick headers topped by ornamental courses. Cornice formed by corbelling and terra cotta tiles.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4349

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	626	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4353 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COOK, FRANK S JR, MARY ANN JENKI	Lynn Josse, Michael Allen, CRO	1/15/2010
8112 PERSHING AVE		43. Date of revisions:
ST LOUIS MO 63105		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is one of at least five house built in a row with empty lots between them (now built on). The red brick porch is a post-1909 Craftsman era addition with battered brick piers, wrapped metal soffit and eaves. Wooden door (incompatible replacement) in left bay and windows remain on house. Small window opening to left of entrance is boarded. Ornamental brick courses at sill level of window openings; arches have pronounced headers. Corbelling forms cornice on shaped parapet that wraps the corners. Slight stepped parapet appears to be a later historic addition.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:
1943 Negro Directory: Laura Howard, Divoll School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	027	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4357 ALDINE AV
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912	Hartman, John	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, John	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Dittmeier, Frank L.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☒

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story brick house has a shaped parapet with central peak and outer blocks. Bracketed shed-roofed hood is over entrance at brick and concrete stoop, left. Openings are boarded.

38.(cont.) History::

1927 Red-Blue Book:
1930 census:
1943 Negro Directory: B. Alfred Cox, Vashon High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4357
NO
TRESPASSING

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	028	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4359 ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone and concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s): 1925
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop and hood	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912	Hartman, John	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, John	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Dittmeier, Frank L.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, DOROTHY	Lynn Josse, Michael Allen, CRO	1/15/2010
4359 ALDINE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

It appears that this house was similar to 4357 Aldine until a large front addition was built in 1925. like the house to the east, the façade is brick and the front door is at the left bay under a bracketed shed-roofed hood. The right bay is a projecting volume on a high imitation stone veneer base right at the sidewalk. Bakery brick accents are on its stepped parapet and at header course over the window opening. Replacement windows and door.

38.(cont.) History::

Front addition permit: 11/5/1925 to R.O. Wright for addition ($800); A. Fletcher, architect and J.R. Steele, builder. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4357
TRESPA ING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	029	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4218 W ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1897		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Brueggemann, H.F. (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
LRA			Lynn Josse, Michael Allen, CRO	1/15/2010
330 N 15TH ST				43. Date of revisions:
ST LOUIS	MO	63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

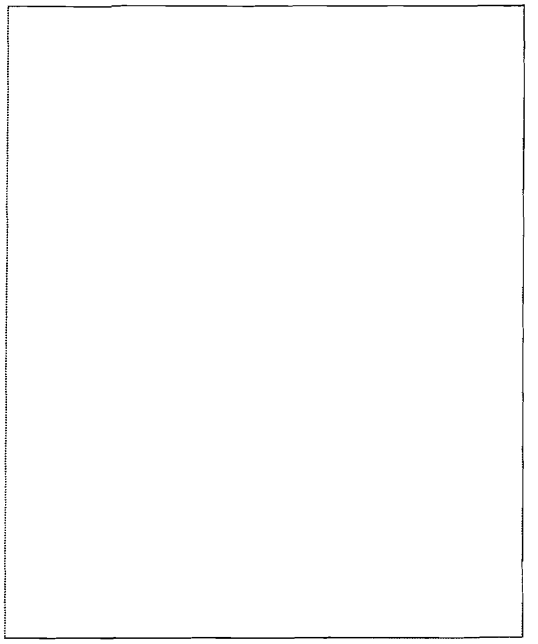

Site Map/plan (include north arrow):

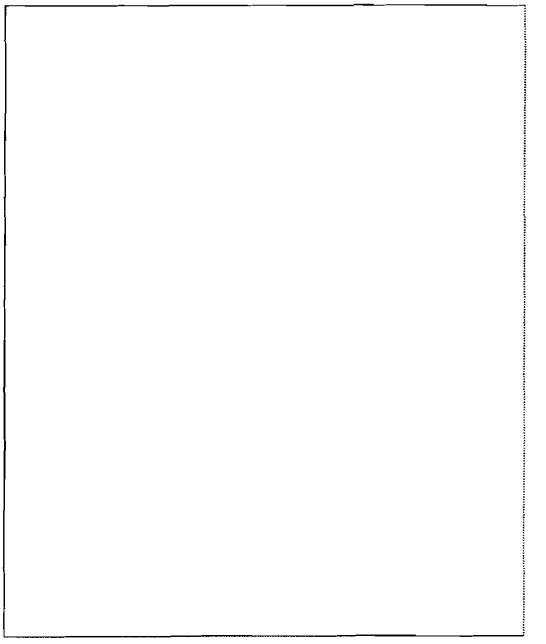

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This one-story flat-roofed brick house has a shaped parapet with buff terra cotta coping and decorative brickwork under the parapet. The window openings are boarded in the two window bays. The steps and porch are missing, but the door opening is partly unboarded to reveal the original configuration of a door and right sidelight.

38.(cont.) History::

1920 census: Anna Bosse is a naturalized German-speaking Dane who lives with her son and 2 grandsons, white, son is a riveter/steelworker; 4218Wa:Joseph Howard and his sister Julia, white renters age 79 and 72, he is listed as a real estate speculator
1927 Red-Blue Book:Suggs, Clarence (Viola)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	036	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4219 W ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1905	Jones, P. D.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Jones, P. D.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jones, P. D.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MITCHELL, EDDIE L & ETAL	Lynn Josse, Michael Allen, CRO	1/15/2010
4219 W ALDINE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

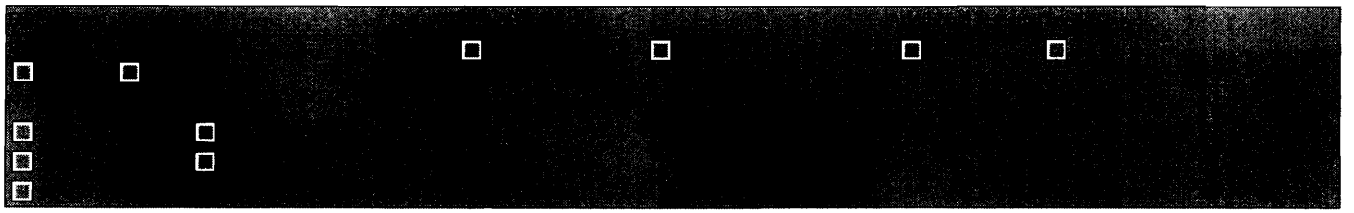

Architectural/Historic Inventory Form

Location Map (include north arrow):

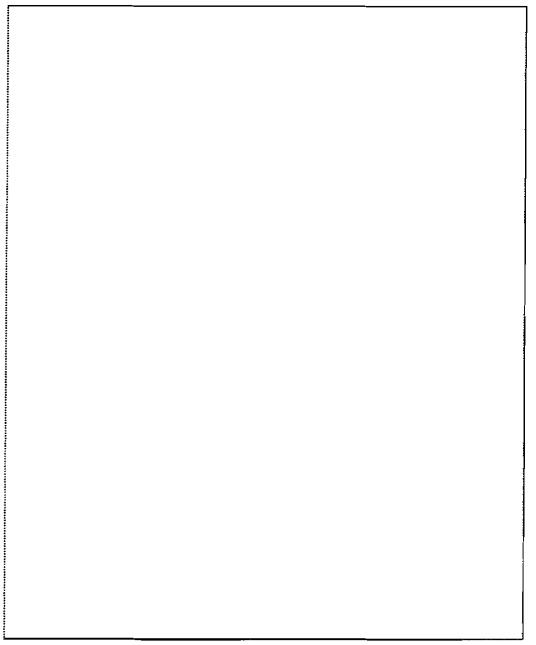

Site Map/plan (include north arrow):

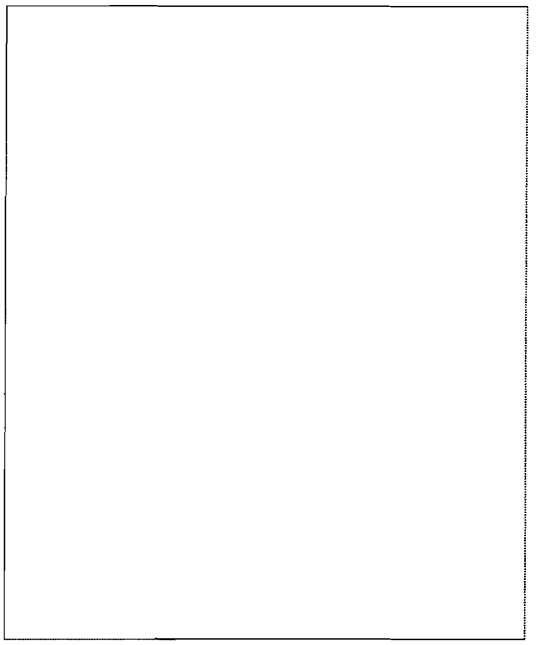

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this two-story flat-roofed brick building has a brown brick base and a red brick body separated by a painted limestone course. Concrete steps lead to the brick porch, which has a hipped roof. The two door openings have metal storm doors. On the first floor, there is one window opening to the right of the porch; on the second floor, there are three openings. Band courses of patterned brick run continuous on the front wall to highlight the Roman arches of the openings. There are wooden one-over-one windows behind ill-fitting metal storm windows. The shaped parapet wall has been rebuilt in a different (lighter) brick and has buff terra cotta coping.

38.(cont.) History::

1920 census: John & Ida Horrell & daughter, renters, black, he's a janitor and daughter is an elevator operator. And, Wm. And Sylvia Lee, black, renters, he's a Pullman porter.
1927 Red-Blue Book: Lee Wm H (Sylvia); 4219Wa: Wilke Everett (Callie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	c 31	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4232 W ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (NC)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Abrams, S., & Sons	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Abrams, S., & Sons	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Abrams, L. (orig. own.)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PEETE, MELVIN & KAWAUNEE	Lynn Josse, Michael Allen, CRO	1/15/2010
4232W ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a modern, one story, flat-roofed concrete masonry unit garage. (noncontributing)

28. (cont.) Further description of important architectural features:

This two-story flat-roofed brown brick building is divided into two bays. The left bays feature paired six-over-one wooden windows in each opening, while the right bay features a balcony door over the paired historic-era wooden entrance doors. A brick porch at the entrance has concrete steps and brick piers supporting a metal-railed balcony. There are limestone pieces at the head corners of the openings and a shaped parapet.

38.(cont.) History::

1927 Red-Blue Book: Seays Louis (Rose) 4232a Boykin Lonnie (Delia)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	032	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4236 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Abrams, S., & Sons	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Abrams, S., & Sons	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Abrams, L. (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
SMITH, DONEVIA & KEVIN R JONES			Lynn Josse, Michael Allen, CRO	1/15/2010
4237 W ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story flat-roofed brown brick building is divided into two bays. The left bays feature paired one-over-one wooden windows in each opening, while the right bay features a balcony door over the paired wooden entrance doors. A brick porch at the entrance has concrete steps and brick piers supporting a metal-railed balcony. There are limestone pieces at the head corners of the openings. Presumably the building once has a parapet wall like its neighbors to either side, but the front parapet is now flat.

38.(cont.) History::

1927 Red-Blue Book: Tennyson geo (Gertrude); Thomas Roy L (Evelyn)
1930 census: 1943 Negro Directory: Nan E. Walton of Sumner High School (however, Wirt Walton is listed at 4236 Aldine, not W Aldine)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C33	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4238 W ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1926	Abrams, S., & Sons	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Abrams, S., & Sons	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Abrams, L. (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SUMMERS, MELVIA	Lynn Josse, Michael Allen, CRO	1/15/2010
4238 W ALDINE AV		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

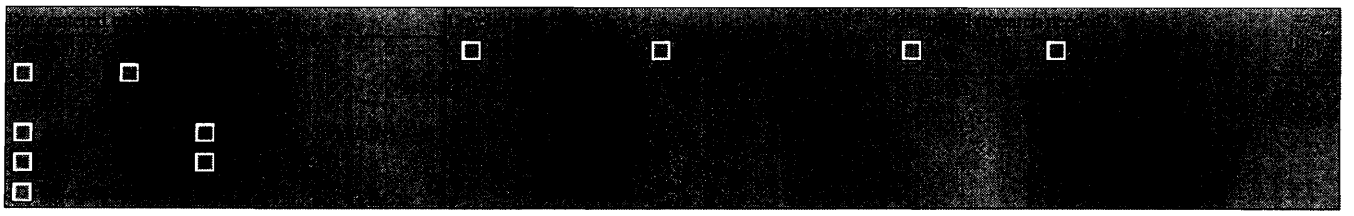

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story flat-roofed brown brick building is divided into two bays. The left bays feature replacement one-over-one vinyl windows in each opening under metal awnings, while the right bay features a balcony door over the paired wooden entrance doors. A brick porch at the entrance has concrete steps and brick piers supporting a metal-railed balcony with a metal shed roof. There are limestone pieces at the head corners of the openings and a shaped parapet with a wide center step and end blocks.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	634	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4242 W ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1904		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Lloyd, H., B. C. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
HUGHES, GIBB, JR			Lynn Josse, Michael Allen, CRO	1/15/2010
4242 W ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

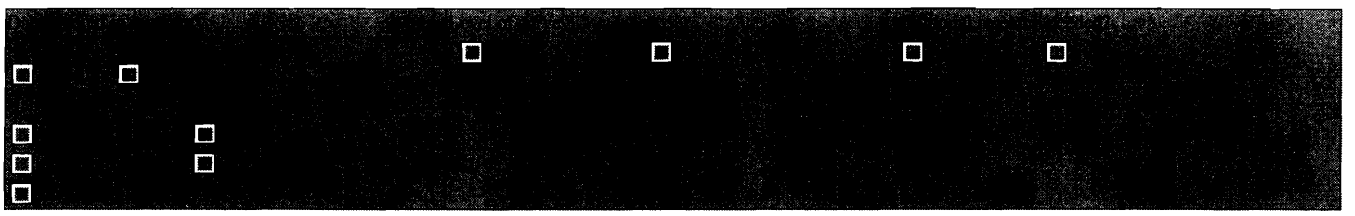

Architectural/Historic Inventory Form

Location Map (include north arrow):

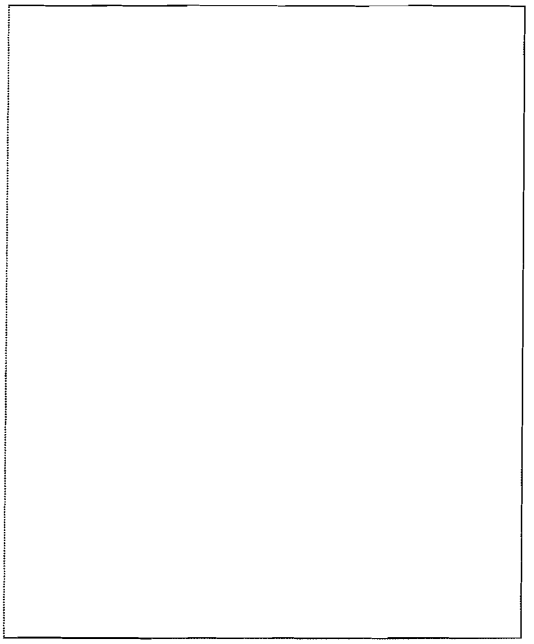

Site Map/plan (include north arrow):

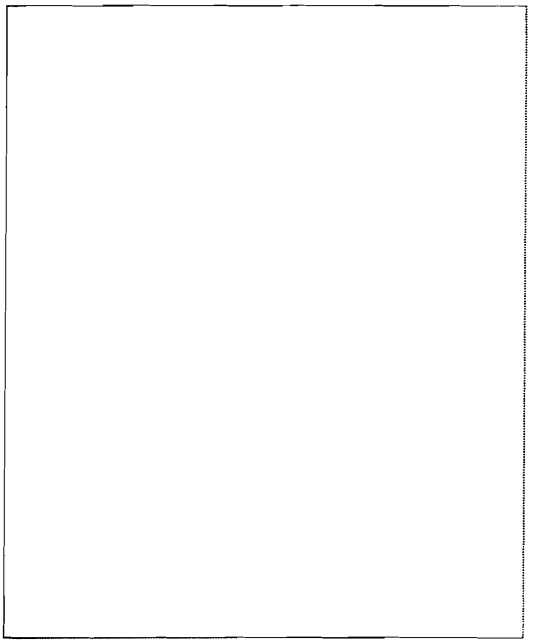

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a two-story flat-roofed painted brick house with smooth stone foundation. There is a metal cornice that forms a pediment over the entrance bay and provides coping. Decorative brickwork spans the front elevation below. There are two window bays at left and a slightly projecting entrance bay at right with Roman arch entrance and window opening above. The entrance leads to a recessed stoop and two door openings with wooden doors. The second floor windows are wooden one-over-one windows while the first-floor windows are wooden two-over-two windows.

38.(cont.) History::

1904 builder: Lloyd, H., B. C. Co. 1920 census: Howard and Susie Jones, renters, black, he's a laborer at electric co; 4242wa:Bessie Eaton, 3 grown children and 12-y-o nephew, renters, black, Amary Eaton is a public school teacher, Lizzie a college telephone operator, and Albert is a laborer.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	035	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4251 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1906	Pomeroy, C. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Taylor, R.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Taylor, R.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JACKSON, MATTIE B	Lynn Josse, Michael Allen, CRO	1/15/2010
4251 W ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

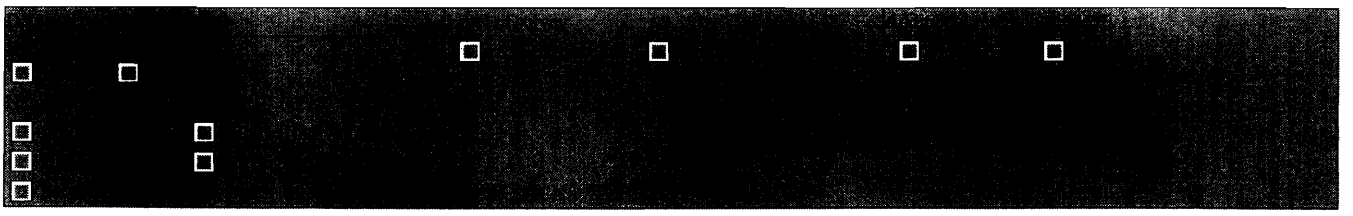

Architectural/Historic Inventory Form

Location Map (include north arrow):

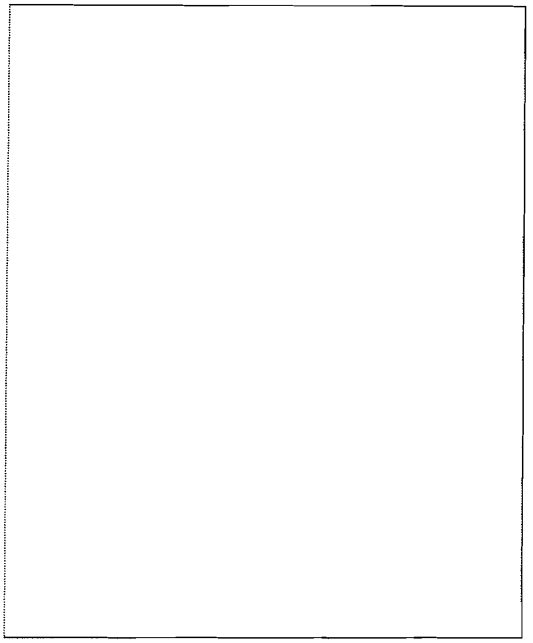

Site Map/plan (include north arrow):

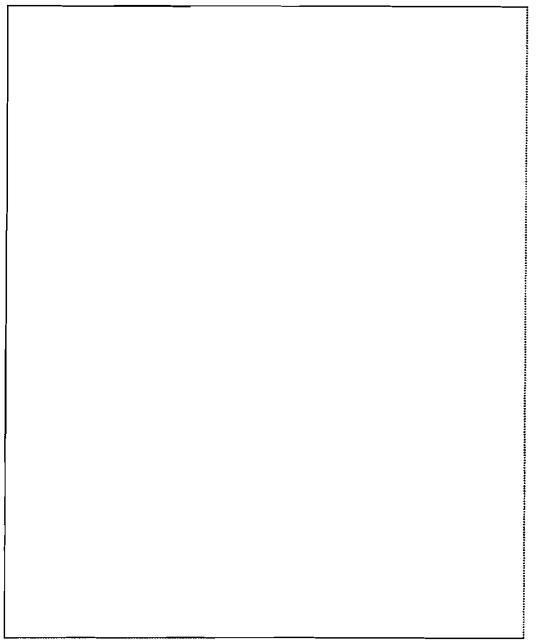

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a one-story flat-roofed brick house with a metal cornice and metal coping. A wooden shed-roofed porch rests on a concrete base with concrete steps. The entrance opening has been partly infilled around a replacement door. To the right of the porch is a window opening with paired one-over-one windows and stone sill and lintel. The basement window is below. The parapet wall is flat.

38.(cont.) History::

1920 census: Macon and Martha Bell and his mother and sister, owners, black, he's a laborer in a steel mill.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4251

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	636	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4253 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Second Empire	Load-bearing Brick	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1903		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Granmeyer, Henry	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Wolff, Gerrard (orig owner)	
0	Evans, John W.	37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, BETTYE A	Lynn Josse, Michael Allen, CRO	1/15/2010
4253 W ALDINE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

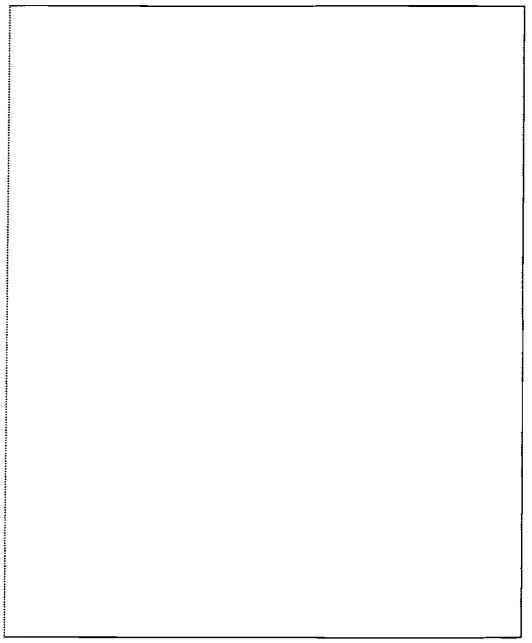

Site Map/plan (include north arrow):

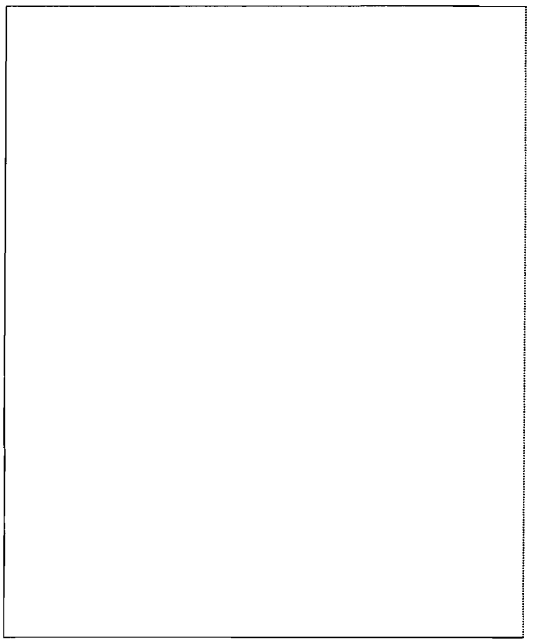

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story flat-roofed painted brick house has the second floor of the front elevation treated as a mansard roof sloping off to the right with a parapet at left. A modest brick cornice is below. There is a full brick porch rising to a gabled cover at the entrance, but with stone entrance steps at the other side leading to the sidewalk. The entrance is left of two window openings carrying replacement one-over-one windows. Two wooden dormers with pediments on the painted slate-clad mansard have openings containing similar replacement windows.

38.(cont.) History::

1920 census: Evans, John and Leona, own, black, mortgage, he is a public school principal and she is a Provident Assoc. investigator.
1943 Negro Directory: John W. Evans, Principal of Lincoln School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	037	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4255 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S.

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1899		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	O'Neill, James R.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	O'Neill, James R.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SHEPARD, MARY ALICE	Lynn Josse, Michael Allen, CRO	1/15/2010
4255 W ALDINE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

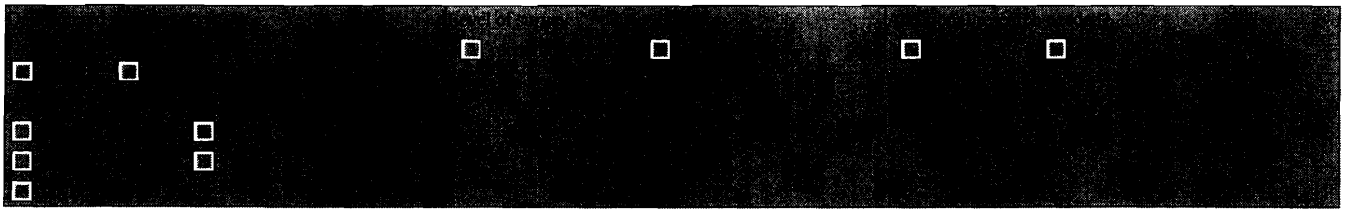

Architectural/Historic Inventory Form

Location Map (include north arrow):

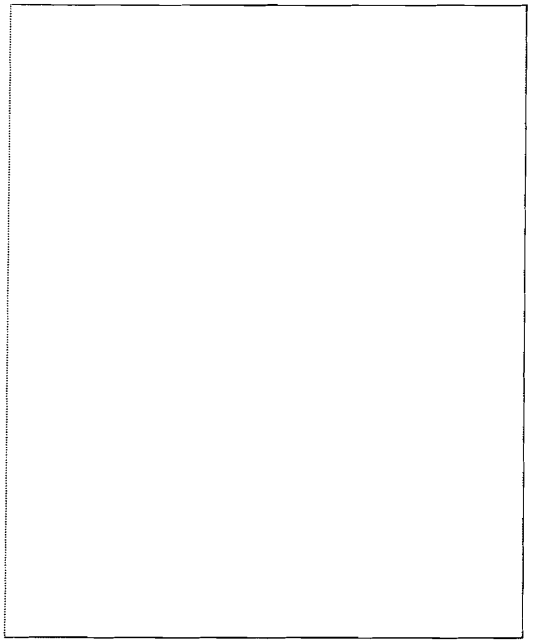

Site Map/plan (include north arrow):

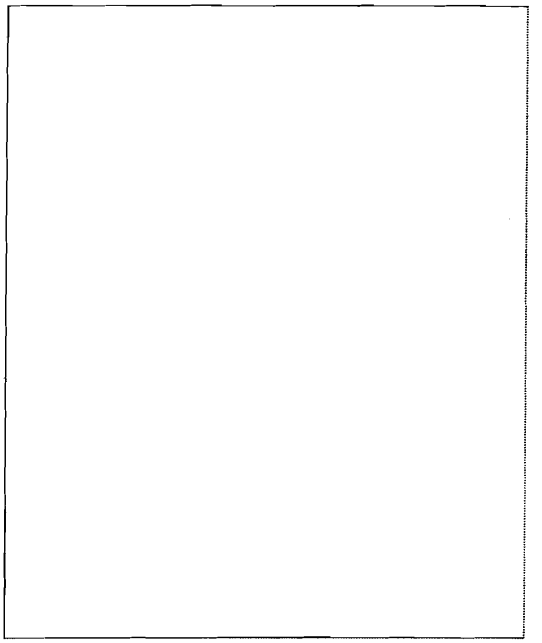

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this two-story brick building is painted. The brick porch, left, has a hipped roof; underneath is a dentil cornice that wraps all three sides. The two entrance doors have been replaced. The large first floor window opening and three second floor Roman arch window openings all contain wooden one-over-one windows. Raised courses of pressed ornamental brick outline the arches. A limestone course with decorative brick course beneath forms continuous sill for the three second floor openings. There is decorative brickwork with terra cotta tiles above the third floor.

38.(cont.) History::

1920 census:3 households at this address: Wilkinson, William, widower with 3 children, and a couple named Johnson, and a family named Jameson (?). all black, all renters. The 3rd family has a 17 year-old niece living with them.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4255

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	036	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4256-60 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Classical Revival	Load-bearing Brick	
(b) 6-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
5	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1904	Ridington, A. B.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Rychlicki Bros.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
LRA			Lynn Josse, Michael Allen, CRO	1/15/2010
330 N 15TH ST				43. Date of revisions:
ST LOUIS	MO	63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Bracketed wooden cornice runs along front elevation and wraps sides. Significant masonry articulation. Second bay from left is projecting with double Roman arch openings leading to recessed entrances; above, parapet rises to pediment with decorative circle in brickwork. Single entrance at right has jack-arch opening. Entrances have stone steps. All window and door openings boarded. Stone peaked lintels over basement openings.

38.(cont.) History::

Nidalia Realty Co. is owner on 1904 permit 1920 census: Josephine Asler (?) and two daughters, renters, black, daughters both laundresses; William and May Allen and two children, black, renters, he is a private janitor and daughter Lola age 20 is a "trained nurse" at City Hospital.
1927 Red-Blue Book: Henry, Greely (Dora); Allen, William L.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	037	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4257 W ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1901	Lucas, W. A.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Cox, Jos.	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Desreisceaux, M. E. (orig. owner)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
RIVERS, KIM			Lynn Josse, Michael Allen, CRO	1/15/2010
11473 WITHERSFIELD				43. Date of revisions:
ST LOUIS	MO	63138		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

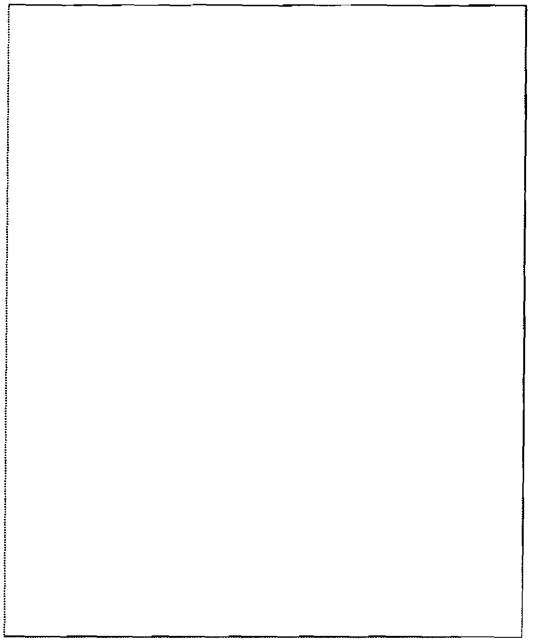

Site Map/plan (include north arrow):

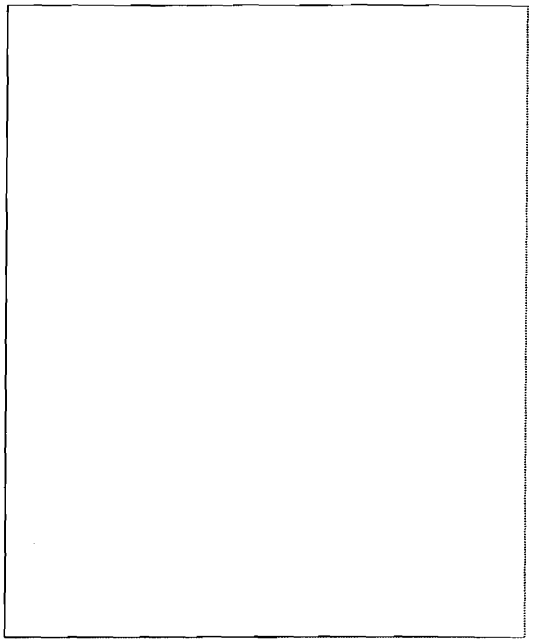

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This three-bay brick house has a buff brick façade and red brick side elevations. The front porch, left, is really a concrete stoop with metal uprights supporting a corrugated roof. Wooden one-over-one windows remain in the façade's five segmental arched window openings. Decorative brick courses form outlines for segmental arches. The front parapet is rebuilt in red brick, likely replacing a cornice and/or shaped parapet with a plain flat wall.

38.(cont.) History::

1920 census: Moore, Walter and Fern and son, his mother, 3 boarders. He's a waiter in a private club and she's a waitress in a restaurant; boarders are porters (2) and a messenger.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C46	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4263-7 W ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership	11. Historic Use (if known):	11. Present Use:
Public		
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 6-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1905	Duffner and Strecker	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Duffner and Strecker	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Duffner and Strecker (orig. owners)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This 6-bay brick building has a red brick façade. The recessed openings, each formerly holding a pair of doors, are at the second, fourth, and fifth bays. Heavy stone course between basement and first floor. Heavy stone lintels over three entrance opening. Masonry articulation includes two Roman arch windows at center of second floor and shaped parapet. Wooden one-over-one windows remain. The entrance and the right window of the first floor are boarded.

38.(cont.) History::

1920 census: Rice, Salina, black renter with mother, daughter, and son. Salina, a 26-y-o widow, is a laundress for a private family. 4263a: Dunham(?), Lennrd? and Gertrude and his mother, black renters, he's a porter in a public building.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4261

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	041	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4264 W ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1905	Brumer, Casper P. (orig own)	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Brumer, Casper P. (orig own)	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Brumer, Casper P. (orig own)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LEWIS, ROBERTA & IDA B JORDAN ET	Lynn Josse, Michael Allen, CRO	1/15/2010
4264 W ALDINE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story brick building has a red brick façade. At the right bay, concrete piers of porch rise to support metal balcony railings. The two front doors appear to be midcentury replacements; the balcony door and its transom both appear to be multilight originals. At both stories of the left bay is a single 1/1 replacement window in a segmental arched opening. Shaped parapet with end blocks is partially rebuilt over openings.

38.(cont.) History::

Owner is listed as Casper Brown elsewhere. 1920 census: William and Eva Chambers and nephew and two roomers, black, renters; he's a barbershop porter, roomer is a brickyard laborer, all 5 from Florida. 4264a: Nelson and Cora Brown and sister in law Pearl Houston and her 3 kids; he's a Pullman Porter with west Indian father; Pearl is a housemaid. (black, renters)
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4264W

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	042	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4268 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1906	McMahon, Wm. P.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Lee, Jos. R. (orig own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

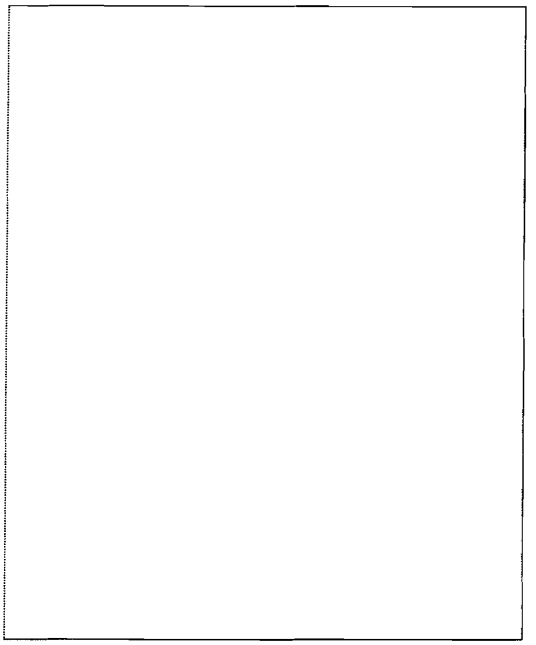

Site Map/plan (include north arrow):

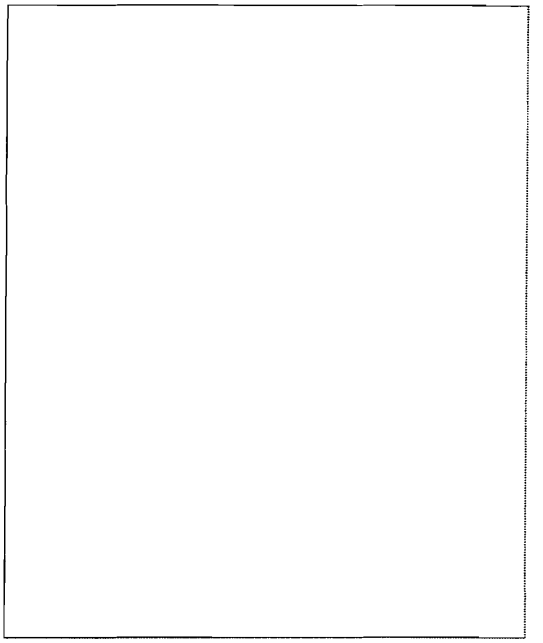

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This red brick building has a painted brick façade. Stone steps lead to the porch at the right bay. Concrete piers and balcony structure replace the original, but the brick knee walls of the porch remain intact. At the balcony is a projecting bay with what appears to be a Craftsman-era multilight door (perhaps original) with a 1/1 wood window to either side. At the left bay two 1/1 wood windows are at each story. The first floor windows are round d-arched originals, and their arches form an arcade. The gabled dormer on mansard roof has wooden brackets, soffits and fascia. A steep roof which slopes towards the façade is a false front.

38.(cont.) History::

1920 census: Walker, George and Cornelia and three roomers (couple with baby), all Mu, renters, George is a waiter and roomer Albert Coffrers? Is a machinist; 4268a:Simon and Sophie Martin, Mu renters, he's a chauffeur.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	093	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4270 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S.
St. Louis, MO	☒	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Parged Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1929	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen Realty Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Rosenstern, S. (orig own.)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, WILLIE MAE & RUBEN			Lynn Josse, Michael Allen, CRO	1/15/2010
4270 W ALDINE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This red brick building has a dark brick façade with buff brick highlights. The full width front porch has limestone piers and brick knee walls; the piers carry a second story balcony. Historic wooden front doors are at opposite ends of the façade with a pair of wood 6/1 windows between them. At the second story, three metal poles support a metal awning over the balcony. The center balcony door is flanked by narrow 4/1 windows, and a 4/1 is at the outer bays as well. Buff brick surrounds the balcony door and its two side windows and rises to form and arch with stacked header fill. The parapet wall has a center peak.

38.(cont.) History::

1930 census:
1943 Negro Directory: Anna R. Moten, Turner School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	044	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4272-8 W ALDINE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Undetermined	
(b) Double-loaded Corridor		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1	None	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gable Hip or Gablet		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1956		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Prosperity Const. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hamilton, Florice (orig own.)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
QUARLES, GEORGE	Lynn Josse, Michael Allen, CRO	1/15/2010
43 LEWIS PL		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☒ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Modern building presents side elevation to Aldine and has a long gallery-style porches on west elevation. Brick body with wooden siding at second floor between windows. Some stylized multi-light windows with staggered dividers.

38.(cont.) History::

owner and builder at same address

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	645	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4279 W ALDINE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Guth, H. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Liebert and Reilley	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Floun, Pearl	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
REVITALIZING ST LOUIS LLC	Lynn Josse, Michael Allen, CRO	1/15/2010
3208 LEISUREWOOD CT		43. Date of revisions:
FLORISSANT MO 63033		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

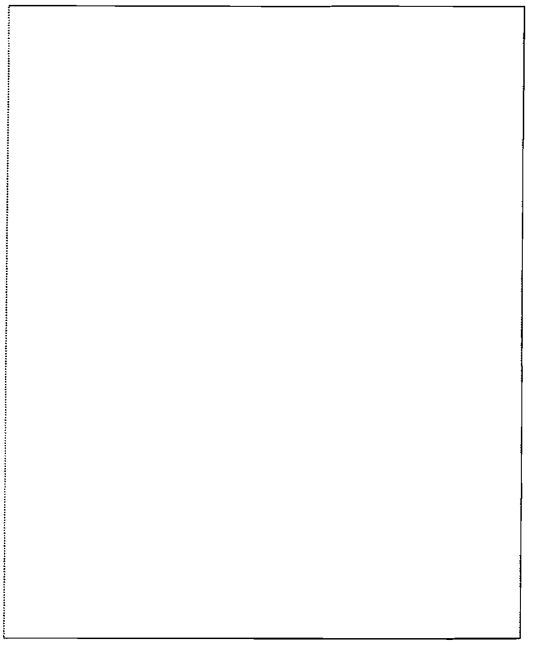

Site Map/plan (include north arrow):

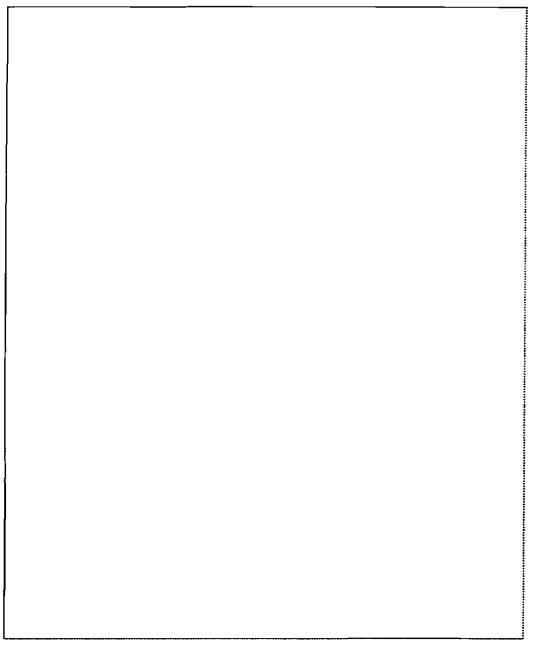

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story house has a variegated brick exterior. The concrete stoop runs under the front door (right) and window, but does not extend all the way to the left end of the façade. Brown brick label course follows wide jack arch window and door openings (boarded). Gable end is recessed in closed pediment, and three ornate wooden brackets remain under deep overhang. Gable opening window missing.

38.(cont.) History::

1927 Red-Blue Book: Douglas Charles P (Octavia)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	046	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4281 W ALDINE AV
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☒	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Flower, J. H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SHUMATE, DORIS L	Lynn Josse, Michael Allen, CRO	1/15/2010
6231 PAGE BLVD		43. Date of revisions:
ST LOUIS MO 63133		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This red brick house has a wide front door opening at the left, new boarded. The entrance and the three window openings on the façade are all segmental arched. The windows are missing sash and most the related wood casings; the first floor window is also missing half of its stone sill. The 1909 Sanborn map indicates the presence of a full-width frame porch. In its absence, the courses under the second story window are parged and the base of the façade is common brick. Brick corbelling at cornice.

38.(cont.) History::

The two now demolished houses in the same row were dated 1890 by the Bldg. Div. certificates, although there was not a certificate for this bldg. 1920 census: Baiser?, Don, Bettie and daughter, renters, black, he's a laborer in the field of Building.
1927 Red-Blue Book: Howard, Emanuel (Alice)
1930 census:
1943 Negro Directory: Vera C. Howard, West Belle School, and Dorris T. Rhea, Dunbar School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING
4281
Last Friday
of Month
8:30 to NOON

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	047	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1700 ANNIE MALONE DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Commerce/Trade	Vacant/Not in Use
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST, SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

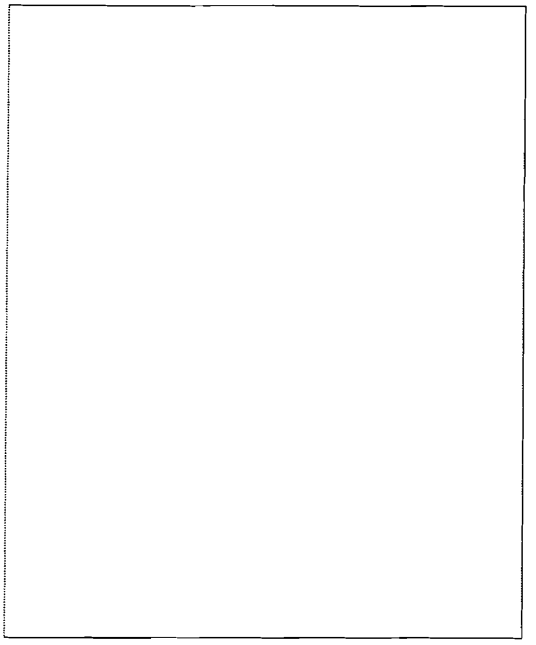

Site Map/plan (include north arrow):

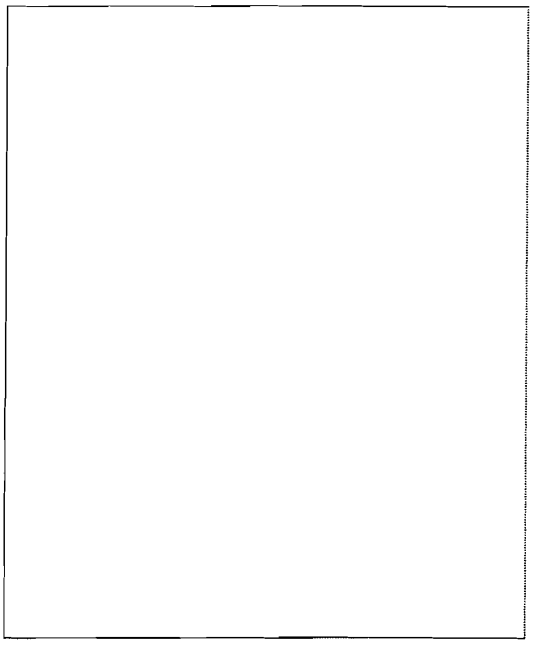

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story building has a cast iron storefront system with metal cornice. Behind a cast iron corner pillar at the left bay, the front entrance or entrances were located. Storefront altered through infill. Window openings on both floors altered for replacement windows. Front parapet shows signs of being rebuilt.

38.(cont.) History::

1920 census: Brown, Henry and Laura and 2 children; renters, white, he is nat. German, and it looks like he's a grocery showman with own business (?)
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

TOTALLY
COMMITTED

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	648	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1706 ANNIE MALONE DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Stucco	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1888		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Freudenstein, John (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NORTHSIDE COMM HOUSING IV LLC	Lynn Josse, Michael Allen, CRO	1/15/2010
4120 MAFFITT AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This house, like its near-twin next door at 1708, has a raised basement with a separate front-facing door under the front porch. The house's stone front is stuccoed and painted. At the left bay, a replacement front door is at the open gabled frame porch. The wider right bay projects slightly. Paired windows with a decorative mullion are at the basement, and triple window with segmental arched transom is at the first floor. The windows are metal one over one replacements behind storm windows. The front parapet wall's sections are defined by slightly projecting blocks.

38.(cont.) History::

1920 census: Fearance, Wilson and Carrie and son , William is a railroad car cleaner, and son Edw is a 26-y-o editor with own business. Boarder Wm Campbell is a chauffeur. They move to 4210 Aldine later
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0471	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1708 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM:
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Stucco	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☐ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☐ Altered Date(s):
Flat	open Porch	☐ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☐ Other Date(s):
	Visible from public road? ☐	Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☐
1888		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
	Freudenstein, John (orig. own.)	
0		37. National Register eligible?
		☐ Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PURTTY, MARILYN	Lynn Josse, Michael Allen, CRO	1/15/2010
3838 ST LOUIS		43. Date of revisions:
ST LOUIS MO 63107		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This house, like its near-twin next door at 1706, has a raised basement with a separate front-facing door under the front porch. The house's stone front is stuccoed and painted. At the left bay, a replacement front door is at the open gabled frame porch. The wider right bay projects slightly. Paired windows with a decorative mullion are at the basement, and a replacement pair with an almost-segmental arched transom is at the first floor. At the top of the façade, an applied gable modernized the façade in the 1910s or 20s. Its peak is above the line of the parapet wall, and it is painted to resemble a half timbered wall.

38.(cont.) History::

1920 census: Parker, John and Mary, own free, black, he's a lumber inspector; 2 brothers in law are a railroad laborer and a bank porter.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	c 50	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1713 ANNIE MALONE DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type.	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WEBB, GEORGE	Lynn Josse, Michael Allen, CRO	1/15/2010
11392 BRISTOL ROCK RD		43. Date of revisions:
FLORISSANT MO 63033		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This former two-family building's façade is red brick above a cut stone foundation. Behind a rounded off segmental arched opening at the right bay, the entrance is converted to a single door opening. Façade windows have stone sills with consoles. The wider windows at the slightly projecting left bay (including basement) retain wide decorative wood mullions. Limestone accents and ornamental brick course form cornice on the parapet, a historic-era alteration.

38.(cont.) History::

The two now demolished houses in the same row were dated 1890 by the Bldg. Div. certificates, although there was not a certificate for this bldg. 1920 census: 2 renter couples, one with a boarder; black; Mr. Dixon is a glazier; boarder is a maid; Mr. Wilson is a porter at YMCA. 1713a: 2 households, black renters, inc. a railroad clerk, drugstore porter, and dept. store maid.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	051	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1715 ANNIE MALONE DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s)
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Recessed 1-story	■ Moved Date(s):
18. Roof Material	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
AFTAB, EMAD & ROMANA	Lynn Josse, Michael Allen, CRO	1/15/2010
1715 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-family building's façade is red brick above a rusticated stone foundation. Behind a rounded-off segmental arched opening at the right bay, two replacement doors retain transoms. Façade windows have stone sills with consoles. The wider windows at the slightly projecting left bay (including basement) retain wide decorative wood mullions. The parapet has been rebuilt without a cornice but retains pressed brick courses.

38.(cont.) History::

1920 census: a 42-y-o-woman and an unrelated couple at 1715, and at 1715a two unrelated households, 7 people total; including a meat cutter, porter, hair cutter with own business, maid
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	052	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1722 ANNIE MALONE DR
E. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☐ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☐ Altered Date(s):
Flat		☐ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☐	☐ Other Date(s):
		Endangered by: Rear wall collapse

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☐
1887		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
	Jack, John (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST 12TH FL		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This painted brick single story building has two boarded windows in segmental arched openings at the façade. The front door (also boarded) is at the south (right) elevation. Intact wooden bracketed cornice on front elevation wraps onto south elevation. Window openings are boarded. Rear wall has collapsed.

38.(cont.) History::

1920 census: McKinnon, Arthur and (?), 7 children; black renters; he's a brickyard fireman; 2 sons are foundry laborers and one daughter is an elevator operator.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO
TRESPASSING
1722

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	053	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1726 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Religion
	Sub-use:	Sub-use: Religious Facility

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Gabled End Church		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable		☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GREAT DAY MISSIONARY BAPTIST CH	Lynn Josse, Michael Allen, CRO	1/15/2010
1726 ANNIE MALONE DRIVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This front gabled brick church is painted white. The front gable end is covered with modern horizontal siding. Modern double doors are centered below a transom. Round-arched window openings on front elevation, lancet-arched openings on sides. Original windows and mullions. Flat-roofed addition at rear is in place for the 1909 Sanborn map.

38.(cont.) History::

1909 Sanborn: the footprint is the same, but this is shown as a store.
1920 census:
1927 Red-Blue Book: McPheeters Memorial Presbyterian Church
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

GREAT DAY PB CHURCH
1726
ANNIE MALONE
ONE WAY

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	054	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1800 ANNIE MALONE DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Foursquare		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1920	Schumacher, S. O.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HARRIS, EDWYNNA L	Lynn Josse, Michael Allen, CRO	1/15/2010
1800 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

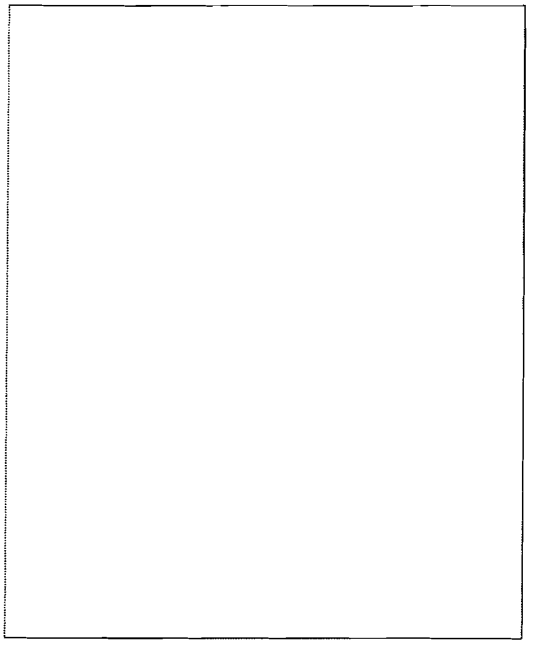

Site Map/plan (include north arrow):

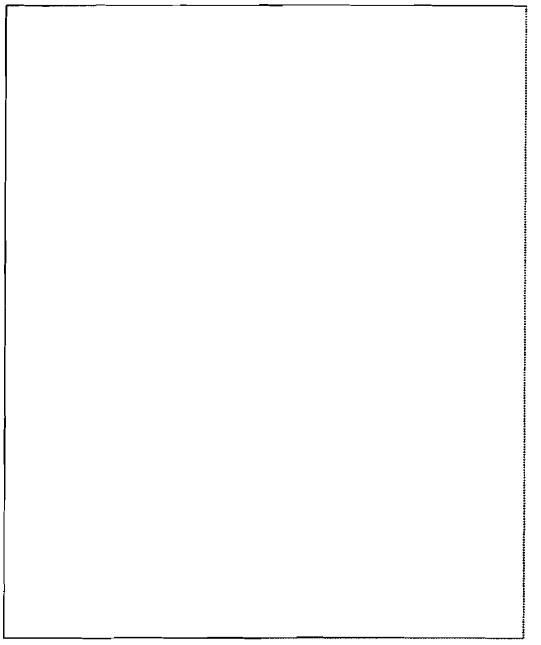

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled brick garage with timbered gable ends (contributing).

28. (cont.) Further description of important architectural features:

This front gabled house is faced with brown machine-rolled brick. The full-width brick porch has a gabled roof. Wood brackets support eaves at porch and main gable ends. Both stucco gable ends have vertical timbering. Original wooden entrance retains door and sidelights. Paired wood six-over-one windows remain at the second story. The triple window at the first floor has a six over one window flanked by four over one windows. Row of four six-pane casement windows in gable end.

38.(cont.) History::

5/19/1920 permit to owner F. A. Carter, $8000
1927 Red-Blue Book: Carter, Frank A. (Ella)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	655	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1804 ANNIE MALONE DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Two-story Victorian House With Side		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Side stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GATHRIGHT, RICHIE DEAN &	Lynn Josse, Michael Allen, CRO	1/15/2010
1819 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This red brick house has a painted coursed limestone base. The four façade openings are segmental arched (bearing replacement 1/1 windows). Window opening arches have pronounced brick headers and stone sills with brackets. Ornamental brick course, dentillation and metal coping form cornice. The transomed door is at the right elevation (south) at a concrete stoop with unpainted wood steps.

38.(cont.) History::

1920 census: Manter???, James and Lula, daughter, niece and nephew, black, renters, he's a Horse shoer (works on own), she is a seamstress for private family, nephew is porter for car shed, and niece is maid for private family
1927 Red-Blue Book:perkins
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1504

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	056	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1806 ANNIE MALONE DR

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1925	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
GROOMS, MAMIE			Lynn Josse, Michael Allen, CRO	1/15/2010
601 N DONNIVAN				43. Date of revisions:
PRINCETON	KY	42445		

FOR SHPO USE:

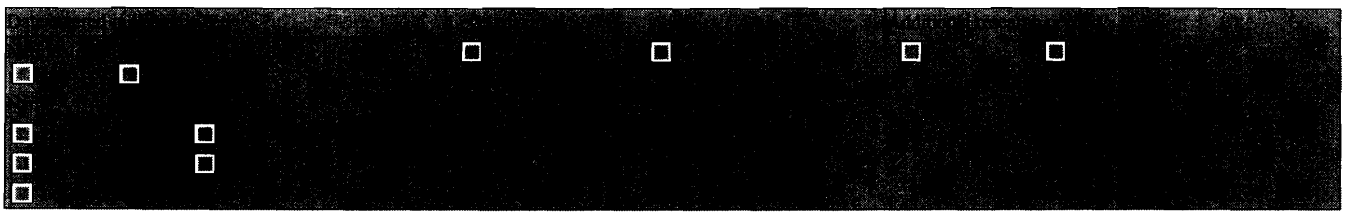

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story, gabled, concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

This single story house has a variegated dark brown brick exterior, with contrasting soldiers and stretchers as label around front door, which is off-center to the right. Replacement door and single 1/1 window to either side. Hipped dormer has a single-pane window.

38.(cont.) History::

1925 owner: Sam Floun
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

FOR SALE
1806
LOOK! GREAT STARTER HOME

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	057	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1809-11 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
T-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NORTHSIDE COMM AFFORDABLE HOU	Lynn Josse, Michael Allen, CRO	1/15/2010
4120 MAFFITT		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this red brick four-family building has a coursed stone foundation. At the center two bays, two rectangular openings lead to two (replacement) doors each, set back facing each other at an angle. All four doors retain transom windows. The segmental arched window openings (four at the first story and six at the second) have stone keystones and sills with consoles. Bracketed wooden cornice with ornate fascia. Replacement doors and windows, and contemporary high wooden front steps. There are entrances at the basement level behind the wooden skirt of the steps.

38.(cont.) History::

1920 census: Edwards(?) Almas and 2 children, black, renters, son Ernest is a clerk for Mail H??, and daughter May is a saleslady for Wholesale Co.; 1809a: Washington, Page and Mary, black, renters, his job is "jobber and repairs - general work".
1811 and 1811a: The Branches and the Morrises, two black renter couples, one a chauffeur and one a janitor.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	058	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		1810 ANNIE MALONE DR		
5. City/State	Vicinity:	6. UTM:	7. Township/Range/Section	Not Applicable
St. Louis, MO	☐		T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ATWATER, JOSEPH C	Lynn Josse, Michael Allen, CRO	1/15/2010
1810 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The exterior of this brick building is painted white. Painted, rusticated stone foundation. Window openings infilled with brick around metal replacement windows (1969). The top of the recessed entry at left bay is infilled with vinyl siding; door opening boarded. Bracketed wooden cornice with ornate fascia wraps the corners.

38.(cont.) History::

1885 owner per certificate: Michael Lee.
Permit 10/22/1969 to owner J. McCain, brick up windows, $800
1920 census: 1810A: Matthew, Wm. and Loretta and their boarder, renters, black, he's a car washer for street car company, she is a hairdresser at home. Boarder (name totally illegible) is a 56-y-o-woman born in AR, and can neither read nor write (unusual). 1810: Thomas and Mary Hill and his brother Bruce, laborer maid and laborer.
1927 Red-Blue Book: Oakley, Ellen, Mrs.; 1810a Matthew Jos B (Loretta)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	059	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1816 ANNIE MALONE DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1908	Colpers, F.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	O'Reilly, Annie	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DAWKINS, WILLIAM E & FLETCHER HO	Lynn Josse, Michael Allen, CRO	1/15/2010
5831 SELBER CT		43. Date of revisions:
ST LOUIS MO 63120		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

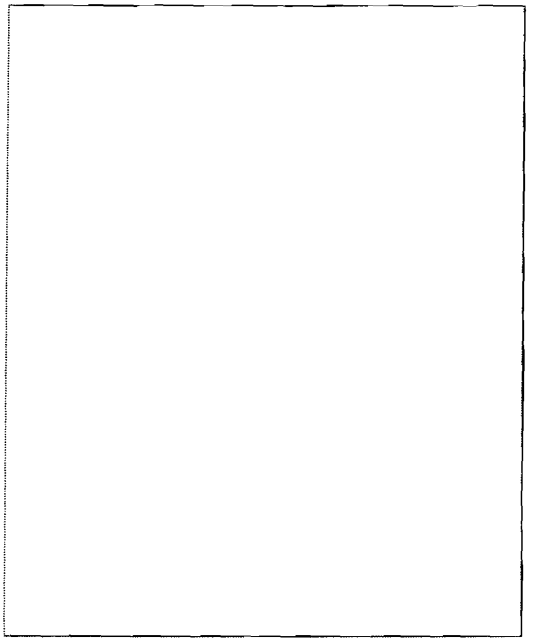

Site Map/plan (include north arrow):

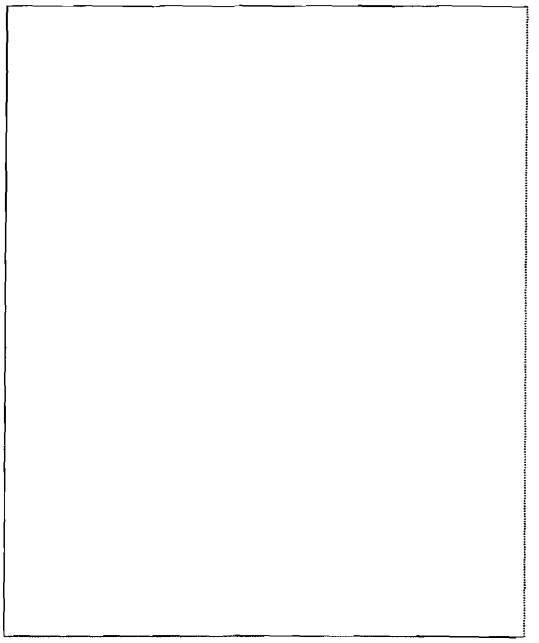

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brick two-family building has a red brick façade above the first story's sill level and a dark brown brick base below it. Recessed courses create pattern around basement windows. Open frame porch, left has historic turned wood columns, but the balcony above has lost its railing. Stone sills on first and second floor window openings at right bay. Replacement windows and doors. Parapet is parged.

38.(cont.) History::

1908 owner: Annie O'Reilly
1920 census: Fraser, Ruben. and Eola, and son, black, renters, he's a post office clerk. 1816a: George and Sarah Bohanen(?), renters, black, he's a janitor
1927: Fraser, R. E. (Eola) 1816a: Terry Laura Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	060	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1819 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1910		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Goodenough, W. E.	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Teschemacher, H. H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HILL, JO GLADYS	Lynn Josse, Michael Allen, CRO	1/15/2010
1819 ANNIE MALONE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brick two-family building has a red brick façade above the first story's sill level and a dark brown brick base below it. At the right bay is a concrete stoop with metal canopy and piers. Both front doors are replacements. Under thick stone lintels, the window openings have been partially bricked in to accommodate later metal slider windows. Corbelled cornice. Shaped parapet with end blocks and center step.

38.(cont.) History::

1920 census: 1819: Bland, James and Exie and son, unclear if they're the owner or renter, black, he is a fireman in office building; 1819a: Meadows, John and Pearl, black, renters, he is a teamster for express co.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	C 6 1	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1825 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Walk-Up (four family)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1924		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Floun, Pearl	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
330 N 15TH ST		43. Date of revisions:
ST LOUIS MO 63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

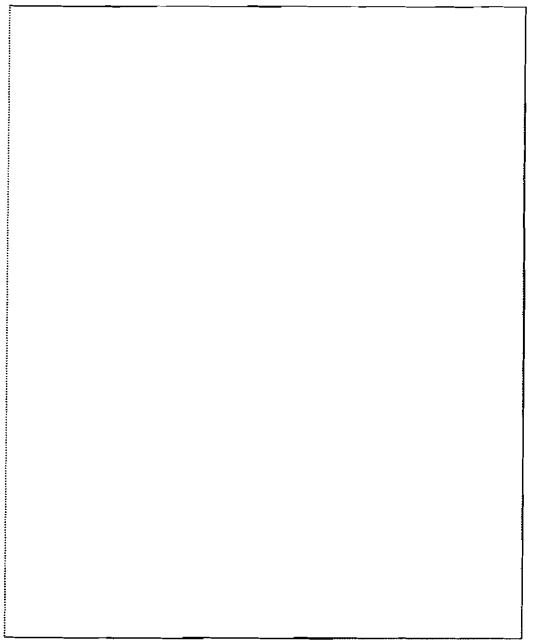

Site Map/plan (include north arrow):

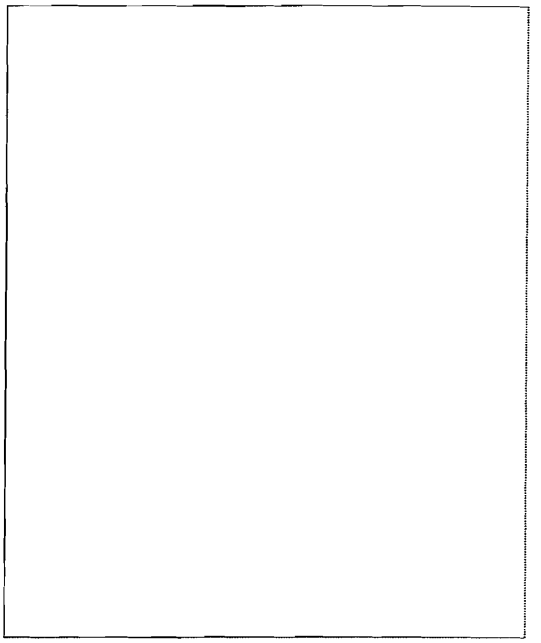

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This typical four-family walkup building has a symmetrical three-bay façade. Limestone course at base of first floor supports centered entrance surround at grade. At the left and right bay are wide segmental arched window openings. At the second story these openings retain all or part of the window sets with a center six-over-one flanked by four-over-ones. There is a limestone sillcourse at the first floor, individual sills at second. False front side gabled roof retains red clay tile and central cross gable with wooden timbering. First floor openings are boarded except for narrow wood sidelights at front door.

38.(cont.) History::

Could not find in Daily Record. Permit date 7/16/1924
1927 Red-Blue Book:
1930 census:
1943 Negro Directory: Ethel Cayto is the sole staff of special school No. 6 listed in the Negro Directory

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1825
LAST FRIDAY
8:30 AM NOON

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C 1 C 2	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1907 ANNIE MALONE DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	Domestic
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Painted Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop; awning	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Other	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1883		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
1892		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
Ethnic Heritage	Peter H. Clark	
Black		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WOOLFOLK, EVA LUE	Andrea Gagen	1/15/2010
1907 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This 1880s-era house now has painted brick façade. The front door is at the right of three ground story bays; the other two are windows; all three are covered by metal awnings. A large 1/1 window is set in the 2nd story's left bay in a slightly raised brick bay w/ corbelled bottom, flat arch opening with rounded corners. The upper façade is altered with an early 20th century stepped parapet, which relates the building stylistically to other shaped parapet buildings in the neighborhood.

38.(cont.) History::

(check date) 1920 census: Header or Healer , a couple, (?) and a second single-person household, black, renters, illegible.
1927 Red-Blue Book: Polk Robt D (Mayme)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Nine teen
Seven

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C063	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1909 ANNIE MALONE DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Painted Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Other	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
1907		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
Ethnic Heritage	John A. Kelly	
Black		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GRAY, LINDA L	Andrea Gagen	
1909 ANNIE MALONE DRIVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story house has a painted stone front w/ carved details, stone sills w/ decorative consoles. A modern frame stoop is at the transomed front door, left. The wide façade window (a replacement) is at the slightly projecting right bay. The upper section of the front wall has been rebuilt in brick with no ornamentation.

38.(cont.) History::

1920 census: Rose, Lemuel and Mary and 2 sons, Mu, owners, he is a janitor for private family.
1927 Red-Blue Book: Rose, Lemuel D
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Nine teen
Seven
1909

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	064	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1915 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S.

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1909	Plummer, L. L. Co.	Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Plummer, L. L. Co.	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SEABROOK, PHILLIP	Lynn Josse, Michael Allen, CRO	1/15/2010
1915 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This house is in poor condition. The single-story painted brick façade has a full-width wooden porch with plywood skirt. Front parapet partly collapsed; brick corbelling evident on remaining end sections. Vinyl one-over-one windows in openings to each side of center entrance, which has replacement door. Roof is collapsed over much of the house.

38.(cont.) History::

1920 census: Bruse (sic), Horace, Mary, 6 children, black, owners, he is a factory janitor
1927 Red-Blue Book: Bruce, Horace (Mary)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	065	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1921 ANNIE MALONE DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Second Empire Mansard	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
3	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1891		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Wiegand, Mr.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Reinhardt, Louisa	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JACOBS, ALBERT WEST JR	Lynn Josse, Michael Allen, CRO	1/15/2010
1921 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Rusticated painted stone foundation with smooth-faced courses at top and bottom. Basement openings retain historic metal grilles. Stone sills with consoles on window openings. Wooden one-over-one windows remain in exposed openings. Entrance openings is boarded around single door, but recessed porch and original transomed doors are visible. Brick corbels under metal gutter pan at top of second floor. Third floor is articulated as a mansard roof that wraps the left (south) elevation. Slate cladding remains, as does metal cornice above. Wooden dormers retain decorative pediments and surrounds; window openings covered by plywood.

38.(cont.) History::

1920 census:Robt and nannie Eaton family, B, he's a Pullman porter, and Abernathy family, Mu, renters, his name looks like Pearl; he and son Charly are real estate agents,
1927 Red-Blue Book: Hall, Henry (Alice); 1921a: Harvey Emma Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Nineteen Twenty One

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	OLC	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1926 ANNIE MALONE DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1908		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Stafford, E. H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

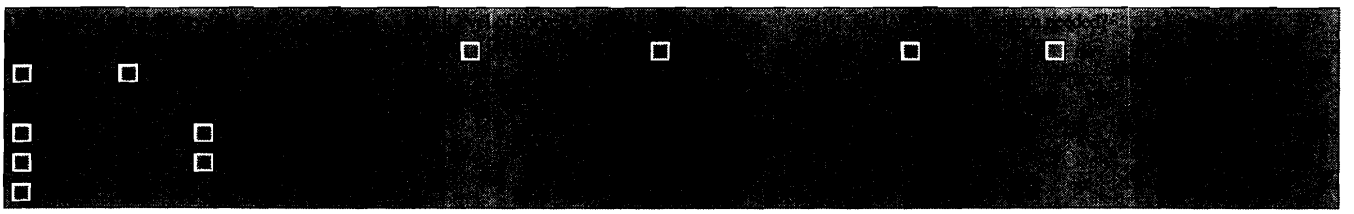

Architectural/Historic Inventory Form

Location Map (include north arrow):

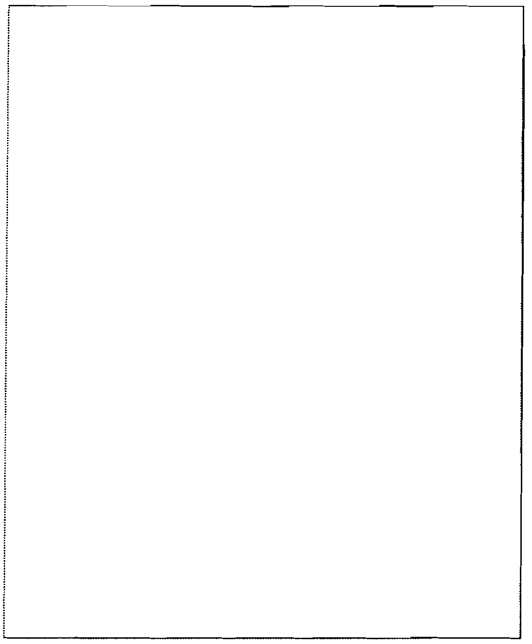

Site Map/plan (include north arrow):

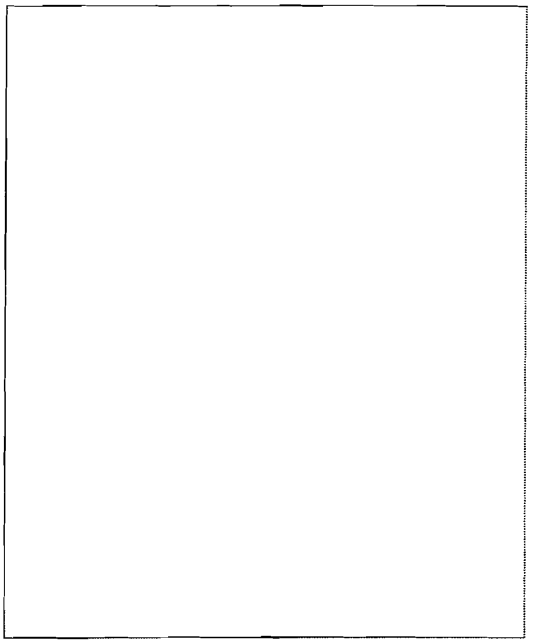

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-family building has a brown brick façade with darker brown brick below the first story window sill level. The two front doors, replacements, are recessed at the right bay. The basement and first floor openings have splayed brick headers. Decorative course above second floor. Shaped parapet with end blocks rises to form center pediment. Lozenge pattern in brickwork at center. There is a parged area where the original cornice was removed.

38.(cont.) History::

1908 owner: E. H. Stafford
1920 census:
1927 Red-Blue Book: Hopkins CS (Jennie); 1926a: Dunlop, Ellen Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

STREET
NOT THRU
1926

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	067	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1927 ANNIE MALONE DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Domestic
	Sub-use:	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick; imitation stone veneer	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gable Hip or Gablet	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
1890		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual. Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0	Jakowitz, Charles	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ALLEN, ROBIN D	Lynn Josse, Michael Allen, CRO	1/15/2010
1927 ANNIE MALONE DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Smooth stone foundation, red brick walls. Rounded corner. First floor window openings (right elevation) altered with brick infill to fit replacement windows. Cast iron storefront system features ornamented beam and tapered column heads at corner entrance; storefront openings clad in imitation stone veneer. Metal cornice above terminates in bracketed section over first floor entrance to second floor (left bay). Entrance retains wooden paneling around door. Ornate metal cornice above 2nd floor terminates in large block separating the storefront bays' cornice from the pediment over entrance bay. One window opening at second floor altered (bricked in) for replacement window; rest unchanged with wooden windows. Corner window has sandstone lintel. Three gabled dormers on north elevation have vinyl-sided faces and replacement windows. Hipped trapezoidal-bay dormer on front elevation retains single-paned wooden windows.

38.(cont.) History::

1965 permit to replace four windows and 2 doors, install steel lintels, $1300 to Julia May White.
1920 census: 1927A: Lovinguth, Jos and Caroline and 5 kids plus her father; he is a grocer, white and owns the bldg; her father is foreign-born and speaks Dutch (can't make out country name)
1927 Red-Blue Book: Lovinguth, JC (Caroline) gro
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ONE WAY

Removed from

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:	
SLCAS036	061	Architectural Survey of The Ville	
3. County:		4. Address:	
St. Louis [Independent City]		2422-4 ANNIE MALONE DR	
E. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):	
St. Phillip's Evangelical Lutheran Church			
10. Ownership:	11. Historic Use (if known):		11. Present Use:
Private	Religion		Religion
	Sub-use: Religious Facility		Sub-use: Religious Facility

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Steel	
(b) ~~Side Steeple Church~~		
14. Plan Shape:	21. Ext. wall cladding:	
	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ST PHILIPS EVANG LUTH CHURCH	Lynn Josse	1/15/2010
		43. Date of revisions:
0		

FOR SHPO USE:

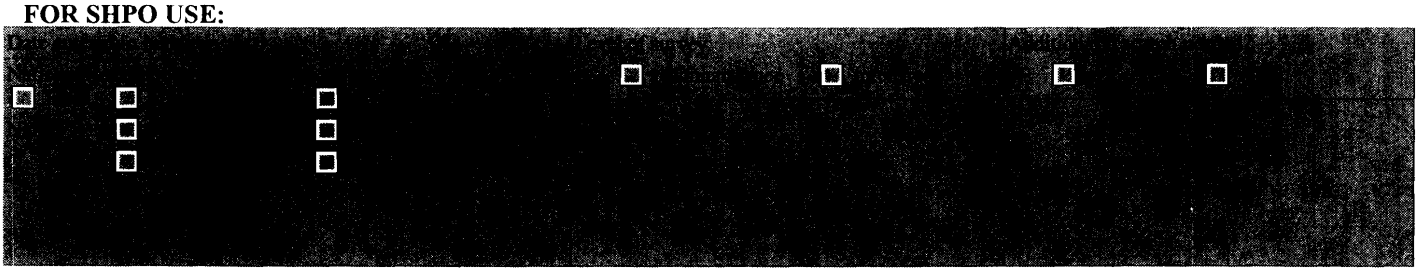

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Freestanding open brick steeple with metal cross. Brown brick building has buttresses on front and side elevations. Entrance bay has two full-height sidelight stained glass windows with arched metal panels at op surrounding projecting bay. Entrance below projecting bay. Projecting bay contains metal-ribbed, divided window with metal paneling at top and bottom.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, plat maps, and building permits.

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	069	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1512-8 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Walk-Up (Six or Eight Plex)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
8	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1914	Nolte & Naumann	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Schaefer, Wm. A.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MENSEY, ELIZABETH	Lynn Josse, Michael Allen, CRO	3/12/2010
5316 PERSHING # 207		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Front elevation consists of doubled four-bay arrangement. Red brick stretchers and burnished brick headers on front elevation bond. At the second and third bays as well as the sixth and seventh, concrete steps to segmental arched entrances containing recessed entrances (replacement doors). Window openings are above and on each floor in bays to each side. Soldier courses runs continuously at header levels. Stone sills. Replacement one-over-one windows. Stone lozenges under second floor windows in non-entrance bays. Corbel patternwork on sides of second floor rises up to continuous patternwork at top of parapet, which is shaped with central pediments and end blocks (clay tile coping).

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	076	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1713 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	
7. Township/Range/Section: Not Applicable		T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1891		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
CLARK, RAYMOND & PAULA WALKER			Lynn Josse, Michael Allen, CRO	3/15/2010
1713 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This shotgun brick house has a painted brick front elevation. At the left bay, concrete steps and stoop with metal railings and uprights support a wooden shed roof with wooden siding on sides. Entrance retains historic wooden door, transom and surround. Window opening has sill with consoles and soldier course header on a segmental arch. Window is a triple window with decorated mullions, carved eyebrow, a center one-over-one window and outer short one-over-one windows with transoms. Parapet steps up at each end to form end blocks; no coping.

38.(cont.) History::

Permit#E7716 issued 4-16-1928 to alter brick dwelling $150. Owner: W. H. Thomas
1920 census:
1927 Red-Blue Book: Thomas, Washington (Alice)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	071	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1715 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Work in Progress
	Sub-use: Single Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s): c. 1927
Flat	Full/Balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1891		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Chadwick, James	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
BRADLEY, CLIFTON J			Lynn Josse, Michael Allen, CRO	3/15/2010
1715 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brick two-family building, a former house, has a painted front elevation. Two-story porch has three brick piers with high walls all capped with stone. Stone steps and brick side walls with stone caps. Segmental arches on first story openings, which have replacement doors and windows. Bracketed projecting pent roof at top clad in asphalt shingles. A projecting bay at the left (south) elevation gives away the 1890s origins of the building. At the time of the survey, it appeared rehabilitation work was in progress.

38.(cont.) History::

Permit##3765 issued 10-17-1927 to alter brick dwelling, $100. Owner: C. Canyea
Permit#H1577 issued 5-3-1935 to alter brick flat, $297.00. Owner: Charles Canyea
Permit#E15 issued 3-14-1927 for 1-story garage. Owner: W.W. Yerby
1920 census:
1927 Red-Blue Book: Stubblefield Courty(sic) (Carrie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	072	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1716 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
REDDICK, WARREN & SHARON	Lynn Josse, Michael Allen, CRO	3/15/2010
1716 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Below a painted brick upper wall, the brown brick water table terminates in painted stone sill course. All openings have painted thick flat stone lintels. Painted stone sill course at second floor as well as first. At the left bay, stone steps lead to a to recessed entrance with two replacement doors. Basement window openings have metal bars. Window openings contain wooden one-over-one windows behind storm windows. Brick courses step up to modified cornice wrapped in metal. Parapet has end blocks and clay tile coping.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	073	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1718 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
5	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1928		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, JESSIE L	Lynn Josse, Michael Allen, CRO	3/15/2010
1718 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

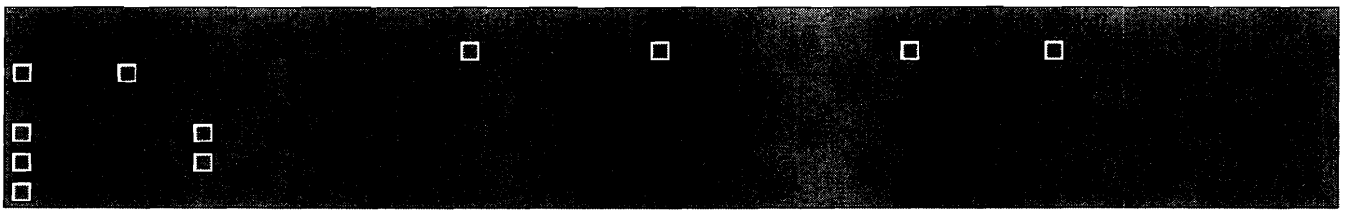

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The front of this building is clad with yellow and ochre brick with a Flemish bond. Steps to porch on each side have brick side walls. Porch has center section that rises with brick arcade to form balcony with metal railing at second floor. Round arch entrances at each side with red brick rowlock headers; wooden doors and metal security doors inside. Center French doors in jack arch opening flanked by round-arch window openings with stone sills; multi-light wooden windows inside. Second floor has center jack-arch opening with French doors with a red brick surround. Two small jack-arch window openings containing multi-light wooden windows are on each side. Wooden brackets support a projecting false hipped roof above that is clad in red clay tile.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	074	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1719 BELLE GLADE AV
5. City/State:	Vicinity: ☐	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1883		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BIZZLE, ELBERT	Lynn Josse, Michael Allen, CRO	3/15/2010
1719 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a flat-roofed frame garage clad in wooden siding. The garage is collapsing.

28. (cont.) Further description of important architectural features:

This side gabled house has a smooth-faced limestone foundation; painted brick wall. Concrete steps and concrete block porch with metal uprights support flat balcony roof with metal surround rail. Wooden siding covers most of the segmental-arched opening at the right bay. Two replacement doors are within. Window openings - the two left bays of the first floor and the outer bays of the second floor - have segmental arches with soldier arches and stone sills. Wooden two-over-two windows in unboarded openings. Wooden door in second floor center opening. Wooden siding covers top of wall where cornice was likely removed.

38.(cont.) History::

Appears on Hopkins. Permit#E8961 issued 12-28-1927 to alter brick tenement, $500.00. Owner is W. V. Cerby.
1927 Red-Blue Book: Pritchett Ira; 1719a Yerby Walter W phys
1930 census:

38. (cont.) Significance

39. Sources of information:

Hopkins atlas, Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	075	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1721 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1908		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hacker, WP	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Wilson, R. V. (orig owner)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
LASHLEY, JOE M SR			Lynn Josse, Michael Allen, CRO	3/15/2010
1721 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story brick house has a painted front elevation. Rusticated stone foundation. Wood porch at the right bay has historic-era square posts and gabled roof with timbered gable end. The front door is modern. At the left bay, flat stone sill and lintel, replacement window. Brick courses step up to roof. Parapet walls rise high on each end of slight false-front sloped roof clad in asphalt shingles.

38.(cont.) History::

1908 owner: R. V. Wilson
1920 census:
1927 Red-Blue Book: Jenkins Jos (Florence)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	076	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1722 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Stone; Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Recessed 1-story	☒ Moved Date(s)
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1882		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MURPHY, MERITER JR ETAL	Lynn Josse, Michael Allen, CRO	3/15/2010
1722 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The stone front elevation of this side gabled house is largely parged and entirely painted. Stone steps lead to recessed entrance with keystone in shaped arch. The two front doors appear original, and the left door retains a tall transom window. Projecting stone course between stories. The façade's five window openings retain wooden one-over-one windows. Cornice enclosed in deteriorating wooden box.

38.(cont.) History::

1882 owner: Mrs. Moody ($4500 - building permit correlates to certificate)
1920 census:
1927 Red-Blue Book: Vacant; 1722a Curran Jas (Ernestine)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C 7 7	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1727 BELLE GLADE AV
5. City/State	Vicinity:	6. UTM:
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Low Hip	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GAY, LUE T & JOLENE	Lynn Josse, Michael Allen, CRO	3/15/2010
6778 ROBBINS AVE		43. Date of revisions:
ST LOUIS MO 63133		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single family brick building has a painted front elevation. Stone foundation is parged. Concrete steps to stoop with brick corner piers, left. Wooden replacement door has a transom in segmental arched opening. Basement window opening with stone sill and segmental arch contains wooden single-pane window. Window openings on first and second floors have segmental arches with soldier course headers, stone sills, replacement windows. Wooden brackets under front eaves.

38.(cont.) History::

This was a single dwelling in 1909 per Sanborn. Permit#*9704 issued 5-5-1916 to alter brick tenement, $300. Owner: C. Puthoff Architect: J. Werly
D-5860 issued. 9-6-1921 to construct 1-story frame shed. Owner: J. Amos
1884 owner Verena Puthoff
1920 census:
1927 Red-Blue Book: Humphrey Lewis (Fannie); Golden Lawrence B (Roberta) coal

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	078	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1731 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1888		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PREWITT, IRENE & MARLIN			Lynn Josse, Michael Allen, CRO	3/15/2010
1731 BELLEGLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story house has a painted brick façade. Rusticated stone foundation; basement window opening (left) filled with glass block. Stone steps to recessed entrance at right that retains wooden surround but has a wooden slab replacement door. Segmental arched openings with bullnosed soldier course arches. Carved eyebrows. Window opening at right has stone sill with consoles, decorated wooden mullion and paired wooden one-over-one windows. Top of wall parged where cornice was altered.

38.(cont.) History::

1888 owner: Hermann H. Puthoff
1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1731
3rd Friday
of Month
ADT

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	079	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1801 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Imitation stone veneer	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1888		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PREWITT, JAMES			Lynn Josse, Michael Allen, CRO	3/15/2010
1731 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☒ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

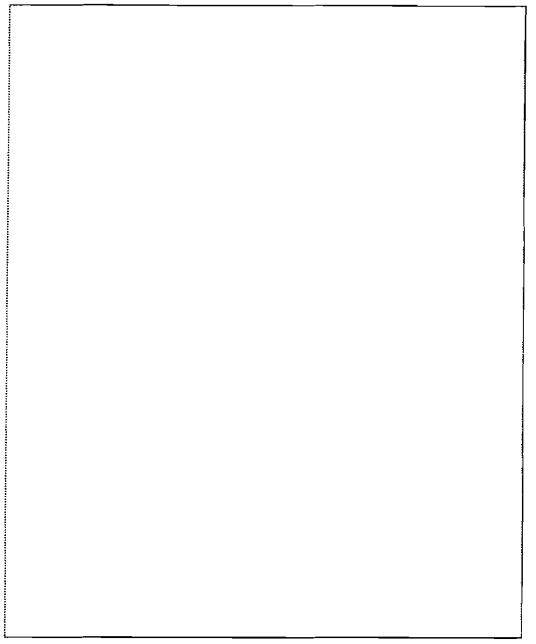

Site Map/plan (include north arrow):

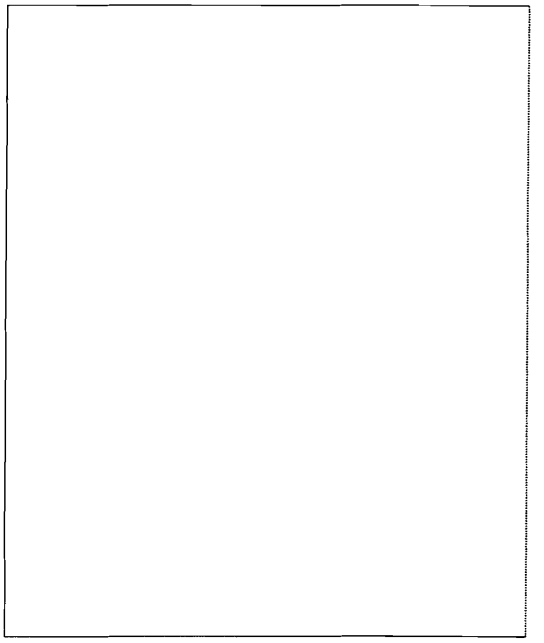

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Rusticated stone foundation. Brick front wall clad in simulated stone masonry. Window opening at left retains stone sill with consoles, now filled in with two replacement 1/1 windows. Recessed entrance at right with replacement door under transom. Cornice wrapped in aluminum.

38.(cont.) History::

1888 owner: Hermann H. Puthoff
1958, owner Edw. Dupree receives permit to "apply veneer to front", $400
1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

This building is potentially contributing depending on pd. of significance.

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1801

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:		
SLCAS036	086	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		1804 BELLE GLADE AV		
E. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☐	/	T: R: S:	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1889		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JCR INC	Lynn Josse, Michael Allen, CRO	3/15/2010
7508 DELMAR		43. Date of revisions:
ST LOUIS MO 63130		

FOR SHPO USE:

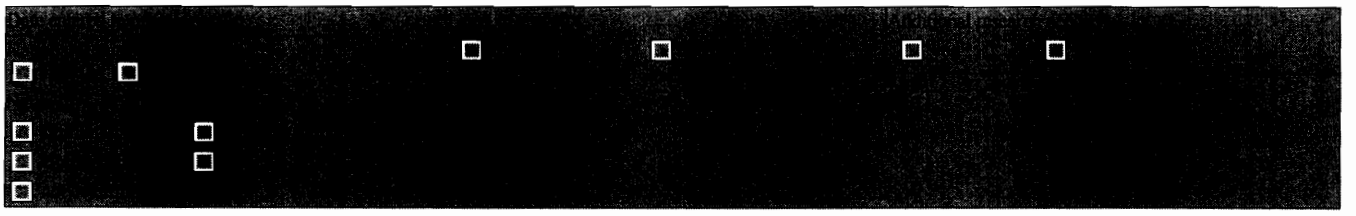

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a frame gabled garage clad in corrugated metal siding.

28. (cont.) Further description of important architectural features:

This three-bay single story brick house has a painted façade and tone foundation. Concrete steps to recessed entrance at left with metal replacement door. Windows in bays at right have stone sills and segmental arches with soldier arches. Openings are infilled at top above jack arches; metal replacement windows are inside of resized openings. Basement windows openings: one is boarded and one filled with glass block. Painted brick patternwork at top of wall, which has terra cotta coping.

38.(cont.) History::

1889 owner: Heike
1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

3rd Thursday
of Month
8:30 a NOON

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C81	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1805 BELLE GLADE AV
E. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☒	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1925	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
FARMER, SARAH L	Lynn Josse, Michael Allen, CRO	3/5/2010
1805 BELLEGLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This building has a red-brown tapestry brick exterior. Just left of center, wooden steps, railings and stoop are at the front door. Openings have jack arches with soldier headers; window openings have rowlock sills and fiberglass awnings. Entrance has replacement door. Windows are wooden one-over-one windows behind storm windows. There is a three over one window in opening at west end of north elevation. Soffit and eaves wrapped in metal.

38.(cont.) History::

1925 owner: B. Meade
1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1801
ADT
ADT

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	082	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1806 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1889		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PREWITT, NORMA J MEREDITH	Lynn Josse, Michael Allen, CRO	3/15/2010
4945 LOTUS		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick front elevation. Full-width frame shed-roof porch has tapered square columns and dentil course fascia. Wooden steps. Window opening at left bay has stone sill with consoles. Paired wooden one-over-one windows are separated by a decorated mullion. Entrance in right bay has wooden casement, transom and replacement door. Secondary entrance on street-facing elevation of rear ell. Plain brick parapet wall.

38.(cont.) History::

1889 owner: Heike 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1806
CAUTION
CHILDREN

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	083	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1808 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s)
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Closed	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LAND, VERA L	Lynn Josse, Michael Allen, CRO	3/15/2010
1808 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

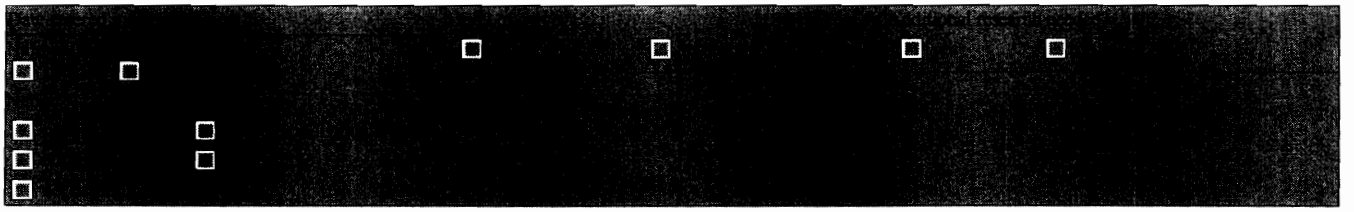

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Rusticated stone foundation. Right bay projects as a closed porch, and rear ell (right) has secondary entrance on street-facing wall. Paired basement window openings boarded. Concrete steps to recessed entrance, which has segmental arch and soldier course header. Wooden door. Grid of colored tiles above entrance. Window opening at left bay has stone sill with consoles and segmental arch with soldier course header. Wooden one-over one windows separated by decorated mullion with carved ornate eyebrow across opening. Dentillated brick cornice. Sloped parapet walls rise to each side of mansard clad in asphalt shingles.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Dooley Leo G (Mary)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1808

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	084	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1812 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	closed	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by: Deterioration

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LAND, J C & VERA B	Lynn Josse, Michael Allen, CRO	3/15/2010
1808 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted rusticated stone foundation under red brick facade. All openings boarded. Right bay projects as a closed porch; its top has collapsed. rear ell at right elevation has secondary entrance. Two basement window openings boarded. Wide window opening at left bay has stone sill. Dentillated cornice. Sloped side parapet walls step out from wall and rise to each side of short sloped roof clad in asphalt shingles. Fire damage has left much of right side of mansard missing or damaged.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Palmer Edw (Marie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING

4058

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	085	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1814 BELLE GLADE AV
5. City/State:	Vicinity: ☐	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
1885		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
		Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WARD,LAWRENCE & SHIRLEY SCIPHO	Lynn Josse, Michael Allen, CRO	3/15/2010
21502 SADDLE RIDGE WAY		43. Date of revisions:
YORBA LINDA CA 92887		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

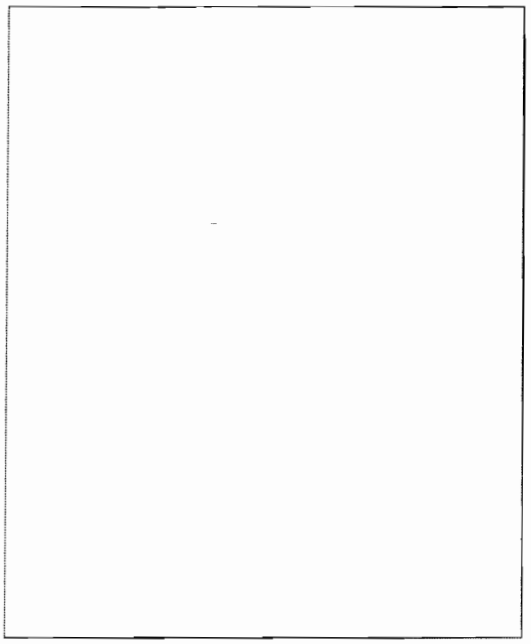

Site Map/plan (include north arrow):

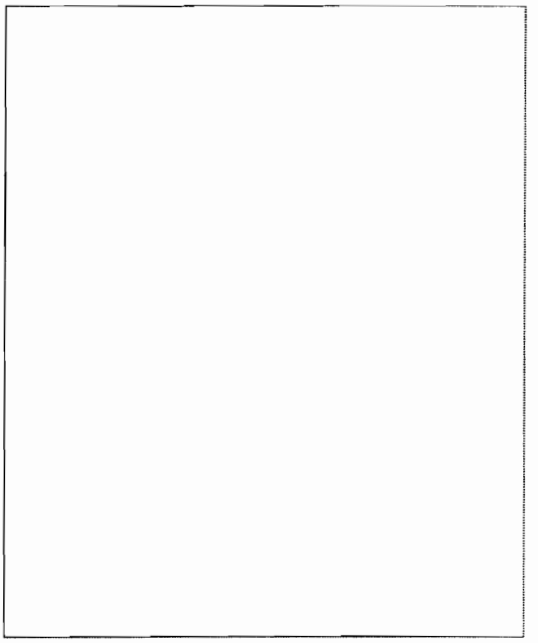

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a gabled frame garage clad in weatherboard. The garage is collapsing and no longer retains integrity (NC)

28. (cont.) Further description of important architectural features:

This single story house has a parged and painted front wall. Concrete stoop, right, has wrought iron railing. Window opening on slightly projecting left bay has stone sill with consoles and jack arch; replacement window inside with diamond pattern muntins on upper sash and single pane in bottom sash. There are shutters on each side. Entrance has wooden casement and transom with replacement door. Bracketed, gabled wooden hood with open gable end above. Vergeboard on gable end matches wooden cornice under short mansard-like roof (clad in asphalt shingles) above. Unpainted brick parapets rise on each side.

38.(cont.) History::

1885 owner: James Chadwick. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0816	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1820 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1908	none listed	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Christian, L. M	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
FOUNTAIN, RUTH S			Lynn Josse, Michael Allen, CRO	3/15/2010
3722 TEXAS AVE				43. Date of revisions:
ST LOUIS	MO	63118		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a modern gabled metal shed.

28. (cont.) Further description of important architectural features:

The two bay façade has a limestone foundation. A limestone sill course separates the brown brick base from the red brick of the upper wall. Marble steps to entrance, which has jack arch and mitered soldier course label with raised tracing course. Window opening, partly boarded and containing replacement window, has same treatment. Entrance has center replacement door surrounded by wooden sidelight and transom windows. Brackets support projecting false front roof, a slate-clad surface which rises above the flat roof and is supported between two end parapets. Unlike the three 19th century neighbors to the south, this roof is a false front with nothing behind it.

38.(cont.) History::

1908 owner: Mueller, J. L. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	057	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1901-3 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4		■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Low Hip	Open Porches	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
c. 1870		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HOLIFIELD, KING DAVID	Lynn Josse, Michael Allen, CRO	3/23/2010
3846 SULLIVAN AVE		43. Date of revisions:
ST LOUIS MO 63107		

FOR SHPO USE:

□ □ □ □ □ □

□ □

□ □

□

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This hip-roofed two story building has front doors at the two outer bays (of four). Concrete porch bases; metal rails and uprights support a fiberglass awning (left) and a shed roof (right). Segmental arches with soldier course headers. Replacement doors and windows. Dentillated brick cornice. The roof is hipped with central chimneys; there is a clear line down the center of the façade as if the building was constructed in two parts.

38.(cont.) History::

Permit #K9786 issued 10-21-1919. Repair brick tenement $400.00 Owner: Thos. McClosky. Permit # E1592 issued 9-21-1904. Alter brick residence $35.00. Owner: A. Tonelle 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

This is one of the oldest buildings in the neighborhood; it is depicted on Plate 29 of Hopkins' atlas and seems to be the same building depicted in plate 86 of Compton & Dry's view, drawn in 1875.

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0 67	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1902 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1925	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LLOYD, MARY E	Lynn Josse, Michael Allen, CRO	3/23/2010
6031 MC PHERSON AVE		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

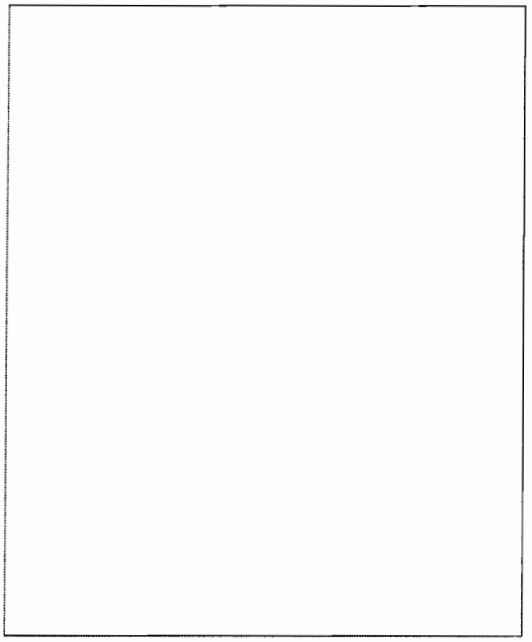

Site Map/plan (include north arrow):

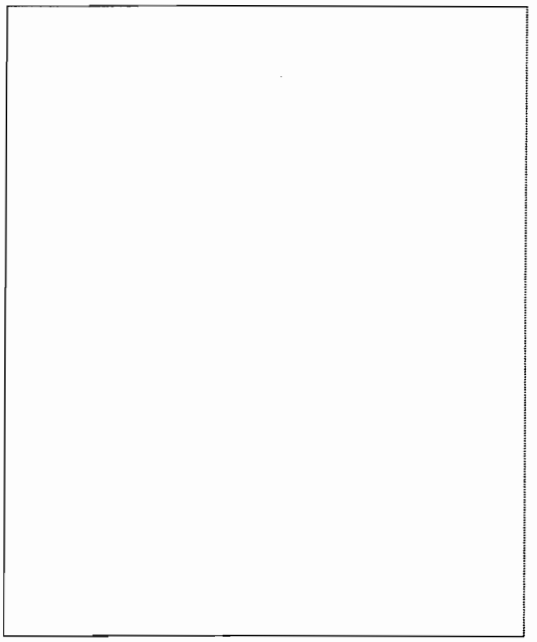

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Above a painted concrete foundation, this house has a dark tapestry brick exterior. Just right of center, the concrete stoop has added metal uprights supporting a metal awning; painted side walls around stoop. To eaither side is a jack-arch window opening with soldier course headers; rowlock sills. Replacement door. Wooden four-over-one windows. Gabled dormer clad in shingles with metal-wrapped vergeboards. Wooden surround around louvered vent on dormer face.

38.(cont.) History::

Permit #C9520 issued 6-5-1925 One story brick dwelling $7000.00 Owner B. Merede ; 1956 1 sty concrete block addition to Mary Wells, $1500
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1902

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0571	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1904 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1925	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NEAL, DENNIS			Lynn Josse, Michael Allen, CRO	3/23/2010
5034 VERNON AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Above a painted concrete foundation, this house has a dark tapestry brick exterior. Just right of center, the concrete stoop has added metal uprights supporting a metal awning; painted side walls around stoop. To either side is a jack-arch window opening with soldier course headers; rowlock sills. Replacement door and windows. Two long wooden brackets at each end of roof overhang with four smaller brackets between. Shed roof dormer with wooden surround and boarded opening.

38.(cont.) History::

Permit #H1974 issued 6-12-1935 Alter Brick Dwelling $40.00 Owner: John Hansley
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

CAUTION

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	016	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1908 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Aluminum	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gable Hip or Gablet	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1968	Shearman, John	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Economy Homes Inc.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Bullay, Love, Jr. (orig owner)	
0		37. National Register eligible?
		Less than 50 years
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BULLAY, LOVE JR & SUSIE L	Lynn Josse, Michael Allen, CRO	3/23/2010
1908 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Techinically a gablet, the roof appears as a low-pitched gable with a louvered vent at the top. Shed roof carport, right, continues pitch of roof and covers a concrete drive to street at south side. Metal door, center, flanked by and vinyl windows (left) and a large fixed-pane window bay, right, with a fiberglass awning.

38.(cont.) History::

1968 owner: Love Bullay, Jr.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	091	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1909 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Gabled Ell		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Brick	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Cross Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WILSON, ARTYS OWENS	Lynn Josse, Michael Allen, CRO	3/23/2010
3330 GOLFE LINKS DR		43. Date of revisions:
SNELLVILLE GA 30039		

FOR SHPO USE:

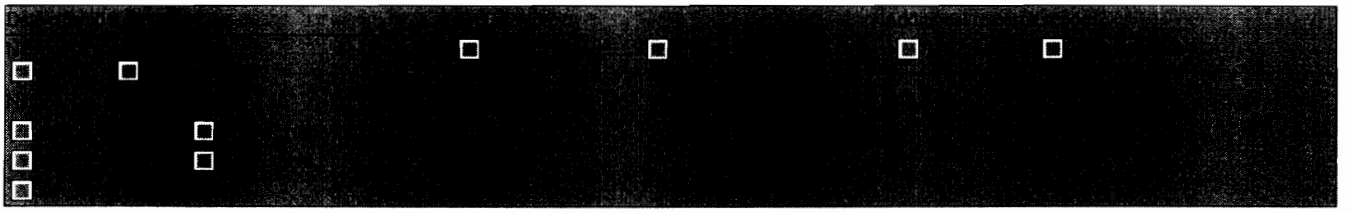

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

First floor is painted brick, while second floor is frame and clad in asphalt roll siding under later vinyl siding. Entrance bay recessed. Concrete steps to porch with metal rails and column supporting shed roof. Openings on brick section have segmental arches with soldier course headers. Entrance has wooden surround with a transom window. Basement openings have wood wnidows. First floor opening has double wooden one-over-one windows divided by wide ornamented mullion. Simple openings with wooden one-over-one windows on second floor.

38.(cont.) History::

Second floor likely added. Permit #I6755 issued 8-12-1915. Alter brick dwelling. $50.00. Owner: Edmon Realty & Building Co. Permit #E9816 issued 7-29-1905. Open frame porch. $125.00 Owner: Mrs. A. Volcott 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	092	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1911 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1925	Lawler, E. J.	Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
	Reilly, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
RENTAL HOUSE PARTNERSHIP LLC	Lynn Josse, Michael Allen, CRO	3/23/2010
625 N EUCLID STE 601		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted foundation. Dark red tapestry brick. Concrete stoop with metal railings. Jack-arch openings with soldier course headers; rowlock sills. Replacement door. Replacement one-over-one windows. Gabled dormer clad in shingles with wooden vergeboards and returns. Dormer opening has wooden surround and contains wooden window with center pane and multi-light border.

38.(cont.) History::

Permit #C9521 issued 6-5-1925. One story brick dwelling. $3,500.00 owner: B. Merade
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	013	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1912 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1910	Brown, N. O.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Brown, N. O.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NEAL, JAMES E & JENNIE LOU	Lynn Josse, Michael Allen, CRO	3/23/2010
1912 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brown brick four-family building has two porches at the center two of four bays. Corbelling and architrave on shaped parapet with center and end steps. Porches have stone steps and brick side walls with wooden columns and hipped roofs. Double entrances. Window openings have stone sills and jack arches. Second floor openings have raised label courses. Replacement windows.

38.(cont.) History::

Permit #G4613 issued 5-9-1932 Alter brick $200.00 Owner N.C. Cleaves. Permit #G1660 issued 6-1-1910. Two double brick tenements $10,000.00. Owner: N.O. Brown. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	C 9 4	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1913 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s)
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BELLE GLADE PROPERTIES L. P.	Lynn Josse, Michael Allen, CRO	3/23/2010
625 NORTH EUCLID SUITE 601		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings
28. (cont.) Further description of important architectural features:
38.(cont.) History::
38. (cont.) Significance
39. Sources of information:

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	095	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1917 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
BELLE GLADE PROPERTIES L P			Lynn Josse, Michael Allen, CRO	3/23/2010
625 N EUCLID AVE #601				43. Date of revisions:
ST LOUIS	MO	63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:
Permit #G9527 Issued 7-16-1934 Alter brick on dwelling $200.00 Owner: Bixton Walker. Permit #F568 issued 9-24-1928. Add brick dwelling $75.00. Owner: B. Walker. Permit #D5953 issued 6-1-1926. Alter brick dwelling. $200.00 Owner: B. Walker

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	0960	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1920 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1910	Brown, N. O., R. E. & Inv. Co.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Brown, N. O., R. E. & Inv. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	N.O. Brown	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HUTCHINSON, KENNETH	Lynn Josse, Michael Allen, CRO	3/23/2010
4353 ENRIGHT AVE		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

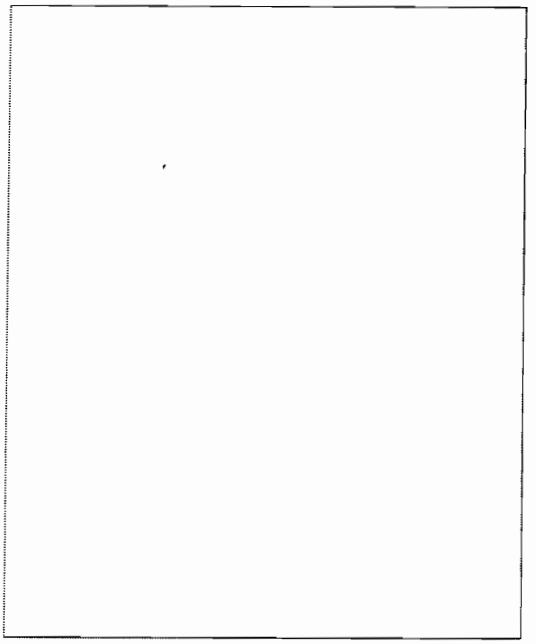

Site Map/plan (include north arrow):

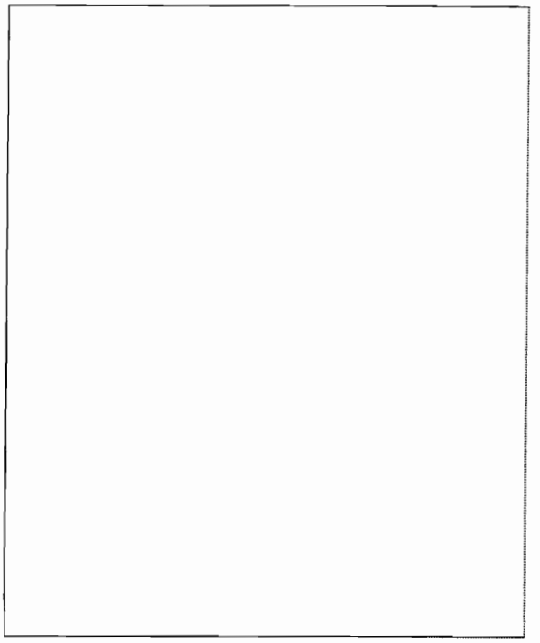

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. At the center two of four bay is a double porch with brick side walls, concrete steps, wooden columns and hipped roof. Openings have jack arches. At the façade the lower left openings are boarded, some have replacement windows or glass block and two have original wooden one-over-one windows. Stone sills. Corbels under architrave on shaped parapet with center and end blocks.

38.(cont.) History::

Permit #G3772 issued 3-29-1910. Two story double brick tenements. $12,000.00 Owner: N.O. Brown Real Estate & Inv. Co.
1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	097	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1925 BELLE GLADE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BELLE GLADE PROPERTIES L.P.	Lynn Josse, Michael Allen, CRO	3/23/2010
625 NORTH EUCLID SUITE 601		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

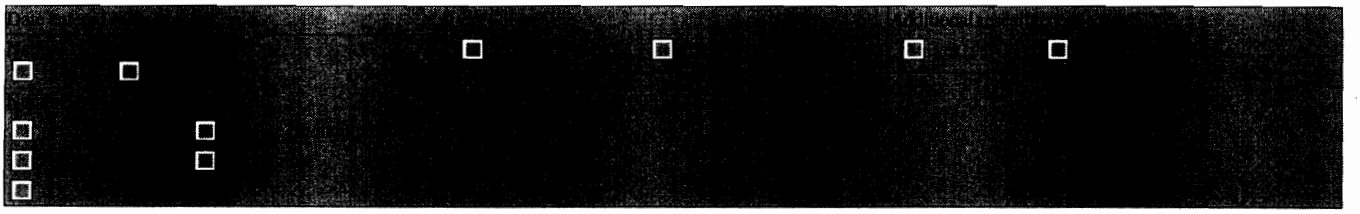

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

38.(cont.) History::

Permit #D7665 issued 9-9-1926. Two story brick tenament. (4) $10,000.00 Owner: J.Herkins.

38. (cont.) Significance

39. Sources of information:

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	098	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1926 BELLE GLADE AV
E. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable
St. Louis, MO	☐		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 years
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BELLE GLADE PROPERTIES L P	Lynn Josse, Michael Allen, CRO	3/23/2010
625 N EUCLID AV #601		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brick front elevation on new platform-framed house with vinyl siding on side and rear elevations. There is a gabled porch with vinyl-clad columns, a metal door and vinyl one-over-one windows.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

1926

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	099	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1933 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1910	Miles, W. D.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GOSBY, MAMIE & CLARENCE	Lynn Josse, Michael Allen, CRO	3/23/2010
1933 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

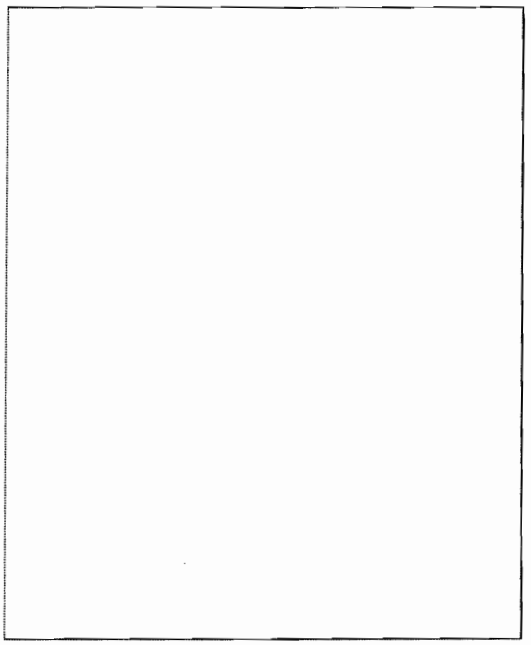

Site Map/plan (include north arrow):

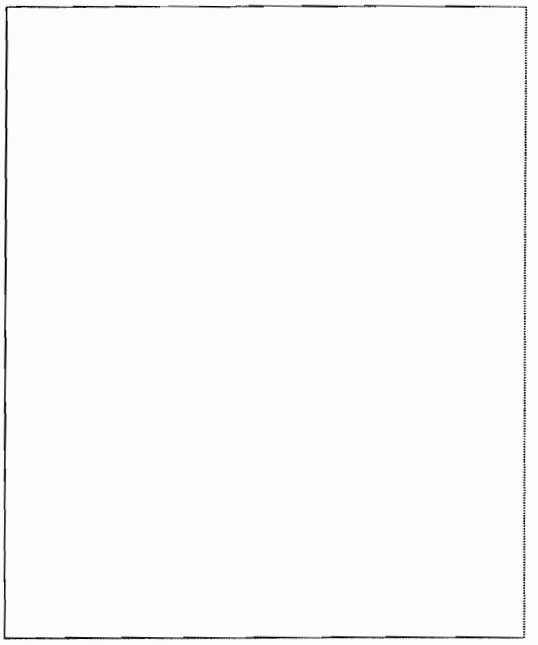

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Recessed secondary entrance bay at left. Wooden steps to entrance with wooden casement and double-pane transom window. Wooden brackets support shed-roof hood. Front elevation has shaped parapet with tall, articulated end blocks and white terra cotta coping between. Concrete steps to full concrete porch with metal rails and solcumns supporting shed roof. Window opening with segmental arch and soldier course header as well as stone sill; double wooden one-over-one window. Entrance has wooden casement and single-pnae transom window; replacement door.

38.(cont.) History::

Permit #B4599 issued 3-12-1923. Alter brick dwelling. $100.00 Owner: T. Holland Permit#G5516 issued 8-22-1910. One story brick dwelling. $1,500.00. Owner: J.E. Brown 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

RESERVED
PARKING

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	100	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2404 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1910		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	N.O. Brown	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
FOSTER, RALPH & ESSIE			Lynn Josse, Michael Allen, CRO	3/23/2010
2404 BELLE GLADE AVE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

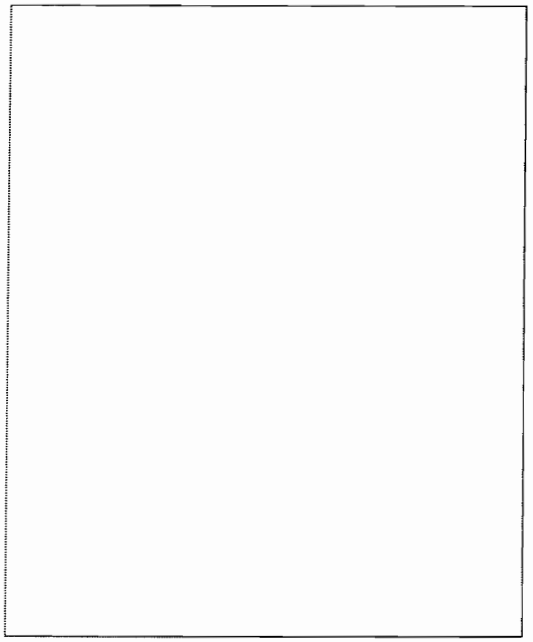

Site Map/plan (include north arrow):

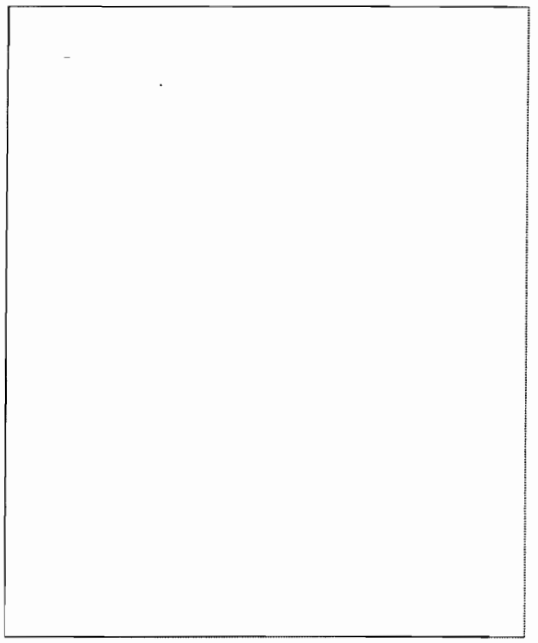

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Dark brown brick water table and porch walls with two bakery brick courses running above. Light brown body above, and red brick side and rear walls. Stone sills and porch wall caps. Jack arches. Porch supports metal columns supporting pyramidal roof. Double entrance. Replacement window at first floor and glass block in basment opening, Second floor openings have wooden one-over-one windows under metal awnings. Brick corbelling under architrave on shaped parapet with end blocks. One-story, flat-roofed masonry garage addition at south; garage openings face street and concrete driveway is in front.

38.(cont.) History::

Permit #C8959 issued 5-12-1925 Alter brick tenement $100.00 Owner Mrs. V. Wilson Permit #G6272 issued 10-21-1910. Two story brick tenement. $2,500.00. Owner: N.O. Brown R.E. & I. CO. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	101	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		2407-27 BELLE GLADE AV		
5. City/State:	Vicinity: ■	6. UTM: /	7. Township/Range/Section: T: R: S:	Not Applicable
St. Louis, MO				
8. Historic Name (if known):		9. Present Name (if known):		
Pleasant Grove Missionary Baptist Church				
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Religion		Religion	
	Sub-use: Religious Facility		Sub-use: Religious Facility	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Load-bearing Brick	
(b) Gabled End Church		
14. Plan Shape	21. Ext. wall cladding:	
Irregular		
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
		■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	open Porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1974	Randale, James and Associates	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Less than 50 Years
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PLEASANT GROVE M.B. CHURCH	Lynn Josse, Michael Allen, CRO	3/23/2010
2411 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

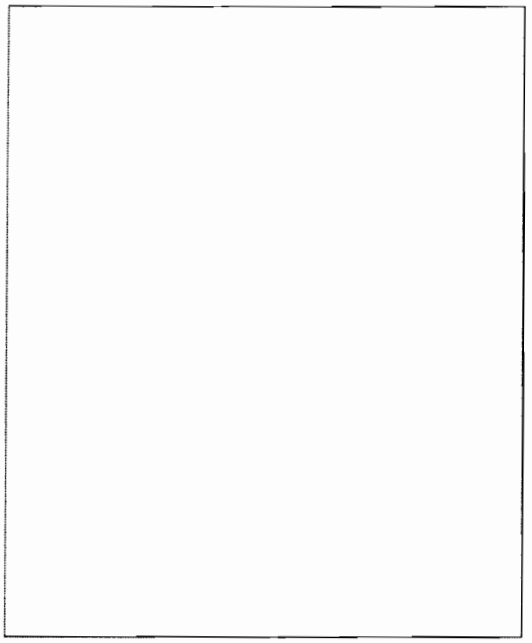

Site Map/plan (include north arrow):

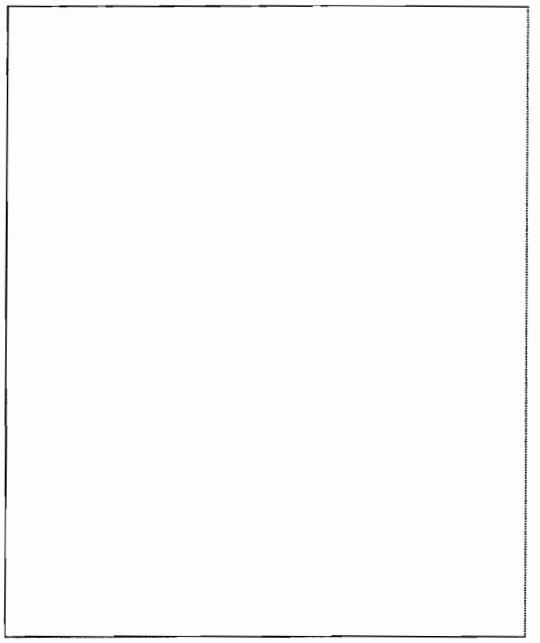

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

There are two connected buildings: a red brick, gabled Modern Movement church and a large irregularly-shaped church of recent construction clad in buff concrete masonry units. The Modern Movement Church has concrete steps leading up to a front platform with brick skirt. Two piers frame the entrance bay, which has metal-framed double doors set into a stained glass window rising to the gable peak. The right pier rises through the gable to support a metal cross. The newer building has a n octagonal shape and an irregular drum rising above a lowe hipped roof. The stucco-clad drum has a roof of standing-seam metal and supports a needle-like spire. The church has a front-gabled open portico with columns and a band of contrasting concrete masonry units running through arched windows framed in the same.

38.(cont.) History::

1974 owner: Pleasant Grove M. B. Church

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Pleasant Grove
BAPTIST CHURCH

ST FERDINAND

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	102	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2426 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Concrete Block	
(b) Composite		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Concrete	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Low Hip	open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1951		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JONES, FANNIE J	Lynn Josse, Michael Allen, CRO	3/23/2010
2426 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This irregularly-shaped painted concrete masonry block house has a low hipped roof. The entrance is placed off one side of an open porch which has a metal openwork pier. There are several window openings, mostly boarded. One window opening near the entrance has a wooden one-over-one window. The house includes an interior garage with vehicle opening to the north.

38.(cont.) History::

Permit #B2163 issued 5-7-1903. Alter frame residence. $38.00. Date of current building found in assessor's database.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	103	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		2500-6 BELLE GLADE AV		
5. City/State	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Platform Frame	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Recessed 1-story	☒ Moved Date(s)
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HOMEWARD BOUND	Lynn Josse, Michael Allen, CRO	3/31/2010
707 N 2ND STREET SUITE 308		43. Date of revisions:
ST LOUIS MO 63102		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The vinyl-clad front gabled house has a projecting gabled bay at left with paired vinyl one-over-one windows in opening. The entrance is recessed at the right bay with a metal door. Another opening with paired one-over-one windows is at right. The soffits, eaves and vergeboards are wrapped in metal.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	104	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2503 BELLE GLADE AV
5. City/State	Vicinity: ☐	6. UTM: /
St. Louis, MO		

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Load-bearing Brick	
(b) Duplex(Double House)		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1961		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
VALENTINE, WAYNE C SR	Lynn Josse, Michael Allen, CRO	3/23/2010
4141 ST FERDINAND AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story frame gabled garage clad in masonite.

28. (cont.) Further description of important architectural features:

Red brick with white-painted Roman brick skirt. Wooden vertical siding on gable ends. Metal windows in openings. There are large picture window openings on each elevation with fixed central paned flanked by two-over-two horizontal windows. There are entrances on eeach elevation with metal security doors over metal doors.

38.(cont.) History::

Permit 1/26/1961 "erect addition and alter dwelling" to owner Haywood Tunstall et al, $15,000; while there may be an earlier house here underneath, the exterior is clearly Modern.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	105	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2513 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s)
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38 History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LEE, ROBERT D SR	Lynn Josse, Michael Allen, CRO	3/30/2010
4776 PLOVER AV		43. Date of revisions:
ST LOUIS MO 63120		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick. Full-width wooden porch has a shed roof on four posts.. Window and door openings are partially filled in and have replacement windows and door. Shaped parapet with end blocks and patternwork.

38.(cont.) History::

Permit #f6660 issued 7-23-1930 Alter dwelling $35.00 Owner J. Williams
1920 census: Ellen Lynch and grandson; she was born in Ireland; they own; they're white.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

2513

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	166	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2518 BELLE GLADE AV
5. City/State:	Vicinity: ☐	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HOMEWARD BOUND	Lynn Josse, Michael Allen, CRO	3/31/2010
707 N 2ND STREET SUITE 308		43. Date of revisions:
ST LOUIS MO 63102		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The vinyl-clad front gabled house has a projecting gabled bay at left with paired vinyl one-over-one windows in opening. The entrance is recessed at the right bay with a metal door. Another opening with paired one-over-one windows is at right. The soffits, eaves and vergeboards are wrapped in metal.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	107	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2525 BELLE GLADE AV
5. City/State:	Vicinity: ■	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Classical Revival – ? No	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	Stoop/ awning	■ Moved Date(s):
18. Roof Material	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
c. 1883		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COTTON, MARY EASTER	Lynn Josse, Michael Allen, CRO	3/31/2010
2527 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Two star anchors at second floor. Segmental arches, rowlock sills. Replacement door and first floor window; wooden one-over-one window in second floor opening. Wooden vergeboards and fascia on gable end with ornamental fan in tympanum. Wooden steps and metal awning at entrance.

38.(cont.) History::

On Hopkins.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	108	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2527 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Car Port (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Brick	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop and awning	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1887		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COTTON, MARY EASTER	Lynn Josse, Michael Allen, CRO	3/31/2010
2527 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a modern flat-roofed wooden car port.

28. (cont.) Further description of important architectural features:

Concrete stoop with metal railings. Metal uprights support full-width metal awning. Basement and first floor unpainted; parapet painted above awning. Parapet has end blocks and creasing course. Side elvation shows segmental arch openings with soldier headers. Stone sill with consoles on first floor window opening, right. Replacement front door, left. Wooden basement window and wooden one-over-one first floor window behind metal security bars.

38.(cont.) History::

1887 owner: James Chadwick
1920 census: owned by Wm. and Susie Moon and two daughters, they are one of the only black families on this side of this block of Belle Glade. He is a car dealer, and she is a laundress

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1C?	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2529 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☐ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☐ Altered Date(s):
Flat	Open Porch	☐ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☐ Other Date(s):
	Visible from public road? ☐	Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☐
1887		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
0	Chadwick, James (1887)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
COTTON, MARY EASTER			Lynn Josse, Michael Allen, CRO	3/30/2010
2527 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

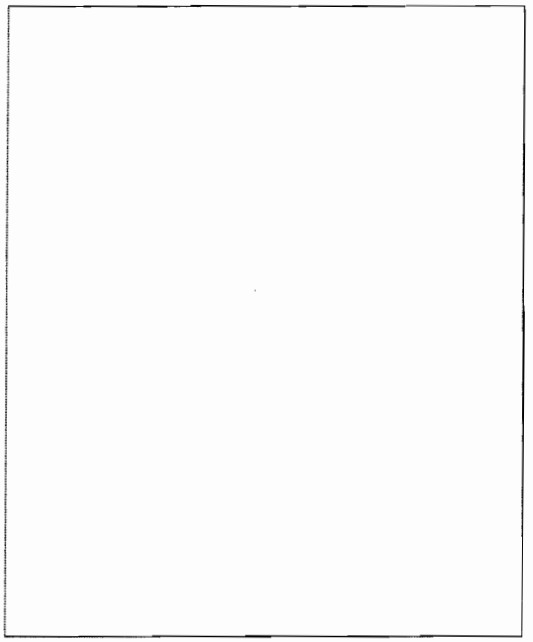

Site Map/plan (include north arrow):

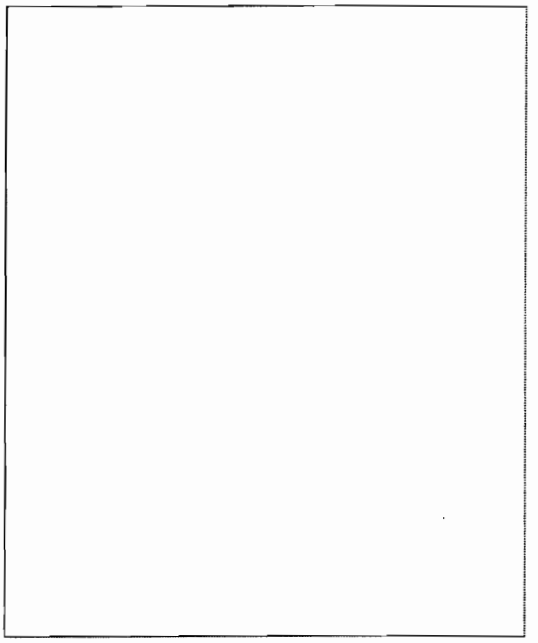

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story house has a two-bay painted brick façade. Wooden fascia and bracketed cornice with projecting crown. Wooden steps to stoop; metal columns support hipped roof over entrance. Two basement window openings with segmental soldier course arches have wooden four-pane sash. Entrance has wooden casing and transom window. First floor opening retains stone consoles under a more recent rowlock sill; the opening has been widened and shortened and about 10 courses are filled in under the original segmental soldier course arch. Metal replacement window.

38.(cont.) History::

1887 owner: James Chadwick.
1934 Negro Business directory: Hollard Rice, carpenter
1943 Negro Directory: Hollow Rice, carpenter (sic)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

2529

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	110	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2600 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Composite		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s)
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1906		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
	O'Leary, D.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	O'Leary, D. (orig. owner)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
FACEN, LORENE	Lynn Josse, Michael Allen, CRO	3/31/2010
2600 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted rusticated stone foundation with smooth top course. Brown brick above and light brown brick piers on porch. Concrete steps to porch, which has brick side walls that have stone caps. Piers support pyramidal roof, under which is a dentillated cornice. Entrance has wooden casement, door and transom window. Openings have jack arches, splayed vertical headers and stone sills. Wooden one-over-one windows, paired in second story openings with wide wooden mullions. Projecting metal crown molding. Gabled section at center with wooden ogee vergeboards and slate ends.

38.(cont.) History::

5/3/1906 to owner D. O'Leary

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	/ / /	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2601 BELLE GLADE AV
E. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1998		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BELLE GLADE PROPERTIES L P	Lynn Josse, Michael Allen, CRO	3/3/2010
625 N EUCLID AV #601		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled frame garage clad in aluminum siding.

28. (cont.) Further description of important architectural features:

The vinyl-clad front gabled house has a projecting gabled bay at left with paired vinyl one-over-one windows in opening. Shingle-style siding at gable end. The entrance is recessed at the right bay with a metal door. Another opening with paired one-over-one windows is at right. The soffits, eaves and vergeboards are wrapped in metal.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

City of St. Louis Assessor's database

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	112	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2603 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1924	Beal and Finkbeiner	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Fox, N. M.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DAVIS, ELLEN	Lynn Josse, Michael Allen, CRO	3/31/2010
2603 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red tapestry brick. Shaped parapet with center step and end blocks; metal coping. Soldier course runs at base of parapet. Dark brick soldier label courses run continuously to form headers for jack-arch first floor and basement openings. Wooden one-over-one windows are paired in first floor left opening; single in first floor right opening. Entrance with wooden door. Basement opening with metal bars and wooden single-pane window. Porch has brick side walls and piers supporting low gabled roof; wooden siding and projecting vergeboards on gable end. Metal awning over left window opening.

38.(cont.) History::

1924 owner: N. M. Fox

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

RESERVED
PARKING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	113	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2604 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1889		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual,
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address			41. Form prepared by (name and organization):	42. Survey date:
LRA			Lynn Josse, Michael Allen, CRO	3/31/2010
330 N 15TH ST				43. Date of revisions:
ST LOUIS	MO	63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Painted rusticated foundation with smooth top course. Stone steps. Openings have flat limestone lintels and window openings have stone sills with consoles. First floor openings boarded, but two-over-two wooden windows remain at second floor. Brick corbelling above.

38.(cont.) History::

1889 owner: Wm. Kaye

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

2604
3rd Thursday
of Month

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	114	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2606 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Asbestos	
15. Number of Stories:	22. Foundation Material:	
2½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Other	stoop and awning	☒ Moved Date(s)
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ST PAUL'S PARADISE TEMPLE CHURC	Lynn Josse, Michael Allen, CRO	3/31/2010
P O BOX 4584		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Jerkinhead roof with shed roof bay at right. Roof end has wooden vergeboards. Concrete steps. Replacement door. Wooden two-over-two windows in two bays at left and above entrance. Apparent hinged wooden windows in opening at third floor. Window openings have flat wooden surrounds and shallow wooden sills.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

606
2604

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	115	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2607 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1924	Beal and Finkbeiner	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Fox, N. M.	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MCCULLUM, GRETCHEN W	Lynn Josse, Michael Allen, CRO	3/31/2010
2607 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

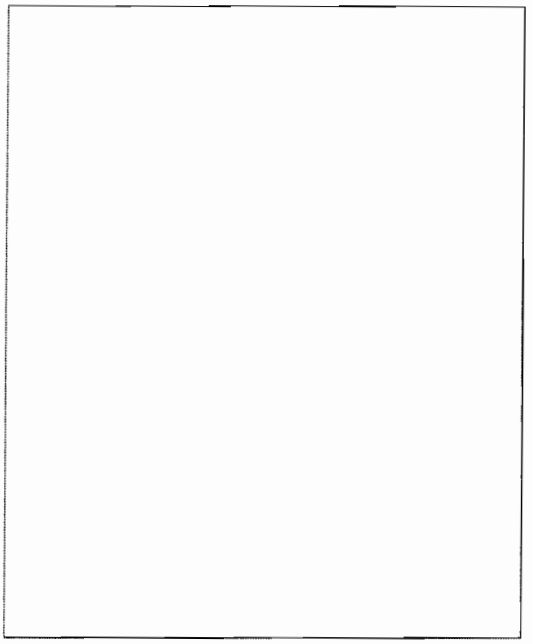

Site Map/plan (include north arrow):

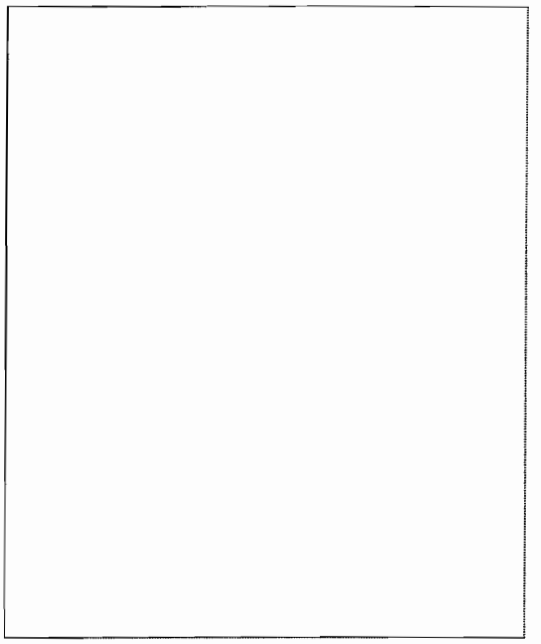

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red tapestry brick. Shaped parapet with center step and end blocks; metal coping. Soldier course runs at base of parapet. Dark brick soldier label courses run continuously to form headers for jack-arch first floor and basement openings. Wooden one-over-one windows are paired in first floor left opening; single in first floor right opening. Entrance with wooden door. Basement opening with metal bars and wooden single-pane window. Porch has brick side walls and piers supporting low gabled roof; wooden siding and projecting vergeboards on gable end. Metal awning over left window opening.

38.(cont.) History::

1924 owner: N. M. Fox

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

RESERVED
PARKING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	116	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2610 BELLE GLADE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Offset Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Wood undetermined	
(b) ~~Single dw. one-story narrow front~~		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Asbestos	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Cross Gable	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1883		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
GREEN, KENNETH			Lynn Josse, Michael Allen, CRO	3/31/2010
2610 BELLE GLADE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Porch has ashlar bond foundation, wooden columns and railing. Concrete steps. Porch rises to form gable over entrance with timbered end. Entrance boarded. Double one-over-one wooden window at left. Single pane wooden window in wooden surround above. Metal awning projecting out from porch.

38.(cont.) History::

Likely depicted on Hopkins.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:	
SLCAS036	117	Architectural Survey of The Ville	
3. County:		4. Address:	
St. Louis [Independent City]		2611 BELLE GLADE AV	
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☐	/	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):	
10. Ownership	11. Historic Use (if known):		11. Present Use:
	Sub-use:		Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Other	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Williams, J.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
CHERRY, GEORGE C JR & MYRTLE A			Lynn Josse, Michael Allen, CRO	3/31/2010
2611 BELLEGLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Clad in simulated stone masonry. Original wooden basement windows and first floor brick molds evident. Concrete porch with base clad in simulated masonry has metal columns under gabled roof.

38.(cont.) History::

Permit #H4569 issued 4-20-1912. One story brick dwelling. $2,000.00. Owner Margaret Brennen.
1920 census: Margaret Brennan (widowed) lives here with 4 children, still owns, the are white.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	118	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2612 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Offset Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Wood undetermined	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Cross Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Roff, Robert	
0		37. National Register eligible?
		Contributing NRc
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLEMAN, RETHA	Lynn Josse, Michael Allen, CRO	3/31/2010
2612 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Asymmetrical intersecting gable over entrance with vergeboards (now clad in metal) that extend under the roofline. Replacement door and windows.

38.(cont.) History::

certificate 1884 to owner Robt. Roff. $1000 alteration 4/14/1938 to owner M. J. Richie, $1000. 10/8/1963 room addition permit to Lorine Douglas

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

2612

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	119	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2613 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1926	Lawler, F. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
ARNOLD, EDDIE E & DIANN B JOHNSO			Lynn Josse, Michael Allen, CRO	3/31/2010
2613 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Dark brick label course at header level. Concrete stoop with metal columns supporting metal awning at slightly off-center entrance. One over one replacement windows on each side of entrance. Vergeboards, brackets and shed in gable end all clad in vinyl siding.

38.(cont.) History::

1926 owner: Sam Floun

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	120	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2615 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop, hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1908	Georges, Chas. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sanguinet, Geo. A.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DAVIS, VIRGINIA	Lynn Josse, Michael Allen, CRO	3/31/2010
4002 GARFIELD 1ST FLR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

Permit #F15

28. (cont.) Further description of important architectural features:

Red brick with burnished headers. Raised belt courses at sill level. Soldier course at second floor header level. Corbelling and patternwork form cornice. Stone sills. Jack arches. Double entrance with wooden casement and stone flat lintel. Open gabled hood over entrance supported by two large open brackets. Basement opening has original wooden multi-light window.

38.(cont.) History::

1908 owner: Geo. A. Sanguinet
1920 census: two white families rent here

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	121	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2616 BELLE GLADE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1926	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MOSS, SAMELLA & JAMES	Lynn Josse, Michael Allen, CRO	3/31/2010
2616 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red tapestry brick facade. Concrete steps and stoop with metal uprights support shed roof at entrance, just right of center. To either side is a jack arch window opening. Replacement door and windows. Exterior chimneys, right. Continuous dark brick soldier label course. Three narrow wooden brackets under front eaves. Hipped roof dormer has boarded opening in wooden surround.

38.(cont.) History::

1926 owner: Sam Floun

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	122	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2617 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Car Port (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop, hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1908	Georges, Chas. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sanguinet, Geo. A.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
COLE, MICHAEL J			Lynn Josse, Michael Allen, CRO	3/31/2010
2617 BELLE GLADE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a flat-roofed metal car port.

28. (cont.) Further description of important architectural features:

This red brick building has a façade of red brick with burnished headers. Wooden doors in entrance; transom boarded. Stone steps. Soldier course header at first floor and basement window openings; stone lintel over double entrance. A later Craftsman-era hood is over the two (original) front doors; it features knee brace brackets and an open gable with pierced patterned gable end. Continuous soldier course forms header for second floor openings. Corbelling and patternwork above. Tapered end blocks on parapet with rowlock cap. Jack arches. Stone sills. Wooden one-over-one windows behind storm windows.

38.(cont.) History::

1908 owner: Geo. A. Sanguinet
1920 census: both units rented by white families; head of one is naturalized German

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	123	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2618 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	Stoop	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1926	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MC CULLUM, GRETCHEN W	Lynn Josse, Michael Allen, CRO	3/31/2010
2607 BELLE GLADE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Replacement door is just right of center at a concrete stoop with metal railings. Openings have jack arches. Rowlock sills and dark brick soldier labels. Wooden four-over-one windows. Wooden brackets under projecting gable end, with wooden vergeboards and shingled shed at base. Three wooden brackets and timbering in gable end along with window surround around two wooden one-over-one windows.

38.(cont.) History::

1926 owner: Sam Floun

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ADT

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	124	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2620 BELLE GLADE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1926	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MARTIN, CLIFTON P & ERNA	Lynn Josse, Michael Allen, CRO	3/31/2010
2620 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted foundation. Red tapestry brick facade. Concrete stoop is just right of center; metal railings and uprights under flat roof. Replacement door and windows. Label course runs around window and door openings. Jack arches. Metal awnings at both façade windows. Gabled dormer clad in vinyl siding with boarded opening.

38.(cont.) History::

1926 owner: Sam Floun

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Weddings Made Simple
www.weddingsmadesimple.net
314-704-8432

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	175	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2622 BELLE GLADE AV
E. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1926	Lawler, E. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TIGER PROPERTIES INC	Lynn Josse, Michael Allen, CRO	3/31/2010
7811 GRANTWOOD OAKS CT		43. Date of revisions:
ST LOUIS MO 63123		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

This front gabled house has a red brick facade. Concrete stoop has wooden railings. Replacement door is just right of center. Openings have jack arches. Rowlock sills and dark brick soldier label courses. One-over-one replacement windows. Wooden brackets under projecting gable end, with metal-wrapped eaves and shingled shed at base. Three wooden brackets and timbering in gable end along with window surround around two wooden midcentury replacement windows.

38.(cont.) History::

1926 owner: Sam Floun

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	126	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2623 BELLE GLADE AV

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☐	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Domestic
	Sub-use: Specialty Store	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1	Full	☒ Addition(s) Date(s): 1903
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLE, HOZEL	Lynn Josse, Michael Allen, CRO	3/31/2010
2617 BELLE GLADE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

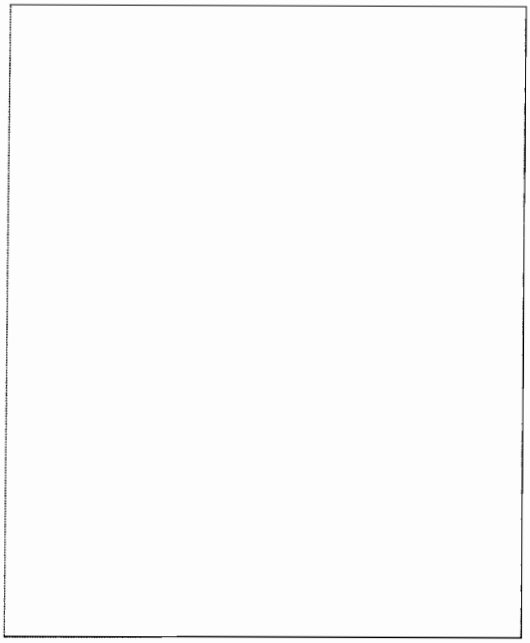

Site Map/plan (include north arrow):

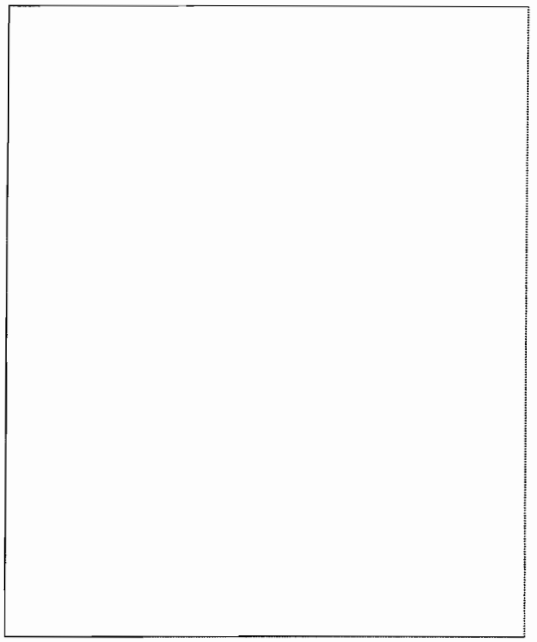

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Rubble stone foundation with smooth top course on front elevation. Red brick façade and front volume is attached to what appears to be an earlier frame dwelling. Storefront opening has steel beam header and boarded transom ribbon; the rest of opening is filled with concrete masonry units. Two window openings on second floor have stone sills with brick consoles and shaped stone lintels. Wooden one-over-one windows. Corbelling above on parapet that has center step. Entrance on south elevation.

38.(cont.) History::

1884 owner: Anton Strupel; addition to store and repair permitted 8/12/1902 to Mrs. M. B. Hurley, builder J. E. Batsch, arch. J. V. Majors, $1500
1920 census shows two white families at this address; the Bacekmann(?) family at 2623a owned the building and he is listed as a grocer

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	127	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2624 BELLE GLADE AV

E. City/State	Vicinity:	6. UTM:	7. Township/Range/Section	Not Applicable
St. Louis, MO	■	/	T: R: S.	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	Stoop	■ Moved Date(s):
18. Roof Material	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WILLIE LOU RILEY	Lynn Josse, Michael Allen, CRO	3/31/2010
2624 BELLE GLADE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Wooden stoop and steps. Entrance has wooden casement (replacement door) and gabled, open hood supported by projecting open wooden brackets. Wooden vergeboards with ogee-profile moldings.

38.(cont.) History::

1884 certificate: "Henry N. Baird by George W. Galloway"

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	129	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		2627 BELLE GLADE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Flat/Walkup hybrid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1928	Guth, H. W.	Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
	Stiely, A. H.	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HUGHES, JOSEPH P	Lynn Josse, Michael Allen, CRO	3/31/2010
4803 FOUNTAIN AV APT 2		43. Date of revisions:
ST LOUIS MO 63113203		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

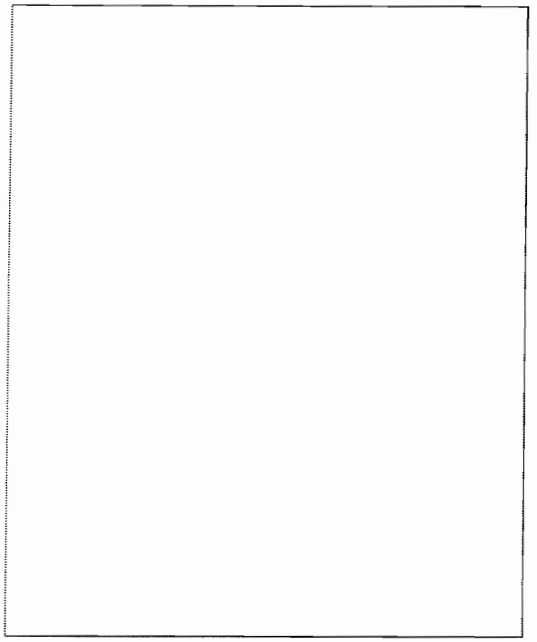

Site Map/plan (include north arrow):

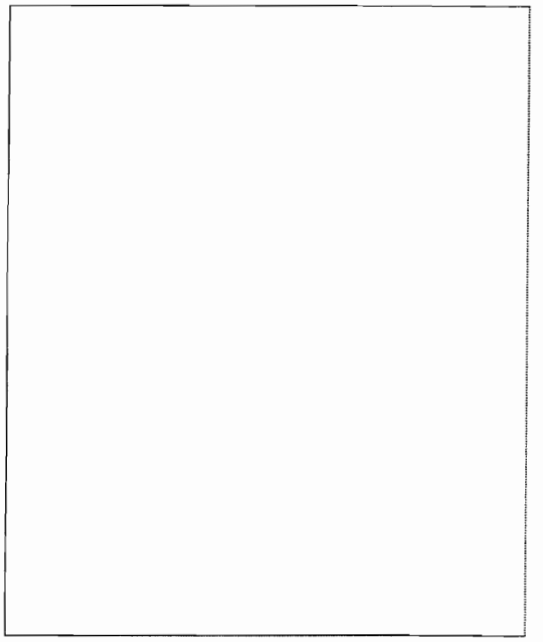

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Two buildings: a six-unit building facing Belle Glade and a nine-unit building facing Kennerly. Red tapestry brick walls. Shaped parapets on each street face that step up to center. Buff terra cotta course under parapet and buff terra cotta coping. Window openings have jack arches with rowlock sills and soldier course headers; paired one-over-one replacement windows inside. Door openings are in groups of three with jack arches and rowlock relieving round arches; stucco in pediments. Above entrances is patternwork that forms round arches and surrounds around buff brick. Concrete stoops with side steps to entrances. Raised basements.

38.(cont.) History::

Two 2-sty brick tenements, 5/5/1928 to owner Dubinsky Realty Co. (includes adjacent building on Kennerly)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

BELLE GLADE

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:		
SLCAS036	129	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		2628 BELLE GLADE AV		
5. City/State:	Vicinity: ☐	6. UTM:	/	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO				
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use:	Single Dwelling	Sub-use:	Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Vinyl	
15. Number of Stories	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
HUGHES, JOSEPH			Lynn Josse, Michael Allen, CRO	3/31/2010
4803 FOUNTAIN AV APT 2				43. Date of revisions:
ST LOUIS	MO	63113203		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a shed-roofed frame garage clad in asphalt shingles.

28. (cont.) Further description of important architectural features:

Porch has turned wooden columns and hipped roof. Wooden surround remains around entrance at right bay. Wooden vergeboards. Shed-roofed addition at south rear. Clad in vinyl siding. The center chimney is composed of segmental clay pieces.

38.(cont.) History::

1884 owner James Chadwick

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

2628

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	130	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1519-23 BILLUPS AV
E. City/State	Vicinity.	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WHITE, LINDA			Lynn Josse, Michael Allen, CRO	1/15/2010
4278 W ALDINE				43. Date of revisions:
ST LOUIS	MO	63112		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Entrance is at right bay. Parapet appears to be rebuilt with concrete coping. Stone belt course above foundation (clad in brick). Stone sill with brackets and lintel on window opening. Stonework is painted. Basement opening retains wide wooden mullion and wooden windows. First floor opening retains wooden one-over-one sash. Entrance altered. Concrete block stoop.

38.(cont.) History::

1920 census: black barber, wife and daughter
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1523

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	/31	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1525 BILLUPS AV
5. City/State:	Vicinity: ■	6. UTM: /
St. Louis, MO		
7. Township/Range/Section: Not Applicable	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Open Porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
COLEMAN, DORRIS D			Lynn Josse, Michael Allen, CRO	1/15/2010
2408 ROCKDALE DR				43. Date of revisions:
ST LOUIS	MO	63133		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

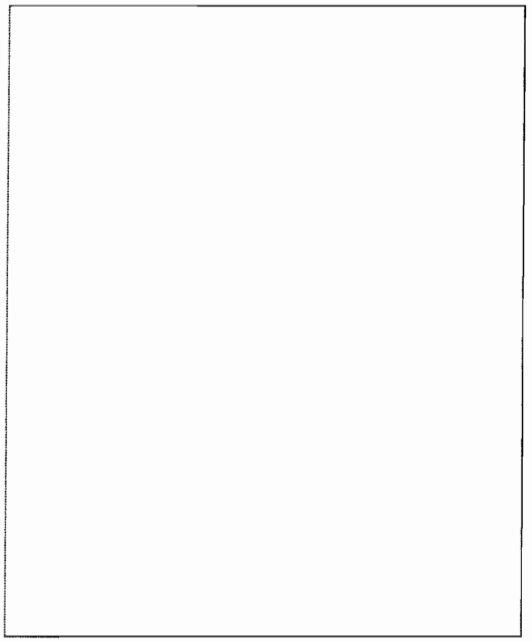

Site Map/plan (include north arrow):

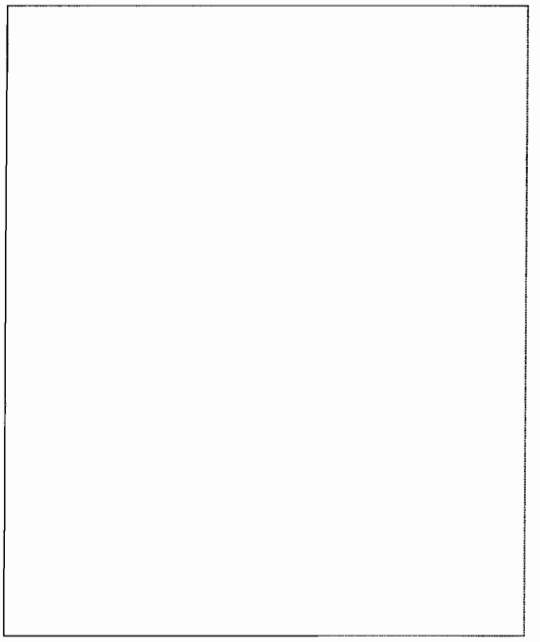

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Window and door openings are boarded. Entrance is at right bay. Although partly wrapped with metal, the original wooden bracketed cornice remains. Wood paneling in recessed entrance. Concrete porch has brick knee wall above open basement level. Historic wooden columns support a badly deteriorated hipped roof.

38.(cont.) History::

1920 census: Arthur, Green and Hattie (sic) and roomer couple; owners, black, he's a RR yardman, roomer is Railway car cleaner.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	132	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1700 BILLUPS AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Recessed 1-story	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1905	Mein, F. L.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Mein, F. L.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Goldstein, H.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MCKEE, CHANDA	Lynn Josse, Michael Allen, CRO	1/15/2010
1249 SUMMER LYNNE DR		43. Date of revisions:
O'FALLON MO 63366		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

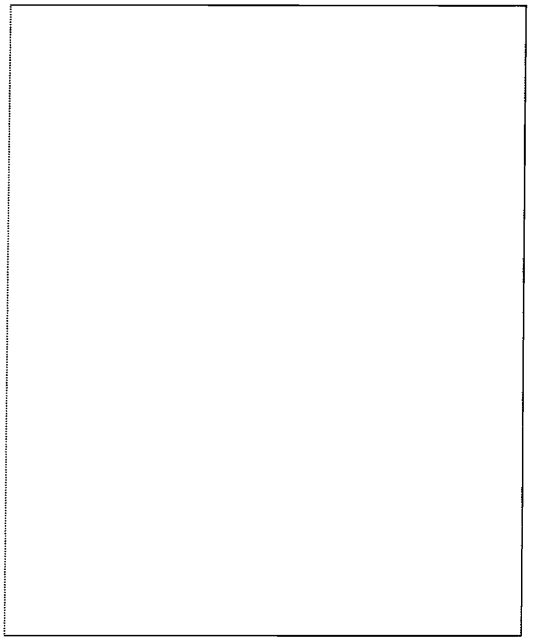

Site Map/plan (include north arrow):

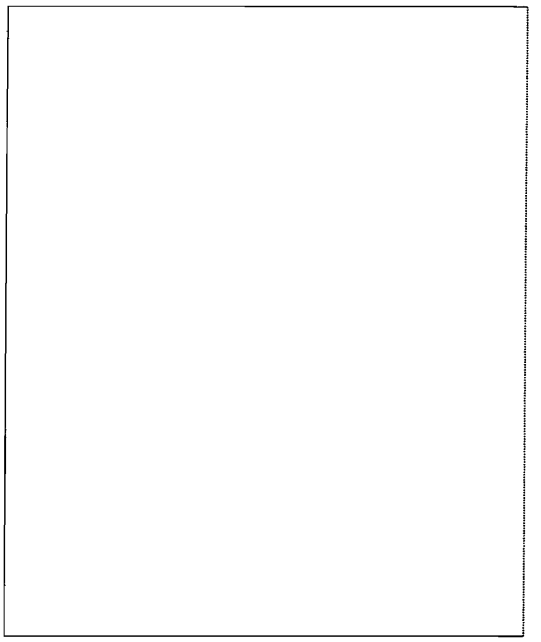

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Stone sills on window openings. Roman arches with tracing courses on first floor, segmental arches on second floor. Segmental arch above basement window has recessed bricks that form a pattern. Openings are boarded. There is a corbelled brick cornice that forms a shaped parapet with four blocks.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	133	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1701 BILLUPS AV
5. City/State:	Vicinity: ☐	6. UTM: /
St. Louis, MO		
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1892		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Feuerbach, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Feuerbach, H.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick front elevation, red brick side elevations. The entrance is at the left bay. Raised basement. Concrete porch that supports a metal canopy. Window openings at basement and first floor retain wooden windows. Cornice removed and replaced with vertical wooden siding with battens.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	134	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1707 BILLUPS AV
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	■	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Full	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1892		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Feuerbach, H.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Feuerbach, H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NEWSOME, STANLEY P	Lynn Josse, Michael Allen, CRO	1/15/2010
4217 WASHINGTON BL		43. Date of revisions:
ST LOUIS MO 63108		

FOR SHPO USE:

□ □ □ □ □ □
□ □
□ □
□

Architectural/Historic Inventory Form

Location Map (include north arrow):

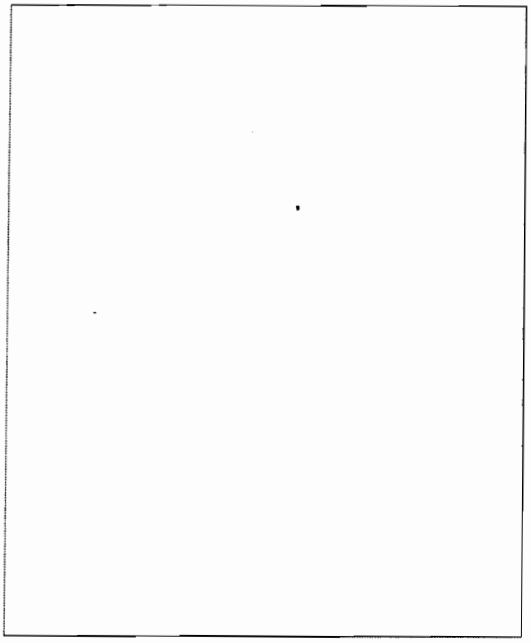

Site Map/plan (include north arrow):

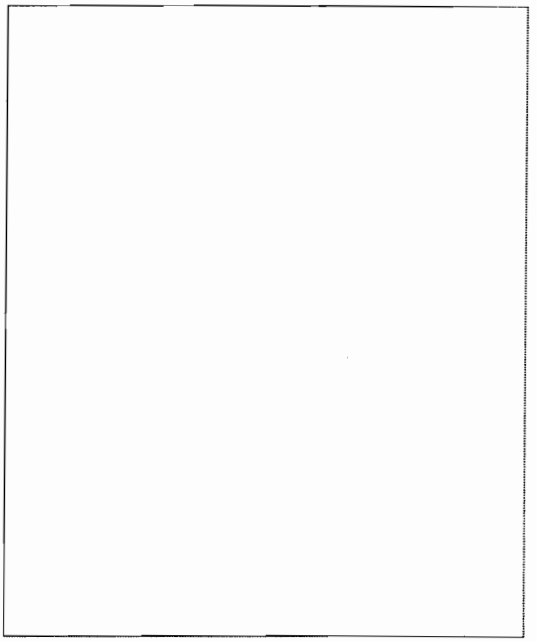

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Raised basement. Painted brick front elevation, red brick side elevations. The entrance is at the left bay. Porch has brick piers that support large wooden beams under a shed roof. Door opening has replacement door. Window opening has original muntins creating two large windows with three fixed-pane transoms above. Windows have been replaced. Ornate wooden cornice wraps corners.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

1707

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	135	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1709 BILLUPS AV
E. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐	
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1892		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Feuerbach, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Feuerbach, H.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

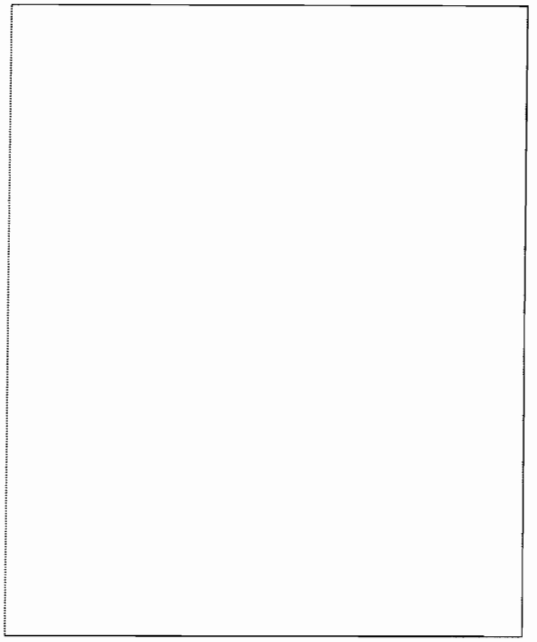

Site Map/plan (include north arrow):

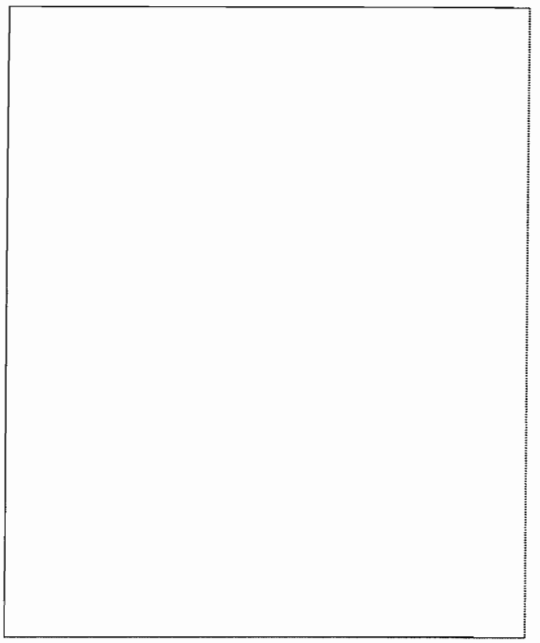

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation, red brick side elevations. Entrance at left bay. Raised basement. Concrete porch. Basement window opening has wide decorated muntins and second entrance (boarded). Entrance has wooden casement, transom and door. Roman arch window opening with stone sill is partly boarded, but original wooden sash is evident. Ornate wooden cornice above wraps corners.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	136	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		1713 BILLUPS AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1892		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Feuerbach, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Feuerbach, H.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
SPARKLING, MINNIE			Lynn Josse, Michael Allen, CRO	1/15/2010
1713 BILLUPS AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

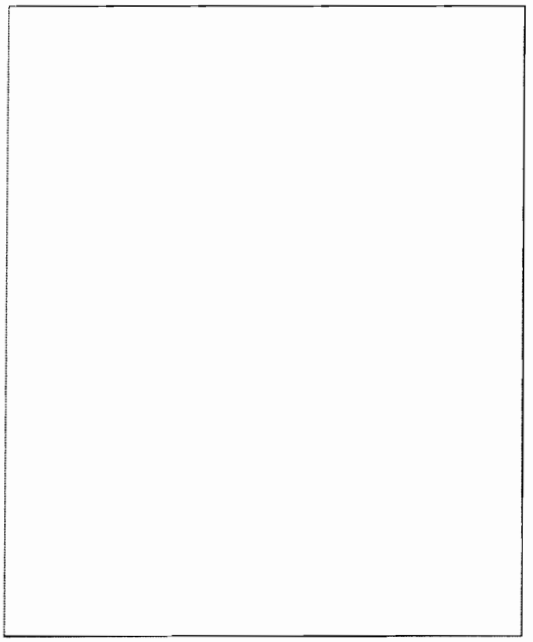

Site Map/plan (include north arrow):

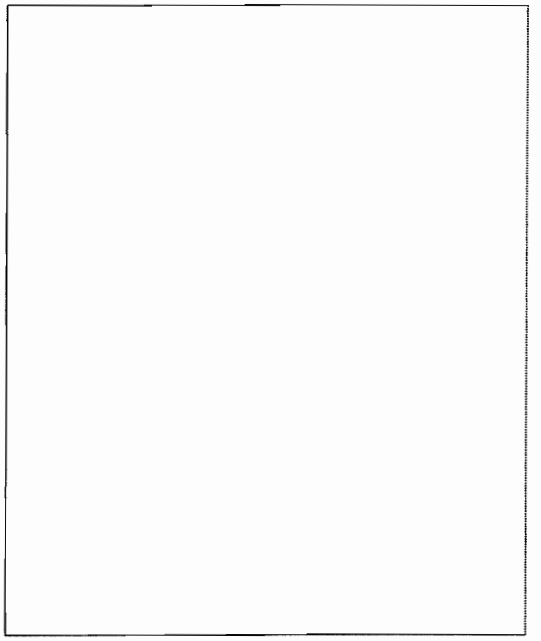

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick front elevation, red brick side elevations. Entrance at left bay. Raised basement is partly paged with a secondary entrance. Concrete porch supports a metal canopy. Entrance has replacement door. Window opening with stone sill has double one-over-one window. Ornate wooden cornice wraps the corners.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	137	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4216 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Wood undetermined	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories	22. Foundation Material:	
2	Undetermined	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Deck	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Welsh, David (orig own.)	
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address.	41. Form prepared by (name and organization):	42. Survey date:
LANG, JESSIE & CAROLYN S	Lynn Josse, Michael Allen, CRO	1/15/2010
4216 E COTE BRILLANTE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Front gabled frame house is clad in vinyl siding. All windows and doors have been replaced, including the wide horizontal fixed pane window at the first story's right bay. Metal awnings are at the first story's door, left, and window. The base of the building on the east elevation is clad in asphalt roll siding, and the foundation is not exposed anywhere so determination of material is impossible from exterior inspection.

38.(cont.) History::

1920 census:Cruthers, Richard and two sons, and boarder Zula DeMe..?; black, rent; he's a laborer in a steel foundry and one of the sons is a laborer in packing house.
1927 Red-Blue Book: 4216: Woolfolk, Branch (Florence); 4216a: Steele Frank (Mary)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ADT

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	138	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4219 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this two-story building is painted. Ornamental brick courses and metal coping form cornice. Entrance bay, left, is corbelled out to project at the second story. Front door is boarded. Columns attached to each side of entrance and unpainted area above show that porch has been removed. Window openings have stone sills on projecting brick bases and headers featuring rough-textured Roman bricks alternating with stretcher/header pairs. First floor openings boarded, second floor openings open without sash. This was formerly part of a row of three attached two-story flats, the eastern two-thirds of the row has been demolished.

38.(cont.) History::

1920 census: Gitton, Floyd and Laura and his father James, renters, black, Floyd is a RR clerk and James is a Pullman porter.
1927 Red-Blue Book: Lash Fred (Viola); Rooks Walter(Bessie) 4219 rear: Shelton, Wm
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	135	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4220 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1924		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	McMenanamy Real Estate Co (orig own)	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	McMenanamy Real Estate Co (orig own)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HORTON, LAURREIN J	Lynn Josse, Michael Allen, CRO	1/15/2010
4220 E COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The front gabled house has a façade of machine-raked dark red brick. Wide concrete steps lead up to gabled porch, which has high brick knee walls and piers. Gable ends are clad in hexagonal asbestos siding. Historic wood door in entrance, and wooden one-over-one windows in each opening.

38.(cont.) History::

1927 Red-Blue Book:Seay Aug A (Ethel)
1930 census:
1943 Negro Directory: 4220a: Lulabelle Kirkpatrick of Wayman Crow School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1610	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4221 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Thompson, Robt.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

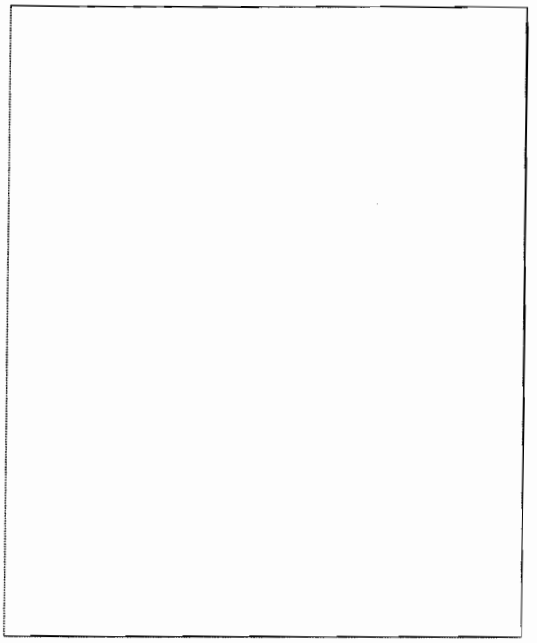

Site Map/plan (include north arrow):

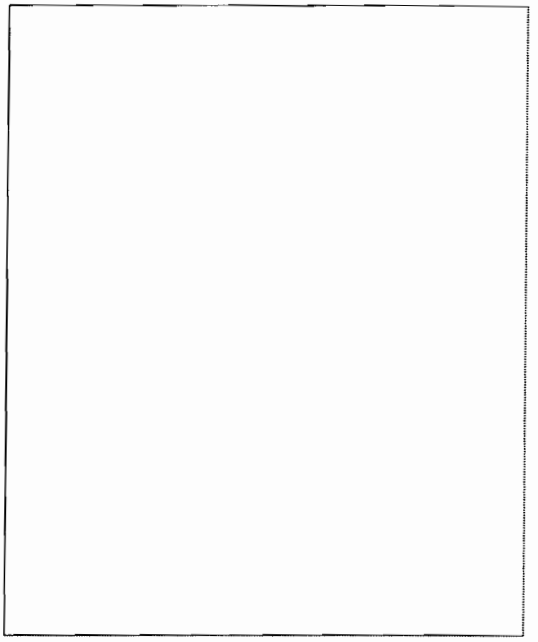

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted, rusticated stone foundation topped with smooth-faced course and red brick facade. Stone steps lead to porch at left bay, which has brick knee walls capped by stone and wood columns rising to a hipped roof over a dentillated cornice on all three sides. The double entrance is boarded. First floor window opening, right, has Roman arch with stone sill; opening is devoid of sash and boarded. Second floor window openings have stone sills and thick stone lintels; left opening has wooden one-over-one sash and right has a broken replacement window. A wooden bracketed cornice under a metal gutter pan sits below a false gabled roof clad in asphalt shingles, held between two side parapet walls..

38.(cont.) History::

1905 owner: Patrick Galvin
1920 census: McNeal, Edward and Coralie(?), his sister, her mother, and two boarders - renters, black, he's a butcher in a packing house, she's a laundress in a factory, sister a seamstress in a shirt factory, boarders are factory laundress and private family's maid. 4221A unit: Leroy(?), Robt and Alice and boarder; he's a laborer in packing house, as is boarder, renters, black
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1211	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4222 COTE BRILLIANTE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1924		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	McMenanamy Real Estate Co	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	McMenanamy Real Estate Co (orig own)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MARTIN, PAUL	Lynn Josse, Michael Allen, CRO	1/15/2010
61 WHITESIDE DR		43. Date of revisions:
BELLEVILLE 62221		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This front gabled bungalow has a machine-raked brown brick facade. Wide steps lead to porch, which has high brick knee walls and piers. Gable ends are clad in vinyl siding. The front door, just right of center, and windows to either side have been replaced.

38.(cont.) History::

1927 Red-Blue Book:Bradford Bazil (Hattie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4222
4X4

Missouri Department of Natural Resources
State Historic Preservation Office

Demolished 2010

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	142	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4224 COTE BRILLIANTE AV 63111
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	
7. Township/Range/Section:	Not Applicable	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular (Short Str. Fac.)	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☐ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☐ Altered Date(s):
Flat	Other Bay	☐ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☐ Other Date(s):
	Visible from public road? ☐	Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☐
		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40: Current Owner/address			41. Form prepared by (name and organization):	42. Survey date:
MITCHELL, VICKY			Lynn Josse	1/15/2010
8833 SHADY GROVE				43. Date of revisions:
ST LOUIS	MO	63136		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☐ listed ☐ in listed district ☐ eligible (individually)	☐ reconnaissance ☐ intensive	☐ yes ☐ no
Name: ☐ pending listing ☐ not eligible ☐ eligible(district) ☐ not determined	Other:	

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Rusticated stone foundation. Porch as cast stone piers, concrete steps. Boarded window opening has brick earmold, stone sill. Entrance has wooden door and is coverd by bracketed, gabled wooden hood. Wooden braketed cornice above. Deteriorated false gable above partly clad in asphalt shingles.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, plat maps, and building permits.

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	143	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4314 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912	Parsons, E.W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Parsons, E.W.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MC CALL, MELODY	Lynn Josse, Michael Allen, CRO	1/15/2010
4314 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

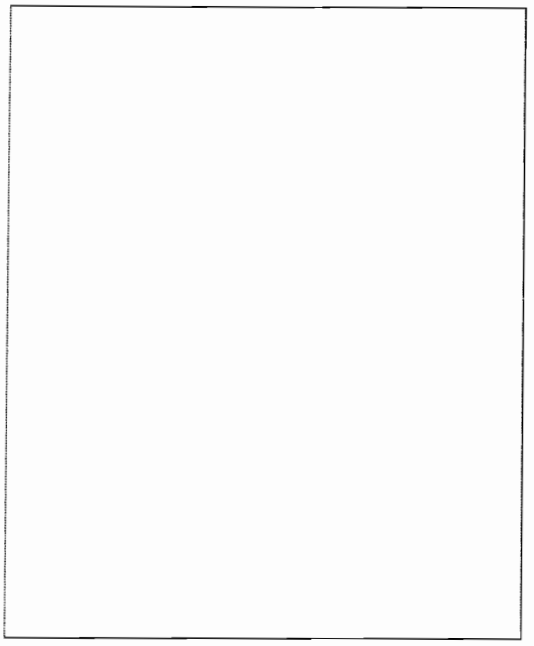

Site Map/plan (include north arrow):

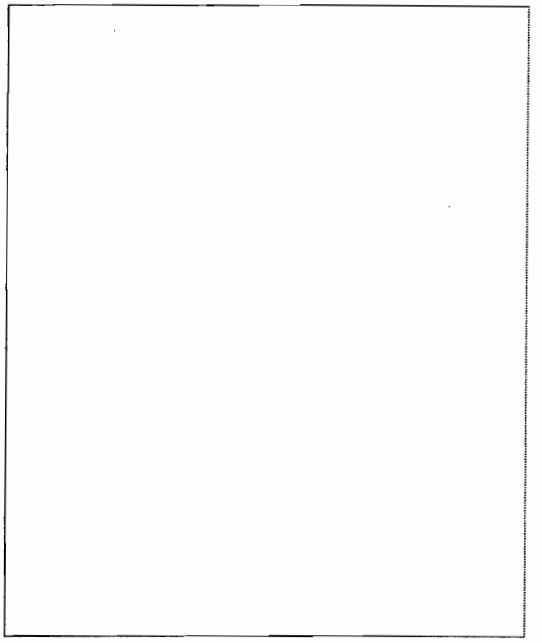

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation, red brick sides and rear. Brick porch piers rise to support gabled roof. Gambrel and gable ends clad in vinyl siding. Entrance at right bay featured metal replacement door with surround and glass block infill where sidelights and transom likely once were located. In left bay, the basement opening is filled with glass block and the first floor opening has single-pane fixed window surrounded by aluminum wrapped wood. Stone sill and earmold course around window opening. Window in gambrel end is fixed single-pane window.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Cromm Sarah Mrs
1930 census:
1943 Negro Directory: Abe Johns of Carr Lane School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4314

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	144	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4316 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912	Parsons, E.W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Parsons, E.W.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WILLIAMS, YVONNE & PERRY WARRE			Lynn Josse, Michael Allen, CRO	1/15/2010
4316 COTE BRILLIANTE				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

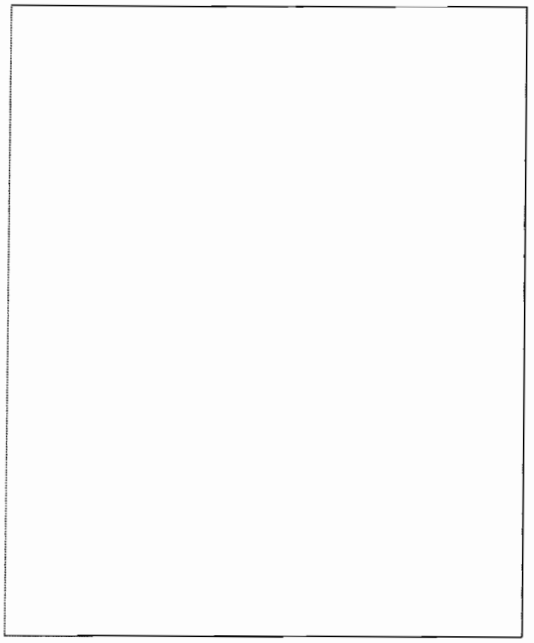

Site Map/plan (include north arrow):

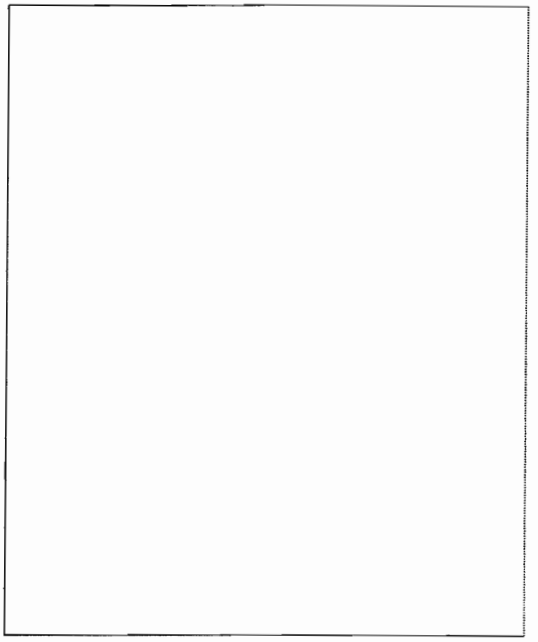

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation, red brick sides and rear . Brick porch has high knee wall with stone cap. Concrete steps. Piers remain at entrance, but roof is missing. Gambrel end clad in vinyl siding. Window opening with jack arch and replacement window. Entrance has original wooden dividers and door. Window opening on gambrel end is double window containing replacement windows.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Burton Danl W (Lizzie) dentist
1934 Negro Business Directory: Burton, dentist

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4316

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	145	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4317 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	recessed 1-story w/ open porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LUCAS, FRANCES	Lynn Josse, Michael Allen, CRO	1/15/2010
4317 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Partially painted. Rusticated stone foundation. Wooden porch, left, has a flat roof; apparently there was once a balcony there but the door has been replaced by a modern transomed window. Roman arch entrance leads to recess where one original door opening is covered. Wide arched window opening on first floor has stone sill and raised tracing course. Second floor openings have stone sills and tall headers and segmental arches. Replacement windows. The upper metal section of the cornice is missing, and the parapet wall above it appears rebuilt (like in the early to mid 20th century).

38.(cont.) History::

1920 census: Taylor and Sarah Davis and their niece (age 10), black, renters, he's a chauffeur. Upstairs William and jennie McManus (?), black, renters, he's a laborer in a car shed. 1927: Davis Taylor (Sarah) and a) Green Jas.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	146	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4318 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1912	Parsons, E.W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Parsons, E.W.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PARKER, JOHN	Lynn Josse, Michael Allen, CRO	1/15/2010
4318 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

Red brick walls. Basement window opening bricked in. At right bay, concrete steps up to brick porch with a gable roof. Entrance configured with center door, sidelights and transom; all elements appear original. Porch has original wooden fascia boards and vergeboards with vinyl siding in gable end. Gambrel end clad in vinyl siding with two replacement windows in openings with louver centered above. Window opening at first floor has stone sill and a wooden one-over-one window behind storm windows.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Wright Andrew (Birdie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	147	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4319 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HARRINGTON, VERNELL	Lynn Josse, Michael Allen, CRO	1/15/2010
4319 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

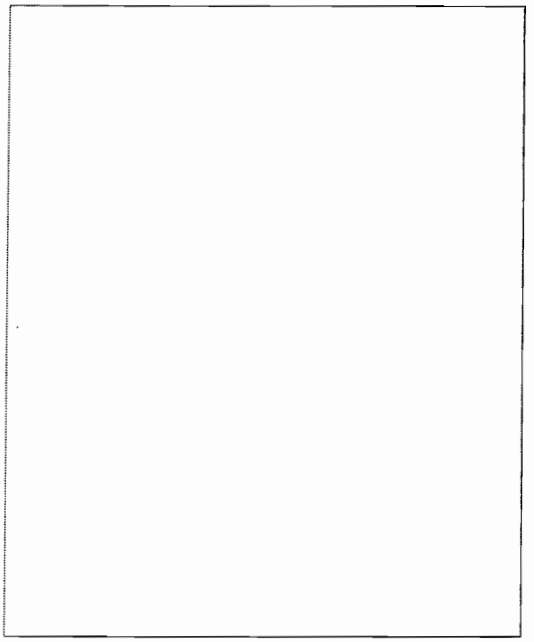

Site Map/plan (include north arrow):

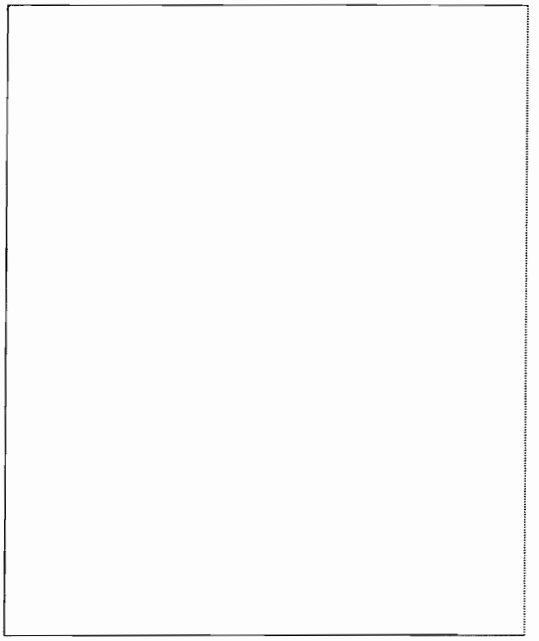

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a painted-front brick two-story building. Like its neighbor at #4327, this former two-family building appears to have had both a recessed entry and a porch with a balcony on top. Rusticated stone foundation and lintels. At the right bay the first story window opening is obscured by a tall metal awning, but the pair of windows underneath are clearly replacements. At the second story, the former balcony door opening at the left bay and the two windows at the right retain their thick stone lintels but below them are 6 courses of brick and short replacement windows. Entrance altered to one door opening surrounded by imitation stone veneer. Shaped parapet, metal cornice are underneath a parapet wall with end blocks and later brick coping.

38.(cont.) History::

1920 census:John D. and Deonia(?) Whitman, renters, black, and son. He is a hod carrier, she is a mail clerk at the Post Office.
4319a: Robt. And Henrietta Nea, renters, black, he's a janitor for a private family.
1927 Red-Blue Book:Vaughn, Anson (Elnora)/ a) Smith Theresa notary
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

319

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	148	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4323 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Front Slope	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Tudor Revival	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Cross Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1936	Reither & Sternberg	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reither, Julius F.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Bledsoe, Frank	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
HUGHES, CHARLES D & STELLA F			Lynn Josse, Michael Allen, CRO	1/15/2010
1576 MENDELL DR				43. Date of revisions:
ST LOUIS	MO	63130		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

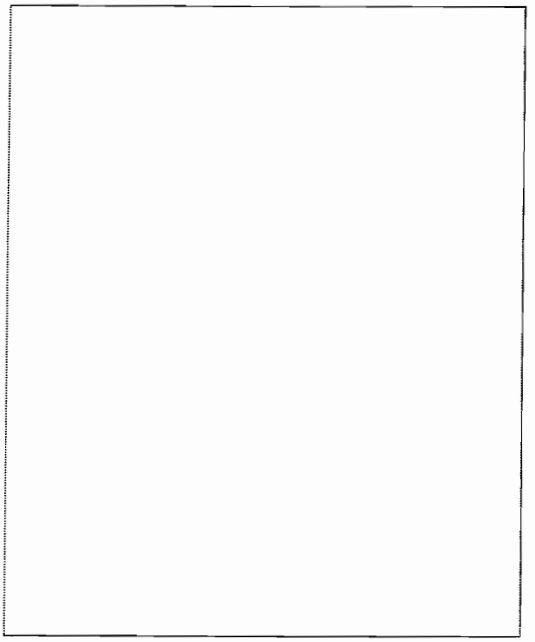

Site Map/plan (include north arrow):

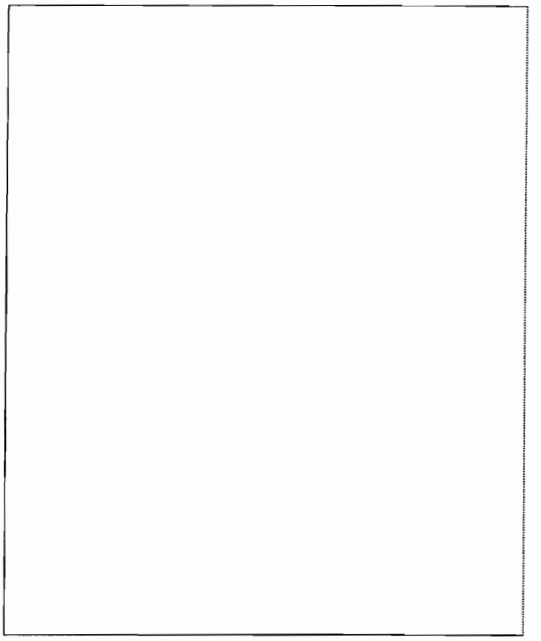

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled brick garage with wooden doors.

28. (cont.) Further description of important architectural features:

Red brick. Side gabled roof with intersecting asymmetrical front gable. Front gable end divided into entrance surrounded by a soldier course round arch and triple window in opening under a small window. Metal inset mailbox opening to left of entrance. Two other window openings flank a brick chimney with tapered left side and square chambers placed diagonally above the lower body. Window openings have brick sills and large, painted wooden headers; inside are wooden four-over-one windows. Low concrete stoop with metal railings that run down concrete steps.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

5323

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	1219	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4324 COTE BRILLIANTE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gooch, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
BROWN, CAYLOMA			Lynn Josse, Michael Allen, CRO	1/15/2010
4327 ALDINE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

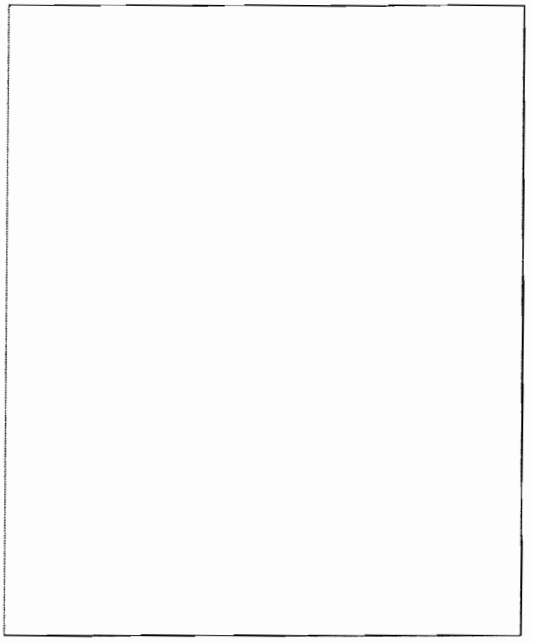

Site Map/plan (include north arrow):

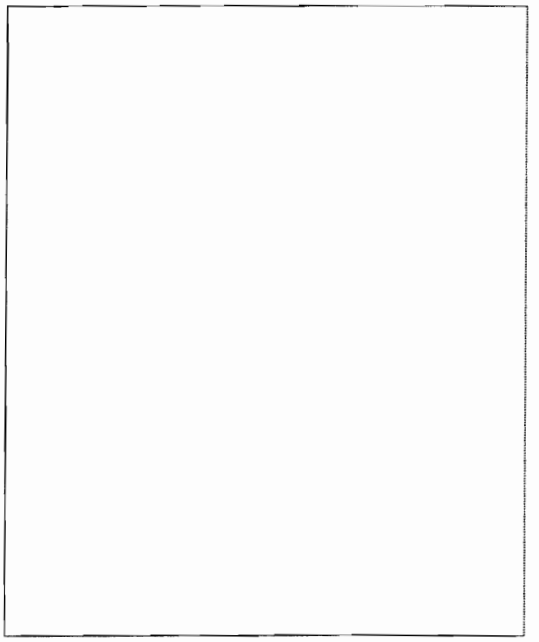

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled frame garage clad in weatherboard. (contributing)

28. (cont.) Further description of important architectural features:

Buff brick. Full porch has wooden steps, brick piers and a low hipped roof. Entrance at right bay has original wooden dividers, door, transom and sidelights with muntins. Window opening on first floor has stone sill contains a double one-over-one window. Gambrel end clad in vinyl siding with two window openings containing replacement one-over-one windows with false muntins in upper sashes.

38.(cont.) History::

1927 Red-Blue Book: Brown Fannie E Mrs
1930 census:
1943 Negro Directory: Cayloma Brown, Wheatley School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	150	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4326 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Masonite	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gooch, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co. (orig. owner)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HOLMES, BRIENNE K	Lynn Josse, Michael Allen, CRO	1/15/2010
4326 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

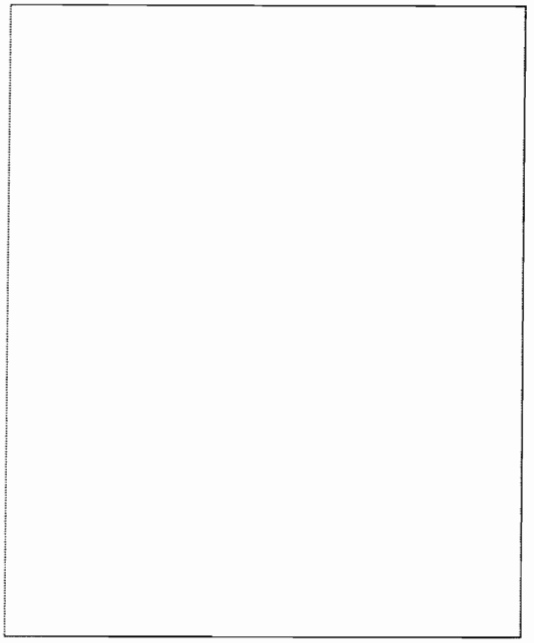

Site Map/plan (include north arrow):

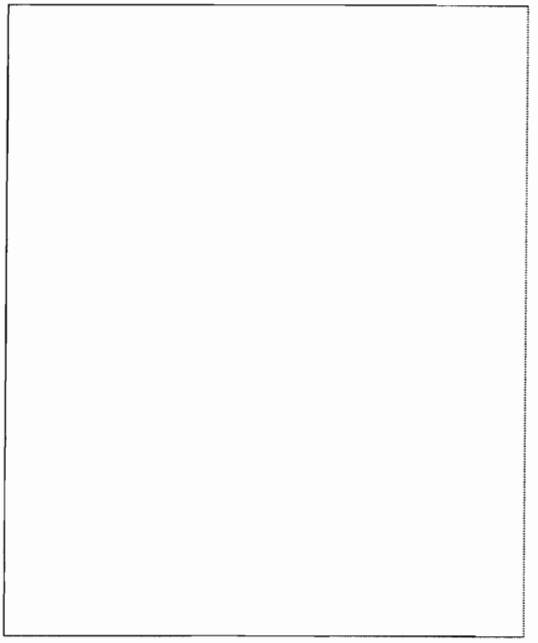

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled frame garage clad in weatherboard.

28. (cont.) Further description of important architectural features:

Painted front elevation, red brick sides and rear. Concrete steps on brick porch with open stone-capped knee walls and stone-capped piers supporting a hipped roof. Original wooden fascia board and ceiling on porch. Entrance at right bay has original wooden dividers, transom and sidelights, but door has been replaced. Stone sill on first floor window. Gambrel end clad in masonite siding with paired windows in central opening. Replacement one-over-one vinyl windows arte in all openings.

38.(cont.) History::

1927 Red-Blue Book: Turner McKinley H (Nettie)
1930 census:
1943 Negro Directory: John A. Nelson, Sumner High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

SALE

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	13	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4327 COTE BRILLIANTE AV		
E. City/State:	Vicinity:	6. UTM:		7. Township/Range/Section: Not Applicable
St. Louis, MO	☒			T: R: S:
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use: Multiple Dwelling		Sub-use: Multiple Dwelling	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
2½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Other	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1935		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Rice, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Gibson, Lee	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HUGHES, PATRICIA D & AGONCILLO	Lynn Josse, Michael Allen, CRO	1/15/2010
4327 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled brick garage.

28. (cont.) Further description of important architectural features:

Red brick. The house has a medium front-gabled roof with a shed roof wing on the west side and a jerkinhead configuration on the south end. Concrete steps on each end of full porch with flat roof and knee wall with bullnosed brick cap. Entrances on each side of first floor center window opening with brick sill containing triple window. Windows are wooden six-over-one. Second floor opening has door flanked by window openings. Multi-paned wooden door, replacement windows. Louvered vent in opening above. Contrasting buff brick patternwork around opening and above, with limestone blocks for accent.

38.(cont.) History::

1927 Red-Blue Book: not listed
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4827
URBAN LEAGUE
1649

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	152	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4330 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: / 7. Township/Range/Section: Not Applicable
St. Louis, MO	■	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Masonite	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Gambrel	Full	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gooch, H.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HEETER, PATRICIA JAMES	Lynn Josse, Michael Allen, CRO	1/1/5/2010
4330 COTE BRILLIANTE AVE		43. Date of revisions:
ST LOUIS MO 63115		

FOR SHPO USE:

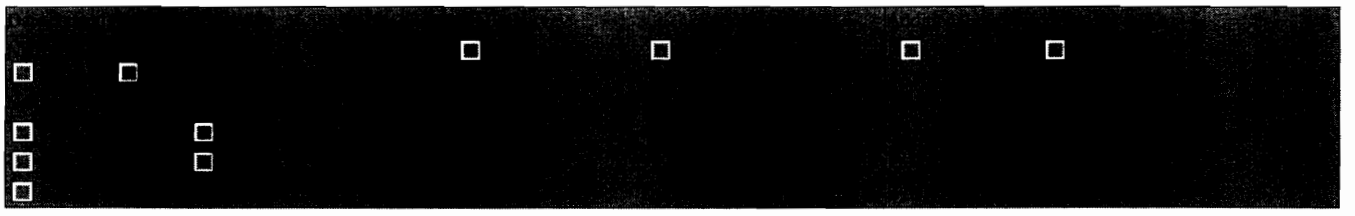

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

Buff brick. Full porch with brick piers supports hipped roof. Porch has concrete steps and metal rail. Entrance at right bay with original wooden door, sidelights, transom and dividers. Sidelights have muntin dividers creating pattern. Window opening on first floor with stone sill contains one-over-one window. Gambrel end clad in asbestos siding with two window openings. Wooden four-over-one windows.

38.(cont.) History::

1927 Red-Blue Book: Owens Arth G (Carrie)
1930 census:
1943 Negro Directory: Lina May Daugherty, Wheatley School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	153	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4331 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1930	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen R.E. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Lerner, Sophie	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLE, HERMAN & LINDA D	Lynn Josse, Michael Allen, CRO	1/15/2010
4331 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☒

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brown brick with yellow brick accents. Stone base at battered piers of porch and around concrete steps. Center entrance with replacement door. Flanking window openings with stone sills and wooden six-over-one windows. Shed-roofed gable clad in stucco with center paired window openings. Six-over-one wooden windows in openings. Chimney at right runs through gable and capped with yellow brick. Gable flares to form porch roof.

38.(cont.) History::

Permit date: 6/20/1930.
1930 census:
1943 Negro Directory: Rodney G. Higgins, Ph. D., Stowe Teachers and Junior College, and Maude Oswald of Dessalines School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	154	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4332 COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Asphalt	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gooch, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WALLS, REGINA PITTMAN	Lynn Josse, Michael Allen, CRO	1/15/2010
900 LYNNWOOD BLVD		43. Date of revisions:
NASHVILLE TN 37205		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Smooth stone band at base of wall. Porch has concrete steps and brick skirt, knee wall and piers supporting low hipped roof. Wooden fascia board, soffits and eaves on porch. Entrance at right bay boarded but original wooden dividers, sidelights and transom evident. Basement window opening has paired wooden single-pane windows. First-floor opening with stone sill has wooden one-over-one window. Two second floor openings with stone sills have wooden twelve-over-one windows. Gambrel end above second floor clad in asphalt shingles with vent at center.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Lewis David (Hattie)
1930 census:
1943 Negro Directory: Sara Francis Steele of Divoll School, Regina Steele of Lincoln School, Ernestine Steele of Marshall School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

{ Listed 2/20/09 }

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.	2. Survey Name:
SLC-3026 155	Architectural Survey of the Ville
3. County:	4. Address:
St. Louis [Independent City]	4335 COTE BRILLIANTE AV

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):
Dreer, Herman House	

10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1930	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen R.E. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
Ethnic Heritage	Herman Dreer	
Black		37. National Register eligible?
		Individually Eligible

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BANKS, RALPH C & SARA	Andrea Gagen	
4335 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

38.(cont.) History::

1920 census: Reed, Donie? And Malvina? And 3 children, black, renters, Dad is teamster at Express Co... this is probably rear house
1927 Red-Blue Book: not listed
1930 census:
1943 Negro Directory: Herman (Sumner Asst Pr.) and Vivian (Vashon) Dreer are both listed here, and at 4335a, John W. Davis of Vashon

38. (cont.) Significance

Listed in National Register of Historic Places (2/20/09).

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	150	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4336 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gooch, H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Jefferson Realty & T. Co.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TOLEDO, LOUISE K & DONNA TOLEDO	Lynn Josse, Michael Allen, CRO	1/15/2010
4336 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick. Concrete steps match parging at base of porch and part of foundation of house. Porch has metal rails on sides and brick piers supporting a low hipped roof. Basement window opening has wooden window. Entrance at right has replacement door and original surround, transom, sidelights and dividers. First floor window has stone sill and wooden one-over-one window. Gambrel end clad in vinyl siding above first floor. Paired one-over-one replacement windows in opening at center of second floor.

38.(cont.) History::

1943 Negro Directory: Andrew S. Jackson of Sumner High School
1927 Red-Blue Book: Bland Aaron
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	157	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4337 COTE BRILLIANTE AV
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐	

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1928	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen R.E. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marget, M.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HAYNES, MINNIE B	Lynn Josse, Michael Allen, CRO	1/15/2010
4337 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brown brick. Concrete steps and ashlar-bond stone piers on porch; outer piers are battered and support low gabled roof with timbering in gable end. Entrances on sides of first floor flank center window opening containing paired replacement windows. Second floor has center window opening containing paired wooden six-over-one windows flanked by openings containing four-over-one windows. Contrasting brown brick courses form header uniting all three openings and arch around center opening. Stone lozenge in arch above opening. Shaped parapet rises to pediment at center with contrasting brick trim. Stone coping.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: - not listed
1930 census:
1943 Negro Directory: Wm. T. Smith, principal of Penrose School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	158	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4339 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1928	Standish, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gordon-Horen R.E. Co.	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marget, M.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SMITH, KIRK W & PAULA J	Lynn Josse, Michael Allen, CRO	1/15/2010
4339 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

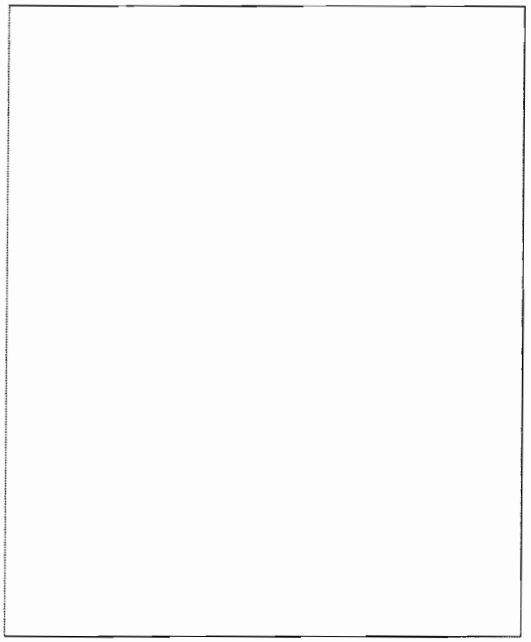

Site Map/plan (include north arrow):

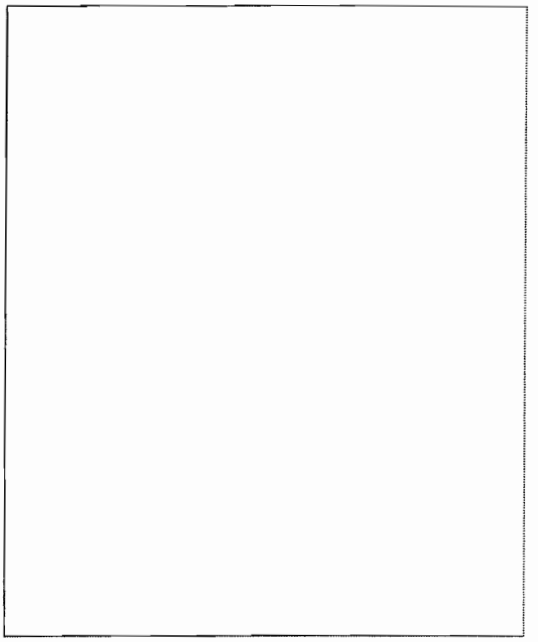

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Light brown brick with contrasting buff brick forming earmolds around window and door openings. Concrete steps lead up to brick porch that forms a balcony over the entrance and with a segmental arch opening. Porch is open on left side with knee wall capped by painted concrete. Windows and doors all replaced. Wall projects slightly around second floor door opening; ornamental pattern above. Contrasting brick soldier course runs across parapet, which is coped with concrete.

38.(cont.) History::

1930 census:
1943 Negro Directory: Doris Bruce, Simmons School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	159	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4343 COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1912	Mayo, Amanda	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Mayo, Amanda	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Mayo, Amanda	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BETTS, CECELIA A	Lynn Josse, Michael Allen, CRO	1/15/2010
4343 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brown brick, with quoining at corners. Concrete steps to brick porch with stone cap on knee wall; piers support medium gable rood with timbered gable end. Entrance original with door, sidelights and transom. Wooden replacement material covers second floor bay, cornice line and pedimented false gable. Windows all replaced with one-over-one vinyl windows.

38.(cont.) History::

1920 census:Guest, Robt L and Katie (Mulatto) and their black live-in chauffeur Lindsay, Lewis age 20, and servant Sylvene(?) Rufford(?), age 20. Robt.'s job is listed as Chief on a Railroad
1927 Red-Blue Book: Mayo Amanda Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	100	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4347 COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1928		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	McKeever, George	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
STARR, EDGAR			Lynn Josse, Michael Allen, CRO	1/15/2010
10757 SPRING GARDEN				43. Date of revisions:
ST LOUIS	MO	63137		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Tapestry brick walls. Porch roof slightly inset at each side. Porch has knee walls, with stone caps on "piers" at each side of entrance. Concrete steps. Gabled dormer with exposed rafter tails under overhang. Entrance bay at right. Windows and doors replaced and covered with security grilles.

38.(cont.) History::

1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4347

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1101	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4351 COTE BRILLIANTE AV
E. City/State:	Vicinity: ■	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Metal	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Low Gable	Open Porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1924	none listed	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hoover, J.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SCOTT, HILLARD & GERALDINE	Lynn Josse, Michael Allen, CRO	1/15/2010
9401 STACY PL		43. Date of revisions:
ST LOUIS MO 63132		

FOR SHPO USE:

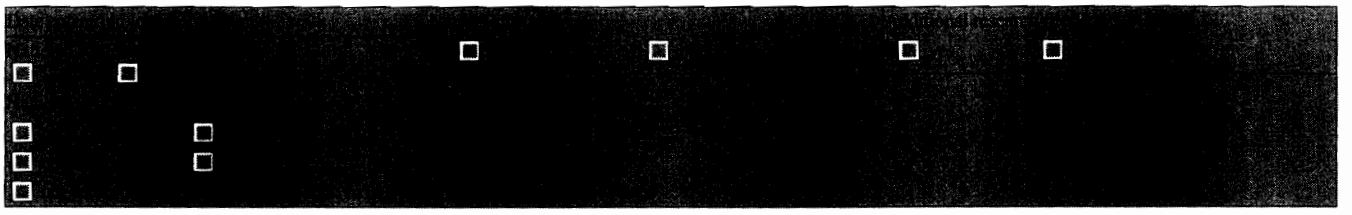

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Imitation stone veneer clads foundation of the red brick facade. Entrance at left bay with wooden door. Porch is brick with gable roof. Gable end clad in vertical metal siding. Window opening has wooden Chicago-style window under metal awning. Basement opening filled with glass block.

38.(cont.) History::

built on same permit as #4353
1927 Red-Blue Book: Eirnie Thos W (Lillian)
1930 census:
1943 Negro Directory: Peter E. Frisby of Waring School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4351

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:	
SLCAS036	167	Architectural Survey of The Ville	
3. County:		4. Address:	
St. Louis [Independent City]		4353 COTE BRILLIANTE AV	
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☐	/	T: R: S:
8. Historic Name (if known)		9. Present Name (if known):	

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Asphalt	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s)
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1924	none listed	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hoover, J.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
BENNETT, H W			Lynn Josse, Michael Allen, CRO	1/15/2010
P O BOX 477				43. Date of revisions:
SWEETWATER	TN	37874		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Parged foundation, rough machine-raked red tapestry brick wall. Brick porch with piers supporting gabled roof. Fascia boards missing. Entrance at left bay has replacement door. Boarded window in opening with brick sill shows evidence of wooden sash below. Gable end and porch gable end clad in polychromatic, irregular synthetic shingles.

38.(cont.) History::

built on same permit as #4351
1927 Red-Blue Book: Lennon Clyde (Martha)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

HBD
07

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1163	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4354 COTE BRILLIANTE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1925	Steele, J.R.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Steele, J.R.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Steele, J.R. and M.L. Steele	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DUNLAP, HENRY T & EVA M	Lynn Josse, Michael Allen, CRO	1/15/2010
4354 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

High basement, tapestry brick. Concrete steps. Porch has brick patternwork on face, high wall, battered piers supporting wooden beams under low hipped roof. Entrance has replacement door. Window openings with brick sills contain wooden four-over-one windows. Soldier course header runs across second floor windows. Shaped parapet with some patternwork.

38.(cont.) History::

1927 Red-Blue Book: Lindsay Arnett (Anabel)
1930 census:
1943 Negro Directory: Raleigh Morgan, Jr., Sumner High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	1604	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4356 COTE BRILLIANTE AV		
5. City/State	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	■	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use: Single Dwelling		Sub-use: Single Dwelling	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Asphalt	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Medium Gable		■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLLINS, BOBBY & MATTIE	Lynn Josse, Michael Allen, CRO	1/15/2010
4356 COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The house is clad in asphalt roll siding that imitates tapestry brick. Three window openings have flat tops and are filled with vinyl replacement windows. There is a atone foundation. The entrance is on the east elevation. The eaves and vergeboards are wrapped in metal.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Bruce Donald F (Adelaide)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	\ Lp 5	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4364 COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Low Gable	Open porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1875		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CARTER, SHEILA	Lynn Josse, Michael Allen, CRO	1/15/2010
3505 HEBERT ST		43. Date of revisions:
ST LOUIS MO 63107		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Low front gable with projecting eaves and returns. Wooden two-over-two windows in two first floor openings on front elevation. Small window opening on second floor has wooden brickmold and four-paned sash. Painted, coursed, rock-faced stone foundation. The front door is at the left bay at a modern frame porch; the door is relatively new.

38.(cont.) History::

Appears on Hopkins map and Compton & Dry view. Apparently this is a brick house at the right two bays with a frame addition, possibly an open porch, at the left bay by 1909. It is not known at what point the porch was enclosed (if it was a porch) and the façade assumed its present symmetrical front gabled appearance.
1920 census:
1927 Red-Blue Book: Walker Thos L (Eula) phys
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4364

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	1610	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4200-2 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Craftsman	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	hood	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1927		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Rosemond, R. R.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Flowers, P. P.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
FARMER, RENEE			Lynn Josse, Michael Allen, CRO	1/15/2010
4200 COTE BRILLIANTE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brown brick. Projecting wooden false gable end supported by four brackets. Entrance covered by wooden gabled hood supported by two brackets. Window openings have stone sills and square stone blocks accenting headers. Entrance missing doors. Window openings partly covered by vinyl siding.

38.(cont.) History::

1927 Red-Blue Book: not listed
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	167	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4204 W COTE BRILLIANTE AV

E. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	■	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Open porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1917	White, J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Flowers, P.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Brick porch at right bay has deteriorated roof, and intact wooden fascia and brackets.. Entrance and sidelights boarded. Window openings have stone sills. Unboarded second floor window has wooden one-over-one sash with broken glass. Wooden cornice forms pediment at left bay's parapet wall; timbering in pediment. Enameled white brick forms three lozenges at parapet over right bay. Metal coping.

38.(cont.) History::

1920 census: Flowers, Peter and Josie, 2 daughters and boarder, black, owners. He is a railway mail clerk; boarder is masseuse with own business
1927 Red-Blue Book: Flowers P. P. (Josie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	168	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4208 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: / 7. Township/Range/Section: Not Applicable
St. Louis, MO	■	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Full	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Pitman, C. A.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BROWN, JULIA	Lynn Josse, Michael Allen, CRO	1/15/2010
4208 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This house has a dark red brick façade. Concrete steps lead up to frame porch with brick piers at either end and columns on brick bases (columns probably added) at steps. Entrance in right bay has replacement door. Window openings have stone sills. Replacement vinyl windows except for original small wooden window to right of entrance. Wide false gable at parapet retains projecting wooden soffit, fascia and eaves as well as decorative brackets, timbering and (painted) stucco.

38.(cont.) History::

1920 census: John W. Dan(?), Railroad porter, is owner, a household all his own; and 2nd household is renters Claiborne and Beatrice Riddle and daughter, he's a postal clerk, and all are listed as Mulatto.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4208M

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	109	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4210 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Full	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1913		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Pitman, C. A.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PORTER, ANTHONY	Lynn Josse, Michael Allen, CRO	1/15/2010
4210 W COTE BRILLIANTE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick facade. Wood steps up to full-width hipped porch with 3 brick piers. Window openings have stone sills. Front door and first floor left bay window boarded. Small, high window opening to right of door retains single-pane wooden sash. Second floor openings have deteriorated wooden eight-over-one windows. False gable end with projecting wooden soffit, fascia and eaves as well as wooden brackets and timbering with stucco.

38.(cont.) History::

1920 census: Jerry and Jennie Cherry and boarder, owner, black ; Jerry is a railroad steward; boarder William Schuance(?) is a barber with his own business. 2nd household: renters, black: John and Blanche Purnell and daughter, he is a public school teacher.1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4210

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	170	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4216 W COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Walk-Up (four family)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	hood only	■ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1926		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Schmidt, H.	36. On National Register? ■ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ■ district
0	Cassel, Jos. & Julia Nubbard	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

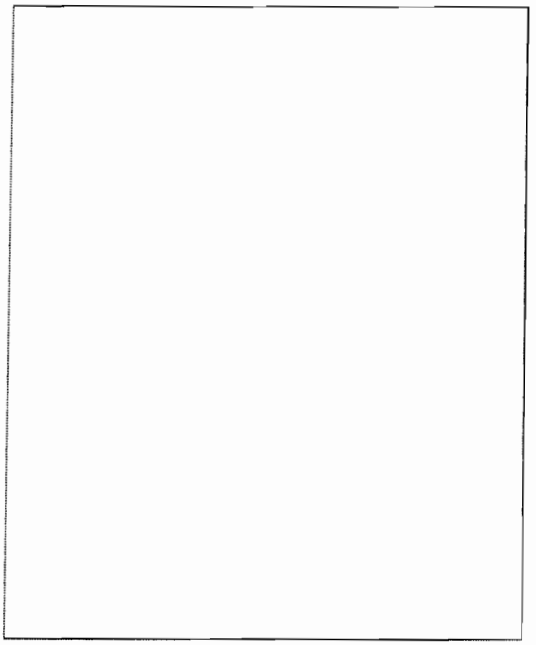

Site Map/plan (include north arrow):

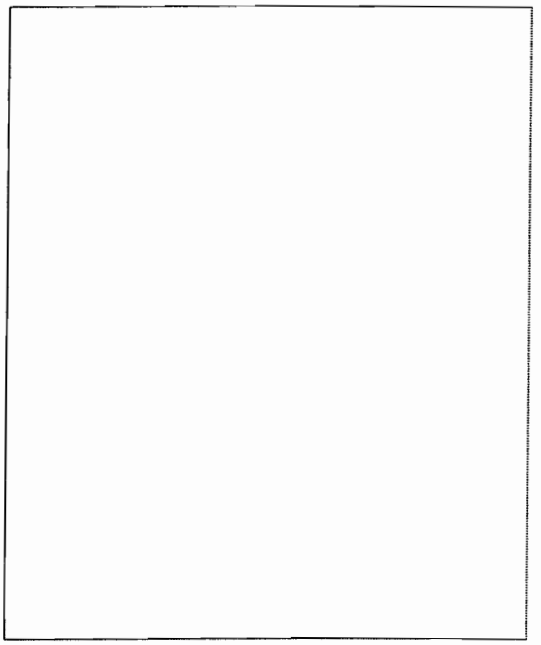

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The red brick façade of this four family walkup building is symmetrical. Hipped-roof wooden hood over entrance, center bay. Projecting hipped pent roof above second floor has wooden supporting brackets. Left and right bays have paired windows in openings; windows damaged. Central bay has wooden one-over-one window in opening over entrance that is missing its door and has covered sidelights..

38.(cont.) History::

This permit was filed with 3680 but appears to be the right one.
1927 Red-Blue Book:4216a: Singleton Jordan (Martha) no listing for another unit
1930 census:
1934 Negro Business Directory: 4218W: Ernest Stubblefield, carpenter
1943 Negro Directory: Mosley, W. G., principal of Vashon High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	\7\	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4220 W COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1911		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Wahlus, W. E. C.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Thomas, J. C.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ADAMS, FREDDIE	Lynn Josse, Michael Allen, CRO	1/15/2010
11835 BRAMPTON HUNT RD		43. Date of revisions:
FLORISSANT MO 63033		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

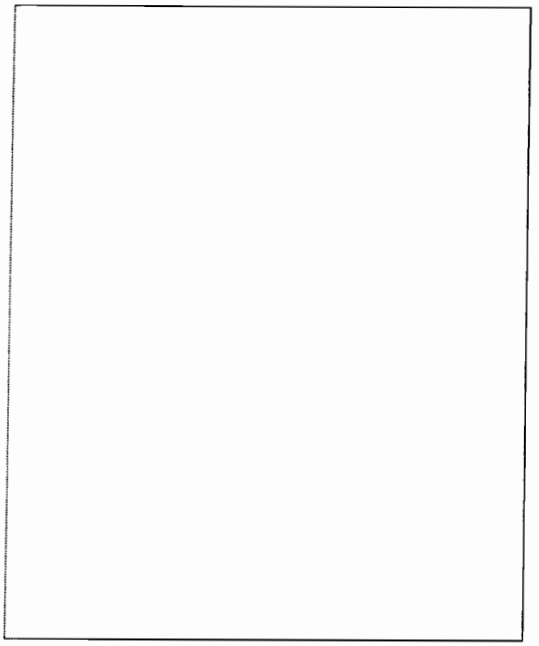

Site Map/plan (include north arrow):

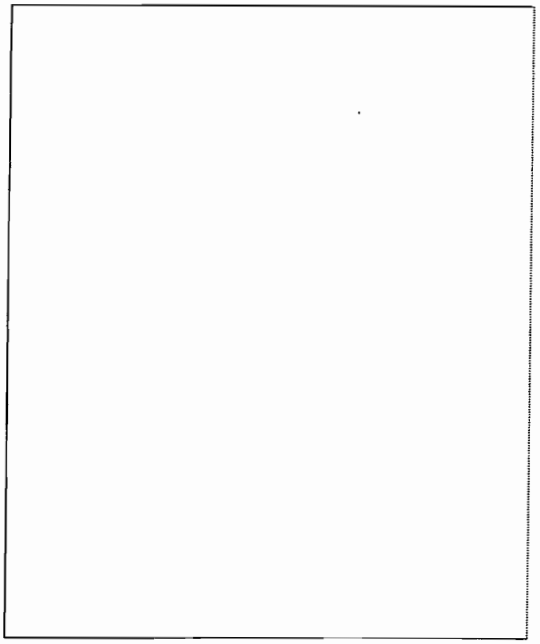

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The light brown brick façade of this two-family building is two bays and two stories. Left bay projects, three sided, with window openings on each face. Stone sills and flat lintels on openings (replacement windows). Sill course at first floor forms cap for knee wall on brick porch. Porch has brick piers that support balcony with metal rail. Wooden fascia and dentillated cornice under balcony. Stone steps. Double entrance at first floor (replacement doors); single entrance above with wooden door and transom. Dentillated metal cornice on shaped parapet.

38.(cont.) History::

1920 census: looks like McMahon, Alphonse and Minnie and daughter, renters in A, Mulatto, he's a postal clerk; and at 4220, Joseph and Anna Thomas, owners, black, he's a railway mail clerk.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	172	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4221 W COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Colonial Revival/Georgian	Load-bearing Brick	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
5	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	Full	■ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1900	Rankin (Ranken), J. C.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Wood, W. J.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Duckworth, Rev. E.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WOODS, VIRGLE			Lynn Josse, Michael Allen, CRO	1/15/2010
5945 N BRIDGE				43. Date of revisions:
ST LOUIS	MO	63120		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Wide five-bay front elevation, side gable. Full-width wooden porch sits on brick piers; paired columns support wooden shed roof with dentillated cornice and wooden fascia. One-over-one wooden windows in openings (one boarded on first floor). Entrance offset to left of small window opening; wooden surround and transom remain. Wooden dentillated cornice above second floor. Two asphalt shingle-clad dormers have gabled roofs, wooden pediments and dentillated cornices above their openings. Wooden one-over-one windows in dormer openings. Gable ends on side of house clad in slate; brick chimneys interrupt slate cladding.

38.(cont.) History::

1920 census: Gordon, William and Mary and two kids, owners (free), black, she's a nat. citizen from Canada, he's an undertaker who owns his business
1927 Red-Blue Book: Gordon Mary Mrs.
1930 census:
1943 Negro Directory: William Pollard, Sumner High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	173	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4222 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Open porch/balcony	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
c. 1911		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
ADAMS, FREDDIE M			Lynn Josse, Michael Allen, CRO	1/15/2010
11835 BRAMTON				43. Date of revisions:
FLORISSANT	MO	63033741		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The brick façade of this house is painted up to the bracketed metal cornice; the parapet wall is unpainted. Left bay projects with window openings on all three faces. Openings have stone sills and flat lintels. Replacement windows, except one wooden basement window. Stone steps at porch. Porch has bakery brick on inside face of knee walls that have stone caps. Piers rise through balcony with metal rails. Double entrance on first floor with replacement doors.

38.(cont.) History::

1920 census: Wilson, Fuzzell, Virginia, Juanita, and sister in law Ruth, black, own home, he's a postal clerk. Sister in law is 12. in other unit, black renter family of 6 (Whetom??), father is a postal clerk.
1927 Red-Blue Book: Wilson, Fuzzell (Virginia) and Robinson Jas (Arah)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4220

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	174	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4226 W COTE BRILLIANTE AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	stoop and hood	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman , J.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Dittmeier, Frank L.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WONSLEY, SANDRA D			Lynn Josse, Michael Allen, CRO	1/15/2010
5227 MINERVA AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The red brick façade is above a painted stone foundation with continuous soldier course above. At the right bay, the original front door is intact under a transom and a hipped hood. Window opening has stone sill and brick earmold; fixed pane window within. Above a frieze with consoles, the front roofline is clad in asphalt shingles which have fallen off the deteriorated left side.

38.(cont.) History::

1920 census: Bush, Zachary T, owner and Sarah; he's a postal clerk
1927 Red-Blue Book: Dreer HS (Mary)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	175	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4228 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, J.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Dittmeier, Frank. L.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CARTER, DERRICK	Jan Cameron	1/15/2010
3603 RIDGEDALE AV		43. Date of revisions:
ST LOUIS MO 63121		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Below the red brick façade, the painted stone foundation has a continuous soldier course above. At the right bay is a brick porch with piers supporting shallow hipped roof; wooden fascia. Window opening has stone sill and brick earmold; wooden one-over-one window inside. The basement window below is filled in with glass block. Entrance has wooden casement, door and transom. Cornice wrapped in metal. False front sloped roof above is clad in asphalt shingles.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	176	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4229 W COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, J.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Dittmeier, Frank L.	
0	Sawyer, Cornelius	37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WALKER, SHIRLEY	Lynn Josse, Michael Allen, CRO	1/15/2010
4229 W COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Concrete steps lead to a full-width porch with brick piers supporting low hipped roof. At the left bay is a wide window opening with stone sill. A wide 1/1 window is behind paired storm windows. At the right, the front door is a replacement. The front parapet wall of this red brick building has clay tile coping and is lower than the side parapet walls.

38.(cont.) History::

1920 census:Sawyer, Cornelius, Patsey and daughter, owners, black, he's a nat. citizen from Canada and a high school teacher.
1927 Red-Blue Book:Sawyer, Neal (Patsy)
1930 census:
1943 Negro Directory: Cornelius Sawyer, Vashon High School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	177	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4230 W COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1906		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JONES, JOHN W & ELIZABETH	Jan Cameron	
4230 W COTE BRILLIANTE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick façade is over a light brown brick base. Limestone courses above and below base. Segmental arch window opening (boarded) with stone sill to left of boarded entrance. Brick porch with concrete steps and gable roof; narrow wooden fascia and gable end. Wooden cornice deteriorated under asphalt shingle-clad sloped false front roof.

38.(cont.) History::

1920 census:Evans, William and Jennie and her mother, owners, black; he's a railroad porter and she's a factory seamstress; their boarder is a dept store stock clerk
1927 Red-Blue Book:Evans, Wm (Jennie); rear, vacant.
1930 census:
1943 Negro Directory: Nannie E. Jones and Ida Jones of Lincoln School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING
4230 W

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	178	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4231 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and asphalt	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	White, J. F.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
FRINCE, MARION A			Lynn Josse, Michael Allen, CRO	1/15/2010
8413 JANUARY AVE				43. Date of revisions:
ST LOUIS	MO	63134		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story frame gabled garage clad in weatherboard.

28. (cont.) Further description of important architectural features:

This brick first story of this house is painted. Front gambrel end clad in asphalt shingles with two window openings containing wooden one-over-one windows. A full-width wooden porch supports low hipped roof. Entrance has left sidelight and wooden door at right, both historic multilights under transoms. Window opening with stone sill contains a wood 13-over-one window.

38.(cont.) History::

no permit for this but it is same plan and facade as next 3. 1920 census: Gates, John and Gertrude and her mother and a niece; black, owners, he's a Pullman porter
1927 Red-Blue Book:Gates Gertrude Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NEW FRONTIER
MORTGAGE
314-898-2877

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:		
SLCAS036	179	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4234 W COTE BRILLIANTE AV		
E. City/State	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership	11. Historic Use (if known):		11. Present Use:	
Public	Domestic		Vacant/Not in Use	
	Sub-use: Single Dwelling		Sub-use:	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts		
(b) Single dw: shaped parapet 1-story	Load-bearing Brick	
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1910		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-bay single story brick house is painted. Concrete steps and stoop lead to boarded door under transom, right. Shaped parapet with terra cotta cornice. Window opening header partly collapsed; opening boarded. Segmental arched basement window opening, left, also boarded.

38.(cont.) History::

Not on 1909 Sanborn. 1920 census: Bush, Robt and Effie, their nephew and her mother. Owners, mortgage, black, he is in hauling on his own, nephew works for an express co.
1927 Red-Blue Book:Bush, Robt (Effie) coal
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

FXD

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	\80	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4235 W COTE BRILLIANTE AV

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and slate	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	White, J. F.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HAWKINS, WINSTON T SR	Lynn Josse, Michael Allen, CRO	1/15/2010
4235 W COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is one-story flat-roofed concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

Two-story, light brown brick, gambrel-front house w/hipped full-width porch; simple entablature on porch with glazed brick accents on brick piers; wood railings, lattice beneath; raised foundation; red brick on other elevations. Front door and sidelights under transoms, left; At the porch, the brick façade is painted white.

38.(cont.) History::

1920 census:Wilholt, Roy and Estella and daughter and brother (Mulatto) and boarder (black); renters, Roy is a Clerk at Mail Railway, as is their boarder,this brother is a porter at a drug store.
1927 Red-Blue Book: Wilholt Roy O (Stella)
1930 census:
1943 Negro Directory: Sara Todd of Carr School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4235

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	\81	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4236 W COTE BRILLIANTE AV
E. City/State:	Vicinity.	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1907		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PERCY, WILLIE	Lynn Josse, Michael Allen, CRO	1/15/2010
4236 W COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Pent roof at top of façade with deep overhang; eaves and cornice clad in metal. Window openings have stone sills. Double entrance has original wooden casement. Wooden porch forms balcony at second floor. Door opening to balcony has wooden casement and door.

38.(cont.) History::

1920 census: Kelly, John and Emma and two daughters, black, renters, he's a postal clerk; 4236a) Davis JohnB and Minnie, and daughter Porter Ethel and Henry. Renters, black. John is a general laborer and Henry is a wholesale delivery clerk.
1927 Red-Blue Book:Jarrett Othelda; 4236 a) Porter, Gus (Gertrude)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

423

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	182	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4238-40 W COTE BRILLIANTE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1906	Sheehan, Walter F.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Welge, Theodore Jr.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Sheehan, Walter F.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PERCY, WILLIE			Lynn Josse, Michael Allen, CRO	1/15/2010
2627 NATURAL BRIDGE				43. Date of revisions:
ST LOUIS	MO	63107		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick façade with brown brick base. Limestone course above base forms sills of first story windows. steps lead to Roman arches in which double V-plan entrances are recessed. Second-floor windows have stone sills. Cornice missing, replaced by red parging. Parapet shaped with end blocks, wide center step, and metal coping.

38.(cont.) History::

1920 census: Tanzy, William and Amanda, black renters, he's a packing house butcher, she's a dept. store maid. 4238a: Williams, Walter and Mary, he's a porter at chemical works and she's a laundress for private family.
1927 Red-Blue Book:Morrow Timothy (D) and 4238a) Williams Walter (Estelle)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	182	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4239 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and slate	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Gambrel	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	White, J. F.	36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address			41. Form prepared by (name and organization):	42. Survey date:
WILLIS, HILLIOUS & LOUVENIA			Lynn Josse, Michael Allen, CRO	1/15/2010
4712 ELLISON AV				43. Date of revisions:
OMAHA	NE	68104		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Gambrel end clad in painted slate tiles with two window openings containing wooden one-over-one windows. Brick piers support wooden porch and low hipped roof. Wooden steps to porch and bar-style porch skirt. Entrance in left bay is configured with left side light (now glass block) and doorway with replacement door. Stone-silled window opening contains wooden 13-over-one window.

38.(cont.) History::

1920 census:(then 4237) Sims, ?, renter, a post office clerk, his granddaughter, and boarder Leona Penn(?), a dressmaker in a factory; all black.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	184	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4241 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Dutch Colonial	Load-bearing Brick	
(b) Front Gambrel Colonial Revival		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick, vinyl and asphalt	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Gambrel	Full	■ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1912		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	White, J. F.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Pitman, C. A.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PHILLIPS, PETER JR			Lynn Josse, Michael Allen, CRO	1/15/2010
1710 GRAPE				43. Date of revisions:
ST LOUIS	MO	63147		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick front elevation, red brick sides. Gambrel end soffit partly wrapped in metal, partly wood. End is clad in vinyl siding partly removed to expose asphalt roll siding. Two window openings containing wooden one-over-one windows. Red brick porch rises to support low hipped roof. First floor entrance in left bay is configured with left sidelight. Window opening has stone sash. Both entrance and window opening covered by wrought iron grills. Wooden sidelight and door remain.

38.(cont.) History::

1920 census:Joseph and Hilda Evans and daughter, Mulatto, owners, she is a naturalized Candian, he's from DC, and a public school teacher.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	\ 85	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4242 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Miller, Elizabeth A. (orig. own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CLARKE, THOMASINA & MARY V JT	Lynn Josse, Michael Allen, CRO	1/15/2010
4242 W COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. High false pyramidal roof clad in asphalt shingles returns to parapet walls on each side elevation. Brown brick water table with stone course above that forms sill of first floor window opening. Wooden porch with fluted Doric columns supporting metal-railed balcony. Porch has dentillated cornice and wooden soffits, eaves, fascia and ceiling. Double entrance with wooden surrounds, doors and transom windows. Trapezoidal bay above entrance has one-over-one windows in openings. Window openings in left bay have stone sills, full brick surrounds and one-over-one wooden windows. Cornice composed of wooden fascia under dentils with projecting bow above. False pyramidal roof rises above between parapet ends.

38.(cont.) History::

1920 census: Mosley Wm, Martha, son, renters, black, he is a public school teacher; 4242a) Cobinton(?) Edw and Emmie(?) (owners) and boarder, all 3 mulatto, Edw is a railroad chef and boarder Veruba(??) Brown is a public school teacher.
1927 Red-Blue Book:Buster Harry C (phys); 4242a) Wilson Framk B (Hazel)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4242

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	186	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4243 W COTE BRILLIANTE AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
James J. Bush House		
10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Foursquare		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2½	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Hip	Full	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Other	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1905	Lucas Realty & Investment Company	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
1913-1946		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
Social History	James J. Bush (sig. person)	
Black		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JONES, JULIUS T	Lynn Josse, Michael Allen, CRO	1/15/2010
4243 W COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick front elevation, red brick sides. Entrance at left bay. Full brick porch with knee walls and piers rising to support low hipped roof over entrance. Entrance has sidelight above wooden panel to left of replacement door. Two window openings above (replacement windows) share a stone sill. Right bay has Roman arch window opening with stone sill at first floor, slightly projecting trapezoidal bay in opening above. Replacement windows.

38.(cont.) History::

1920 census:looks more like 4245? Owned by BUSH, James T. - very important! Wife Margaret and children james and MARGARET. At this time James T. is a Railway Mail Clerk. They have 2 boarders: Katherine Hurley, public school teacher, and Helen (?) Adams, a secretary.
1927 Red-Blue Book: Bush
1930 census:
One of several lots conveyed 11/1/1881 from Lucinda (or Lucina) Elleard; purchased by Lucas Realty & Investment Co.

38. (cont.) Significance

James J. Bush was head of the Postal Workers Union, later a real estate broker who was active in civil rights legislation, and empowering African-Americans homeownership.

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4243

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	187	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4247 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Bungalow/Bungaloid		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and asphalt	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Low Gable	Full	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1924		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	James, G.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Kent, R.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ROSS, ALZANE	Lynn Josse, Michael Allen, CRO	1/15/2010
4247 W COTE BRILLIANTE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

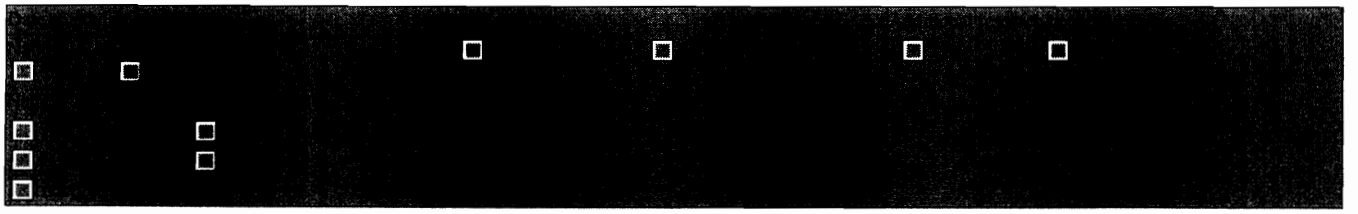

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick with bakery brick quoining and headers around openings, bakery brick in porch columns and five courses of bakery brick at top of walls on front and side elevations. White glazed terra cotta pieces at wall base corners. Porch has metal railings, low gabled roof with overhand supported by wooden brackets. Projecting main roof overhang also supported by brackets. Window opening with wooden surround in gable end contains paired wooden single-pane windows. Gable ends clad in asphalt shingles. First floor entrance in left bay and window opening in right bay boarded.

38.(cont.) History::

1927 Red-Blue Book:Kent Jas (Rose)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4287
NO TRESPASSING
NO LOITERING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	188	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4248 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1903		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Mount Auburn Constr. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Doyle, F. C.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SIMMONS, ALVIN & MATTIE B SIMMON	Lynn Josse, Michael Allen, CRO	1/15/2010
4248 W COTE BRILLIANTE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a red brick building with entrance bay at right. The parapet has a corbelled cornice and end blocks. Window openings have stone sills. The first floor opening in left bay has metal replacement window and the second floor windows in both bays have vinyl one-over-one windows. Entrance configured with door and sidelight; historic surround in place around replacement door and sidelight infill. Brick porch piers support gabled roof; shingles clad gable end.

38.(cont.) History::

1920 census:Johnson, Thomas and Gussie, owners, black, he is a decoratorwith own business
1927 Red-Blue Book:Johnson TE (Gussie)
1930 census:
1943 Negro Directory: Louise McNail of Lincoln School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	189	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4249 W COTE BRILLIANTE AV		
E. City/State	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☒	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Public	Domestic		Vacant/Not in Use	
	Sub-use: Single Dwelling		Sub-use:	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1896		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Lee, Robt. E.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Lee, Robt. E.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story flat-roofed masonry garage clad in stucco.

28. (cont.) Further description of important architectural features:

Painted front elevation, red brick sides. Rusticated stone foundation with smooth bandcourse atop. Concrete steps to recessed entrance at left via Roman arch with brick hoodmold. Wooden entrance divider separates center doorway from sidelights; doorway boarded. Two window openings to right of entrance share stone sill supported by wide corbelled courses. Openings contain wooden one-over-one windows and have brick surrounds. Two brick courses project above first floor. Shaped parapet above.

38.(cont.) History::

1920 census:Nettie Galloway and boarder Edward hill; owner; he is a janitor.
1927 Red-Blue Book: Hill Edw (Nettie) - she married her boarder?
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	190	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4250-2 W COTE BRILLIANTE AV

5. City/State	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	■	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 4-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	Open Porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1906	McMahon, Wm. P.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	McDonald, E.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST 12TH FL		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

□ □ □ □ □ □

□ □

□ □

□

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick with shaped parapet. Brick quoining at front corners. Brown brick water table with stone course above. Wooden porches with heavy columns and entablatures under shed roofs. Entrances at each end and round-arch first floor window openings in between boarded. Second floor openings have wide stone sills and contain one-over-one wooden windows. Parapet is shaped with center and end steps with white terra cotta coping.

38.(cont.) History::

1920 census:Straham(?) E., wf Willie, daughter, renters, black; he is a chauffeur for a private family; at 4250a,black renters Roberts James and Carrie, he is a railroad porter
1927 Red-Blue Book:vCrump Wm (Edna); 4250a) Roberts Jas (Carrie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	191	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4253 W COTE BRILLIANTE AV
5. City/State:	Vicinity: ☒	6. UTM: / | 7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1911		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, John	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Dittmeier, Frank L.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PAYNE, JOHN	Lynn Josse, Michael Allen, CRO	1/15/2010
4253 COTE BRILLIANTE AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Brick porch with gabled roof; gable end clad in vinyl siding. Entrance door replaced at left bay. Window opening has stone sill and brick earmold; contains double window. Brick soldier course above. Shaped parapet with white terra cotta coping.

38.(cont.) History::

1920 census:Gordon, William and Victoria, three sons; own; he is a post office clerk, all black
1927 Red-Blue Book: Jordan Wm (Victoria)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	192	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4255 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick and Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Flat	Open Porch	■ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ■
1911		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hartman, John	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Dittmeier, Frank L.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GARRETT, EUGENE & ERNESTINE	Lynn Josse, Michael Allen, CRO	1/15/2010
7700 W RANKEN		43. Date of revisions:
ST LOUIS MO 63117		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Ashlar bond stone foundation. Soldier course runs above foundation. Window opening has stone sill and brick earmold. Entrance in left bay has wooden casement and transom window. Wooden deck porch supports low hipped roof over entrance. False mansard between parapet ends clad in vinyl siding.

38.(cont.) History::

1920 census: Woodson, Arthur and Frankie, own, black, janitor; 3 daughters and a son
1927 Red-Blue Book: Woodson Arth (Frankie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4255

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	193	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4256 W COTE BRILLIANTE AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1905	Brown, Casper B.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Brown, Casper B.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marks, David A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GAUDA, ROBIN J	Lynn Josse, Michael Allen, CRO	1/15/2010
4256 W COTE BRILLIANTE AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Corbelling at parapet with stepped end blocks and step between two blocks at center. Concrete stoop with metal columns supports balcony with metal rail. Double entrance at first floor in right bay with wooden casement, single entrance above. Window openings have stone sills and segmental arches. Replacement vinyl one-over-one window in left bay on first floor; no window in opening above and no door in entrance to balcony.

38.(cont.) History::

1905 permit is for four in a row (2 extant). 1920 census:Acklin Charles and Minnie and boarder Albert Champlin; he's a welder in steel foundry, boarder is porter railroad; 4256a) Carmichael John and Ruth, black renters, he is a railway mail clerk
1927 Red-Blue Book: Love Robt E (Millie); 45256a vacant
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	194	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4257 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) 1 1/2 story front gable Victorian		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
High Gable	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1904	Sachs, F. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sachs, F. & Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Merkler, Geo.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GASSOWAY, HARRY	Lynn Josse, Michael Allen, CRO	1/15/2010
5223 WELLS AVENUE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Brick-clad steps to brick porch whose piers support a low hipped roof. Entrance at right bay with replacement door under transom. Stone foundation. Stone sills at first floor and second floor window openings. Two protruding courses of brick follow dimension of stone sill to each side. Decorative lozenge-pattern brick run to each side of both first and second floor window openings near top. Openings contain wooden one-over-one windows and are obscured by fiberglass awnings. High front gable traced by projecting wooden soffit that returns at base of second floor.

38.(cont.) History::

1920 census: Smith, David and Minnie (?), own, mortgage, black, he's a porter in a public building
1927 Red-Blue Book:Smith David R (Minnie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	195	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4259 W COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1904	Sachs, F. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sachs, F. & Co.	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Merkler, Geo.	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PHILLIPS, WILLIE T			Lynn Josse, Michael Allen, CRO	1/15/2010
4259 COTE BRILLIANTE AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick front elevation with bullnosed corners. Ornate corbelling at parapet with end blocks rising at each end. Openings at first and second floors have tall segmental arch headers united by continuous tracing courses of pyramidal pressed brick. Window openings have stone sills. Window openings in left bays filled with replacement windows and entrance in right bay has replacement door. Second floor balcony opening has wooden casement and door. Concrete block porch with wooden columns supports balcony. Metal columns supports metal canopy over rest of porch, which has concrete block piers and red brick openwork between.

38.(cont.) History::

1920 census:Logan, Alese(?) renter and her boarder Georgia Williams; Logan is public school teacher and Williams a stock clerk in wholesale co. 4259A: McKinnis(?) Samuel and Ester, black, rent; he is a locker supt. In private club.
1927 Red-Blue Book: Brown Chas (Cath) and Anderson John (Blanche)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	196	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4260 W COTE BRILLIANTE AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1905	Brown, Casper B.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Brown, Casper B.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marks, David A.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	1/15/2010
1015 LOCUST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Window openings (boarded on first floor, open with surround intact above) with stone sills and segmental arches. Concrete steps to brick porch with knee wall and piers supporting metal-railed balcony. Parts of wooden fascia missing. First floor entrance in right bay boarded; second floor balcony door opening has wooden surround and door but missing its masonry header.

38.(cont.) History::

1920 census:4260A cunningham Clarence and Martha and daughter Mercedess, black renters, he is a moulder in a brass foundry, and boarder Maya, Milton, a brickyard laborer; and 4260) Jordan, James and Eliz. & 2 daughters, he is a post office janitor and older daughter is a dept store maid.
1927 Red-Blue Book: Burrell Wilbert (B), Bray Jas A (Jennie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4260

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	197	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4263 W COTE BRILLIANTE AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Egan, John	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Carroll, Ellen	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BAILEY, PAMELA R	Lynn Josse, Michael Allen, CRO	1/15/2010
9230 ASTORIA DR		43. Date of revisions:
ST LOUIS MO 63137		

FOR SHPO USE:

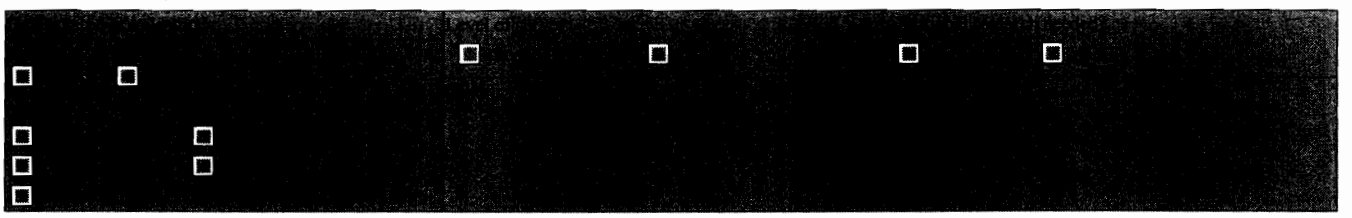

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick, but painted red to level of first floor window opening sill. False mansard clad in asphalt shingles; bracketed wooden cornice underneath. Wooden porch with shed roof. Two entrances in left bay boarded. Above entrances, paired window openings with flat wooden surround. Window openings in right bay with stone sills; segmental arch header on first floor and jack-arch at second floor. Replacement vinyl one-over-one windows.

38.(cont.) History::

1920 census: Jones, Bertha, 2 children, boarder, all black, rent.; 4263a: Windful, Martin and Emilie and 2 kids, black, renters, he's a raliroad waiter.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.	2. Survey Name:
SLCAS036 198	Architectural Survey of The Ville
3. County:	4. Address:
St. Louis [Independent City]	**4122 DR MARTIN LUTHER KING**
E. City/State: Vicinity: ☐	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	
8. Historic Name (if known):	9. Present Name (if known):
10. Ownership:	11 Historic Use (if known):	11. Present Use:
Private		Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Load-bearing Brick	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular (Long Str. Fac.)	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
7	None	☐ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☐ Altered Date(s):
Flat		☐ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☐	☐ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☐
2009		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WALKER, MARK & LAVERNE	Lynn Josse	3/15/2010
11550 PLACER AVE		43. Date of revisions:
ST LOUIS MO 63138		

FOR SHPO USE:

Date entered in inventory:	Level of survey: ☐ reconnaissance ☐ intensive	Additional research needed? ☐ yes ☐ no
National Register Status: ☐ listed ☐ in listed district ☐ eligible (individually) Name: ☐ pending listing ☐ not eligible ☐ eligible(district) ☐ not determined	Other:	

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Contemporary commercial retail strip with brown brick cladding, piers and shaped parapet. Parking lot in front and on western side of building.

38.(cont.) History:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, plat maps, and building permits.

ALPHA ONE GREEK

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	199	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4131-5 DR MARTIN LUTHER KING DR		
5. City/State:	Vicinity: ☒	6. UTM:	/	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO				

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Painted Stone	
15. Number of Stories	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6		☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s): 1926
Flat		☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Other		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LIBERMAN, MINNETTE	Lynn Josse, Michael Allen, CRO	3/12/2010
308 MORRISTOWN CT		43. Date of revisions:
CHESTERFIELD MO 63017		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted foundation, brick side wall and stone front (at the second story). First floor divided into storefronts with entrance to second floor at left. Storefronts wrap corner. Metal cornice above storefronts. Second floor clad in stone with six boarded window openings having flat arches and stone sills. Carved earmolds on each opening. Wooden cornice that has paired brackets, decorated fascia and crown molding wraps the corner.

38.(cont.) History::

Permit#D3697 issued 2-3-1926 to alter brick store, $150. Owner: Mullins & Waltery
Permit#D3914 issued 2-17-1926 to alter brick store, $250. Owner: Mullins-Waltars
CONT_HISTORY
Permit#J1929 issued 5-10-1939 to alter store, $2,500. Owner: J. Ptoch A
Permit#J434 issued 11-7-1938 erect brick store, $3,000. Owner: J. Ptech

38. (cont.) Significance

Previous home of the Harlem Taproom

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

LOANS
Easton Loan Co. 4135
EASTON LOAN
WATCHES
DIAMONDS
EARRINGS
GOLD CHAINS
JEWELRY REPAIR
EASTON LOAN
FINE DESIGNS
Hair
BARBER SHOP
FASHIONS
FINE
BARBER SHOP
NAILS

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	200	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4137-45 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) One-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Shingle, Decorative	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s): 1914
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1870		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BEAVEN, GERRALD ANTHONY	Lynn Josse, Michael Allen, CRO	3/12/2010
7442 HAPIN DR		43. Date of revisions:
ST LOUIS MO 63135		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This is a pre-1875 residential building with a two-story brown brick storefront addition and matching one-story wings. The first story level has consistent articulation with paneled bulkheads, relatively narrow storefront windows and recessed doors topped by ribbon of transom windows (partially covered at right section). Central section has jack-arch opening on forst floor with continuous storefront ribbon and center entrance to second floor. At the outer bays a bracketed fascia is under a sloped front roof with center cross gable. The second floor has two triple windows in openings with rowlock sills and a connecting soldier course header with coloered accents. There is basket-weave patternwork under each opening. Wooden brackets support a false side-gabled roof with central intersecting gable; polychromatic clay tile clads the roof.

38.(cont.) History::

Permit # issued 6-1-1914 to alter brick stores, $800. Owner: Ells Balson
Permit#B6829 issued 6-12-1923 to alter brick shop, $130. Owner: E.S. Balson
Permit#G issued 5-21-1924 to build 2 1-story frame sheds, $300. Owner: B. Suchert; Architect: R.R. Reilly

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

DOLLY'S BEAU
SUPPLY STORE
4137 M.L. KING DR.
314-371-1415
BABACAR
AFRICAN
HAIR
BRAIDING
531-2361
SALE
OBAMA
4141
4139
4137
135

BABACAR
AFRICAN
HAIR
BRAIDING
531-2361
OBAMA

STORYS
FOTO STAMP CO.
ONE MINUTE FOTOS
Old Pictures Copied and Enlarged
Identification
Foto Stamps

URY'S
TAMP CO.
UTE FOTOS
and Enlarged
Photo Stamps
EASTON
LOAN
PAWN SHOP
4135

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	201	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4157 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1937		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III	Lynn Josse, Michael Allen, CRO	3/12/2010
10700 LANDSEER DR		43. Date of revisions:
ST LOUIS MO 63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick facade. Shaped parapet has buff terra cotta coping and center step. Three polychromatic terra cotta rosettes are on the upper facade. Triple window in second floor opening with rowlock sill in enameled white brick and terra cotta lozenges at ends and center of jack arch. First floor has storefront transom level clad in plywood over recessed shop entrance with covered storefront to either side. Because the present appearance dates from 1937, this is used as the date of construction. It appears that an earlier building (date unknown) is incorporated into the present building.

38.(cont.) History::

Permit #H8022 11-1-1937 Alter brick store. Owner: E. Cabibo. 1909 Sanborn shows 2-story brick dwelling set back from street.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

OPEN

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	202	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4159 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) One-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	none visible	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1900		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III			Lynn Josse, Michael Allen, CRO	3/1/2010
10700 LANDSEER				43. Date of revisions:
ST LOUIS	MO	63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Black glazed brick surrounds the center storefront opening, including vertical header over jack arch. Storefront has recessed entrance and partly infilled windows. Projecting metal cornice above has wide end brackets. Parapet rises to center step and has buff terra cotta coping. Façade is red brick above the black brick.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

TAP ROOM
4161
RAW BLEND
CLOTHING• SHOES• CUSTOM TEES• GARMENT & CELL PHONE ACCESSORIES
(314) 398-1585
LET US PROMOTE YOU!
314.531.3382
OPEN
SALE

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	203	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4161 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township/Range/Section: Not Applicable
T: R: S.

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
3	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1880		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III & GLORIA GREEN	Lynn Josse, Michael Allen, CRO	3/12/2010
10700 LANDSEER DR		43. Date of revisions:
ST LOUIS MO 63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Side wall shows evident reconstruction of front bay in brown brick; rest of building red brick with corbelling at top of western elevation. Front elevation has storefront rubbon with corner entrance. Upper floors divided into three bays of window openings with jack arches and stone sills. Second floor openings have contrasting headers and third floor openings have contrasting label courses. Replacement wooden three-over-one (applied muntins) windows are in the openings. Shaped parapet above has white terra cotta coping and three rectangles formed by raised rowlock border courses.

38.(cont.) History::

12/30/1880-M(?) Branham & wf, William Garrison & wf to Thos Cochran & Wm Barbous for $2000; immediately transferred to Margaret Barbous. in 1889 her heirs sold to Marie Fischer (wf of Herman). In 1919 Marie sold to Clyde & Gertrude Pumphrey. (used for Pumphrey Drug Co). 1931 sold to Theresa Stuever, single. 1932 sold to Annie Coghill of St. Louis County and in 1935 to Frank & Jessie Glaser. In 1945, Albert Dickran & wf Zay purchased. He died 1959; Zay remarried (Darner) & held until 8/6/1965 then sold to C. Gordon (single) who transferred it ten days later to Ezell Jr. and Lola Mae Nance. After Ezell's death, transferred by Lola in 1993 to their children.

38. (cont.) Significance

It appears likely that the pre-1883 façade was reconstructed after the 1927 tornado.

39. Sources of information:

Sanborn maps, plat maps, deeds and building permits.

HARLEM TAP ROOM
HARLEM TAP ROOM
4161
Budweiser
TAP
ROOM
WARNING
RAW BLEND

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	204	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4200 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
		Frank's Cocktail Lounge

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1886		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WESLEY, ESSIE D			Lynn Josse, Michael Allen, CRO	3/15/2010
1431 N WHITTIER				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Originally two attached buildings, this address is now a single parcel and functionally a single building. Eastern section has storefront that wraps corner with corner entrance. Cast iron columns. Irregular fenestration on eastern elevation with Roman arches and tracing courses over first floor openings and segmental soldier-course arches on second floor. Front elevation has two windows with Roman arches (soldier headers and tracing courses) and stone sills; wooden arch-top windows. Brick corbelling under metal cornice on each elevation. Western section has side-entrance storefront with cast iron columns under three segmental arch window openings with stone sills; wooden one-over-one windows remain. Wooden cornice with brackets, ornamental fascia and projecting crown above. Both storefronts largely filled in and painted.

38.(cont.) History::

Two adjacent buildings of similar age, present on 1909 map but not 1883. 1920 census:
1927 Red-Blue Book:
1930 census: 1934 Negro Directory - Dr. Wm. E. Allen, 4202a Easton, and Dentist A. M. Brooks, 4202a Easton

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Frank's

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	205	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4208 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use: Warehouse

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
3	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GRAY ENTERPRISES INC	Lynn Josse, Michael Allen, CRO	3/15/2010
4214 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Three story red brick facade has corbelling under parged area where cornice was removed. Storefront openings between rusticated piers on first floor have decorated steel beams enclosed in boxes over each pier. Some openings contain storefronts and others have been reconfigured as garage openings. Window openings at second and third stories have stone sills and jack arches; four bays are covered by vinyl shutters while all others contain one-over-one vinyl replacement windows.

38.(cont.) History::

Frank Miller, Plaster & Lather, resided in Apt. A, per 1943 directory.

38. (cont.) Significance

39. Sources of information:

Negro Directory, 1943; Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

LOCAL & LONG
DISTANCE
533-3906

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:	
2060			
3. County:		4. Address: 4223-29	
St. Louis [Independent City]		~~4220-31~~ DR MARTIN LUTHER KING DR	
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO		/	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):	
10. Ownership:	1. Historic Use (if known):		11. Present Use:
	Commerce/Trade		Commerce/Trade
	Sub-use:		Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Art Deco	Load-bearing Brick	
(b) One-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Concrete/stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☐ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☐ Altered Date(s):
Flat	none	☐ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☐ Other Date(s):
	Visible from public road?	Endangered by:
28. Further description of building features and associated resources on continuation page.		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed?
c. 1930		Survey Name:
30. Significant date period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: district
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page.		
39. Sources of information on continuation page.		

OTHER

40. Current Owner address:	41. Form prepared by (name and organization):	42. Survey date:
WRIGHT, JAMES & CASSIE	Lynn Josse, Michael Allen, CRO	3/15/2010
5635 LINDELL BLVD		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☐ listed ☐ in listed district	☐ reconnaissance ☐ intensive	☐ yes ☐ no
Name: ☐ pending listing ☐ eligible (individually) ☐ eligible(district) ☐ not eligible ☐ not determined	Other:	

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Glazed buff tapestry brick with pale green accent work on piers and above storefront openings. Peach glazed terra cotta cartouches centered over openings, floral blocks set in piers and floral patterns on shaped parapet. Storefront openings have metal storefront system and yellow brick knee walls. Farther back on the lot, the center part of the building, visible from the side, is a former 2-story residential buidling (pre-1909) with its top lopped off.

38.(cont.) History::

Vanity Box Beautorium, a beauty shop, per 1943 Negro Directory and 1934 Negro Business Directory. Rear concrete block addition, 1968, to James Wright (who is still the owner as of 2010)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ADVANTAGE MUFFLER
WEST END AUTO SUPPLY
Jim Wright & Sons Inc.
AUTO SALES & LIMOUSINE SERV.
314-652-2141
Jim Wright & Sons Inc.
AUTO SALES LIMOUSINE SERV.

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.	2. Survey Name:
207	Architectural Survey of the Ville
3. County:	4. Address:
St. Louis [Independent City]	4234 DR MARTIN LUTHER KING DR
5. City/State: St. Louis, MO	Vicinity: ☒
6. UTM:	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
		Domestic
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by: neglect

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1889		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Groskrentz, John	
		37. National Register eligible?
		Not Evaluated — Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Jan Cameron	3/15/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Storefront and second floor entrance have cast iron columns and projecting, bracketed metal cornice. Openings mostly boarded. Second floor has three window openings with stone sills and consoles, segmental arches with keystones and end blocks in soldier courses and deteriorated wooden one-over-one windows. Wooden cornice above has ornamental fascia, brackets and projecting crown.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

COMET
4234

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	208	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4236 DR MARTIN LUTHER KING DR
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Commerce/Trade	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1889		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
LRA			Lynn Josse, Michael Allen, CRO	3/15/2010
				43. Date of revisions:
ST LOUIS	MO	6310		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Cast-iron storefront system runs continuous on first floor and includes columns, dentillated cornice and foliated end pieces. Transoms exposed, but openings are otherwise boarded. Second floor openings have segmental soldier-course arches and stone sills with consoles; windows and casements missing. A white glazed terra cotta cornice runs continously above and wraps the sides; thre brick courses step up to the cornice. The parapet has the same terra cotta as coping and has a center step and end blocks.

38.(cont.) History::

No permit for 4236. 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

COMET
4234

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	Z09	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4239 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1922		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Williams, J. E.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Armstrong, W. W.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III & KAREN NANCE	Lynn Josse, Michael Allen, CRO	3/15/2010
10700 LANDSEER		43. Date of revisions:
ST LOUIS MO 63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Brown brick. Shaped parapet with white terra cotta coping and corbelling. Three window openings on second floor with rowlock sills, jack arches and one-over-one windows. First floor has two outer jack-arch door openings around center jack-arch garage opening containing metal roll-up door.

38.(cont.) History::

1920 census: feed store in prev. bldg.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Bill's
Auto Repair
Towing
533-2329
U-HAUL
RENTALS
NO
LOITERING
OPEN
CLOSED
4239
4239
4239

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	210	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4242 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐		
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Concrete Block	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
c. 1930		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
		Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
YARBER, CHARLIE & ETAL	Lynn Josse, Michael Allen, CRO	3/15/2010
4242 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick front elevation. First floor has continuous soldier course header over center window (covered in metal bars) and side door openings (with security doors). Second floor has four window openings with rowlock sills and continuous soldier course header. Center openings have one-over-one windows and outer openings have glass block infill.

38.(cont.) History::

1909 Sanborn shows house. 1951 Sanborn map indicates "cinder block" construction.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

RESERVED
PARKING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	211	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4243-5 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NANCE, EZELL III			Lynn Josse, Michael Allen, CRO	3/15/2010
10700 LANDSEER DR				43. Date of revisions:
ST LOUIS	MO	63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. First floor has brick outer piers, cast iron columns, a center entrance and a projecting metal cornice with end caps. Second floor has four window openings (stone sills) joined by a tracing course around the vertical headers on the Roman arches. All openings save one are boarded. An ornate metal cornice is below the center step in the parapet.

38.(cont.) History::

1920 census: Kohl, Henry, anna, daughter, white renters, he's a stove plate molder, and her sister is a shirt factory worker.
4243 1/2: Kadoys(?), Anna and son, both Prussian (she's alien, he's nat), he's a newspaper courier,
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

TIRES
4243
WHITES artistic
BARBER
SHOP
NO LOITERING
NO DRINKING
F-150

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	212	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4246 DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1941		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
JOHNSON, LATODD			Lynn Josse, Michael Allen, CRO	3/15/2010
5001 ST CLAIR				43. Date of revisions:
FAIRVIEW	IL	62208		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick with some patternwork across parapet, which has clay tile coping. Three boarded jack-arch window openings on second floor have stone sills. Buff brick soldier course across header of storefront and first floor entrance. Buff brick rowlock course runs below in knee wall. Storefront covered in plywood. Entrance at left has wooden replacement door and transom window. The foundation at the façade is concrete, but farther back the foundaiton is rubblestone, idicating an earlier portion fo the building (date unknown).

38.(cont.) History::

1909 Sanborn shows house. Permit issued 8/23/1941 to Roy Steinmetz for store and warehouse ($9,000; Sam Wolff & Co. builder). Permit issued 2/27/1947 to Dr. A.M. Brooks for one-story brick addition, $5,000; Elvin Matthews, builder (this may be wrong). 1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4246

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	213	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4249-51 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Brick	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s): 1959
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Claus, Friedericke wf of Chas. (orig own)	
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HAYDEN, LEROY & MARY	Lynn Josse, Michael Allen, CRO	3/15/2010
2544 PONTCHARTRAIN DR		43. Date of revisions:
FLORISSANT MO 63033		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Cast iron columns remain in altered storefront ribbon. Upper facade largely reconstructed in red tapestry brick, side wall and storefronts are painted. Window openings are small; on the side elevation the second story windows are shor t1/1s that appear to be in partially bricked-in larger openings. Shaped parapet.

38.(cont.) History::

Major repair permit 5/11/1959 (probably a repair from February tornado damage) $2500 to owner Lea Dubinsky. 1920 census:Shields, Walther/Walker B, his mother, bro-in-law(?) and niece; he's an elec. Worker, bro in law is a Genl Merch salsesman. 4251a is Thos. And Anna Shea, white renters; he is saloon keeper (downstairs perhaps?)
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

JADEN'S
JaDen's Diner
JaDen's Diner

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	214	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4324 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		
7. Township/Range/Section: Not Applicable	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
3	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
1	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MARTIN, ROOSEVELT	Lynn Josse, Michael Allen, CRO	3/15/2010
4324 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

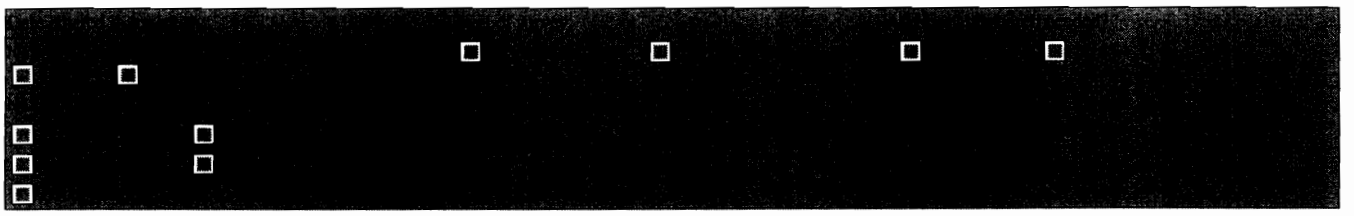

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Cast iron columns remain on storefront, which is mostly infilled with brick. Entrance to building is now at east side. Red brick above storefront with painted sides. Sandstone course under window openings on second floor, which have stone sills and consoles and soldier course segmental arches with tracing courses. One is boarded and others have replacement windows. Third floor mansard roof, now clad in asphalt shingles, greatly altered to accommodate recessed single-pane windows. This building could be contributing depending on date of alterations

38.(cont.) History::

1920 census:
1927 Red-Blue Book: vacant; 4324a Jaeger Casper (Ella)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

MARTIN'S MARKET
534-9119
Martin's Market
WINNERS PLAY HERE!
4324
79¢
24oz Can
4pk 16oz Cans
$2.79
MEAT ORDERS
$19.95
$199.95
PICNIC SPECIAL
BEEF CHUCK ROAST & ARM ROAST
$5.99
10 LB BOX
GIBLETS
PORK CHOPS
T-BONE STEAKS
STOP

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	215	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4332 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Load-bearing Brick	
(b) unassigned due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	None	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1986		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
PEARSON, JAMES			Lynn Josse, Michael Allen, CRO	3/15/2010
4338 NATURAL BRIDGE				43. Date of revisions:
ST LOUIS	MO	63115		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:
Red tapestry brick walls. Three narrow window openings (boarded) at left, with entrance (steel door) at right. Concrete masonry units form top of wall.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:
Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

10 LB
BOX
RIBLETS
$5.99
PORK
CHOPS
1.89LB
T-BONE
STEAKS
&
PORTERHOUSE
STEAKS
6.99LB
STOP

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036 216		Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		**4344 DR MARTIN LUTHER KING DR**
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Other	Concrete Block	
(b) unidentified due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Other	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor):	23. Basement type:	27. Changes:
3	None	Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	Altered Date(s):
Flat		Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road?	Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page.		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed?
2006		Survey Name:
30. Significant date period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: district
		37. National Register eligible?
		Less than 50 Years
38. History and significance on continuation page.		
39. Sources of information on continuation page.		

OTHER

40: Current Owner address:	41. Form prepared by (name and organization):	42. Survey date:
SAAB AUTO SALES & LEASING INC	Lynn Josse, Michael Allen, CRO	3/15/2010
647 W US 54 P O BOX 1736		43. Date of revisions:
CAMDENTON MO 65020		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☒ listed ☐ in listed district	☒ reconnaissance ☐ intensive	☒ yes ☐ no
Name:	Other:	
☐ pending listing ☐ eligible (individually)		
☐ eligible (district) ☐ not eligible		
☐ not determined		

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Concrete block store building with shaped parapet. Center entrance and storefront ribbon.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

FAMILY DOLLAR
$5 Toys, Gifts & More

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	217	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4361 DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	

7. Township Range Section: Not Applicable
T: R: S

8. Historic Name (if known):

9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property: Building

13. Architectural style/vernacular type (a)/(b):
(a) Other
(b) Other Commercial

14. Plan Shape: Rectangular

15. Number of Stories: 1

16. No. of bays (1st floor): 1

17. Roof Type: Flat

18. Roof Material:

19. Chimney placement:

20. Structural system: Load-bearing Brick

21. Ext. wall cladding: Brick

22. Foundation Material: Concrete

23. Basement type: None

24. Front Porch Type:

25. Acreage (rural):
Visible from public road? ☐

26. Outbuildings (list, describe in Box 26 cont'd):

27. Changes:
☐ Addition(s) Date(s):
☐ Altered Date(s):
☐ Moved Date(s):
☐ Other Date(s):
Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date: 1954

30. Significant date/period:

31. Area(s) of significance:
0
0

32. Architect: Meyer, A.

33. Builder: Ette, Edward

34. Original or significant owner: Carlisle Safes, Inc.

35. Previously surveyed? ☐
Survey Name: St. Louis African-American History Sites

36. On National Register? ☐ individual.
Nomination: ☐ district

37. National Register eligible?
Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40. Current Owner address	41. Form prepared by (name and organization):	42. Survey date:
CARTER, KENNETH C & LEROY CARTE	Lynn Josse, Michael Allen, CRO	3/15/2010
3505 HEBERT		43. Date of revisions
ST LOUIS MO 63107		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☐ listed ☐ in listed district	☐ reconnaissance ☐ intensive	☐ yes ☐ no
Name: ☐ pending listing ☐ eligible (individually) ☐ eligible(district) ☐ not eligible ☐ not determined	Other:	

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This flat-roofed building has a concrete slab foundation and painted brick walls. There is a window ribbon on south elevation and a window ribbon and entrance on east elevation. A tapered metal canopy runs on east, south and west elevations. There is a one-story flat-roofed addition of painted concrete masonry units to the north.

38.(cont.) History:

Ice-cream store. Permit issued 4/6/1970 to Leroy Carter for addition ($3,000).

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ICEHOUSE
89¢
24oz Cans
Colt 45
Stag
24 oz CANS
$1.19
KEYSTONE ICE
KEYSTONE LIGHT
89¢
24oz Cans
AN
9
NEW KING
MART

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036 218		Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		**4364 DR MARTIN LUTHER KING DR**
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	1. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Religion
	Sub-use:	Sub-use: Religious Facility

ARCHITECTURAL INFORMATION

12. Category of Property	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style vernacular type (a)/(b):	20. Structural system:	
(a) Other	Load-bearing Brick	
(b) unidentified due to recent date		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	Altered Date(s):
Low Gable		Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road?	Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page.

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed?
1969	Burger Chef Systems, Inc.	Survey Name:
30. Significant date period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: district
	Burger Chef Systems, Inc.	
		37. National Register eligible?
		Less than 50 Years

38. History and significance on continuation page.

39. Sources of information on continuation page.

OTHER

40: Current Owner address			41. Form prepared by (name and organization):	42. Survey date:
GREAT COMMISSION LUTHERAN			Lynn Josse, Michael Allen, CRO	3/15/2010
4364 DR MARTIN LUTHER KING DR				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☐ listed ☐ in listed district	☐ reconnaissance ☐ intensive	☐ yes ☐ no
Name: ☐ pending listing ☐ eligible (individually) ☐ eligible(district) ☐ not eligible ☐ not determined	Other:	

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Former fast food restaurant with drive-through lane converted into church. Metal steeple placed on center of low gable in front; mansard-sided flat-roofed section behind. Painted brick walls, with unpainted false chimney on front elevation.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	Z19	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4202 W DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories	22. Foundation Material:	
2		
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1894		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Wohldmann, Geo.	
		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PETTIBONE PATTI L	Lynn Josse, Michael Allen, CRO	3/15/2010
4216 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

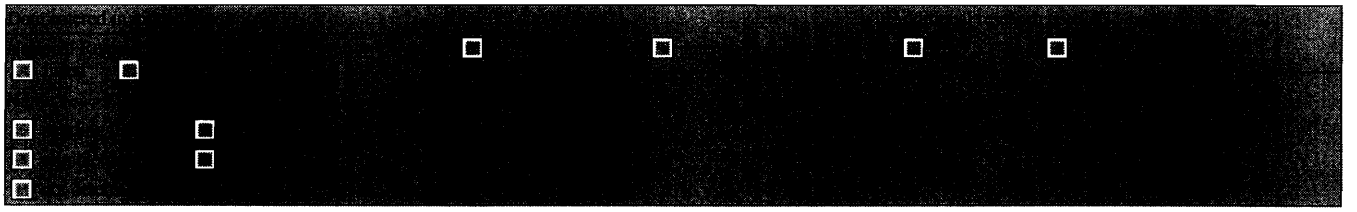

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick with tan brick corbelling on parapet. All openings boarded. First floor has storefronts on each end with steel headers and corner chamfered entrances with round columns. Original division of storefront windows and transoms remains intact. Entrance to second floor at center with Roman arch and vertical header course with tracing course and red sandstone imposts. Center bay projects slightly. Metal cornice over first floor missing. Second floor window openings have sandstone sills with consoles and vertical segmental header courses traced by ornamental brick.

38.(cont.) History::

1925 permit for rear machine shop. Rear additions through the 1940s connect this building to those to the west.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	220	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4213-17 W DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Center	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Bungalow/Craftsman	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
5	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1911	Lee, Thomas C.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sidmouth Investment Company	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Sidmouth Investment Company	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
COLEMAN, LUCIOUS & JESSIE MAE	Lynn Josse, Michael Allen, CRO	3/15/2010
1086 WILSHIRE		43. Date of revisions:
ST LOUIS MO 63130		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted two story front elevation. First floor divided into three storefronts with entrances to second floor at either end; continuous soldier course header across the three storefronts. Stone sill course with consoles runs at second floor. Two projecting bays at each end have wooden ornament and paired window openings (boarded save one showing a one-over-one window) on their faces. Bays rise up through projecting bracketed cornice to form pyramidal roofs (clad in asphalt). Rowlock course runs at second floor header level; stone lozenges spaced symmetrically above. Three boarded window openings at second floor center.

38.(cont.) History::

1920 census: 4215Wa: Griffin, Frank and Marie and daughter and 2 roomers - 16yo dressmaker and a garage porter. Frank works for RR. White, renters. 4215: Frank and Carrie Sands, white renters, he's a chauffeur and she is proprietor of candy store. 4217a, Goldstein, Sylvester and ... Exalle?, white renters, he's a chauffeur at mercantile Co.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	221	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4214-16 W DR MARTIN LUTHER KING DR
5. City/State	Vicinity:	6. UTM: / 7. Township/Range/Section. Not Applicable
St. Louis, MO	☐	T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Steel	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1950	Wischmeyer & Lorenz	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Willingham Construction Company	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	H. & N. Machine and Motor	
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
SURPLUS EQUIPMENT CO INC	Lynn Josse, Michael Allen, CRO	3/15/2010
4216 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick with red brick band courses at base and second floor sill level. Soldier course bands at window opening header level. Angled bricks at top under stone coping. Windor openings have red brick rowlock sills; windows are triple two-over-two metal windows. Entrance at right framed by limestone, with metal double door and glass surround, metal spandrel (obscured partly by awning) and tiple window above. Red brick garage wing is set back at east side.

38.(cont.) History::

This building was constructed adjacent to the earlier building to the west, and although it was permitted in October 1950, it does not appear on the Sanborn map of 1951.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4216 W
SURPLUS EQUIPMENT COMPANY

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	222	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4219-21 W DR MARTIN LUTHER KING DR
E. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable
St. Louis, MO	■		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Craftsman	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Undetermined	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat	none	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date.	32. Architect:	35. Previously surveyed? ■
1911	Lee, Thomas C.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Sidmouth Investment Company	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
	Sidmouth Investment Company	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MARTIN, VALERIA	Lynn Josse, Michael Allen, CRO	3/15/2010
6425 HADDEN BAY DR		43. Date of revisions:
FLORISSANT MO 63033		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick stretchers with burnt headers alternating with the stretchers at every 6th course. First floor divided into two center storefront openings (continuous solider course header) and outer jack-arch entrances to the second floor, which have stone and brick relieving arches and rowlock headers. A limestone sill course runs across the second floor, where four jack-arch window openings contain one-over-one wooden windows. A continous rowlock header and masonry detailing at center and ends frames these openings. Stone lozenges are placed above the openings and below the projecting wooden cornice, which has tall brackets. There is buff glazed terra cotta ornament at center on the parapet (apparently missing some kind of center ornament), and coping of the same.

38.(cont.) History::

Mae Layne ran a hat shop in the building, per 1943 directory. She was a member of the Negro Business League. May have been at 4219 E Dr ML King. Also ran the St. Louis Housewives League from same address.
A. Mitchell ran a Poultry Market, per 1943 directory. Member of the Negro Business League.
James Lennox Pipe and Steam Fitter, resided at 4221A W Dr. ML King. 1920 census:4219a W: Patterson, D.(?) and Mabel, he's an elevator constructor, white, renters. 4221w, a: Eiermann, Walter and Emma and 2 daughters, white renters, he's a tinner for a radiator repairer. 1934 Negro Bus. Dir: Ritz Café at 4221W

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

KamiKaze Kutz
4219

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	223	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4220 W DR MARTIN LUTHER KING DR
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Steel	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6		■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Flat		■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1940		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
	H. & N. Machine and Motor	
		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PETTIBONE PATTI L	Lynn Josse, Michael Allen, CRO	3/15/2010
4216 DR MARTIN LUTHER KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

□ □ □ □ □ □ □ □ □ □ □

Architectural/Historic Inventory Form

Location Map (include north arrow):

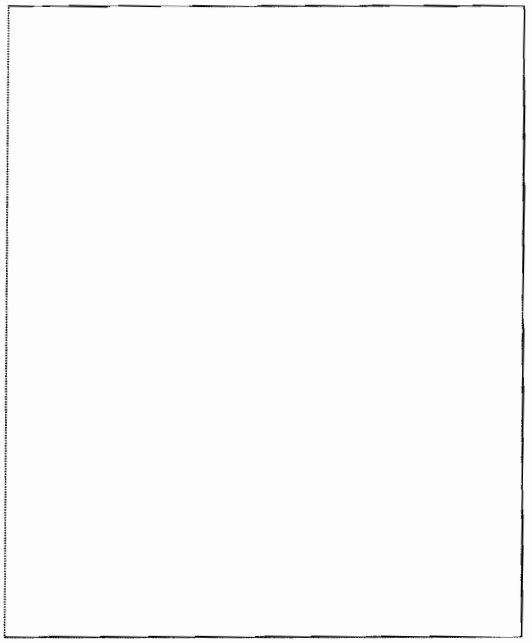

Site Map/plan (include north arrow):

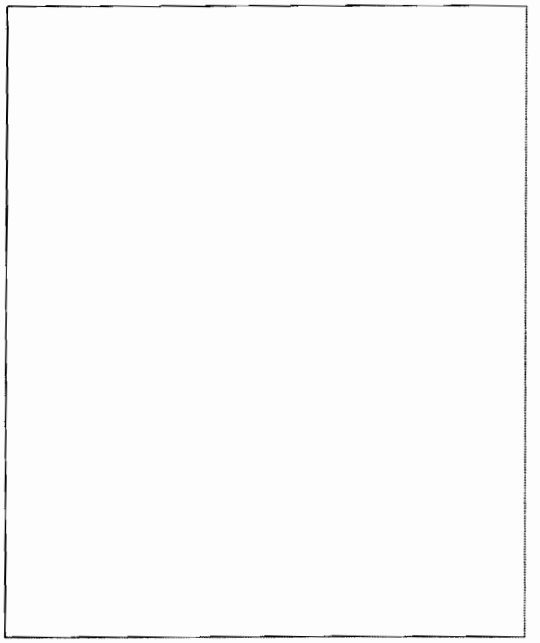

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Buff brick with red brick band courses at base and second floor sill level. Soldier course headers run between piers, and a course of angled bricks is at the top of the wall, which has stone coping. The window openings have red brick rowlock sills and contain steel sash windows. There are two entrances.

38.(cont.) History::

It appears that the first three bays were built separately from the second three, but the permit record is unclear.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4216 W
SURPLUS EQUIPMENT COMPANY

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	224	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4223-9 W DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	1. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Vacant/Not in Use
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
8		Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	Altered Date(s):
Flat		Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road?	Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page.

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed?
1925	Krieg, Otto J.	Survey Name:
30. Significant date period:	33. Builder:	St. Louis African-American History Sites
	Welsh, C. A., Const Co.	36. On National Register? individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page.

39. Sources of information on continuation page.

OTHER

40. Current Owner address:	41. Form prepared by (name and organization):	42. Survey date:
4223 M L KING PARTNERSHIP	Lynn Josse, Michael Allen, CRO	3/15/2010
4220 W SAN FRANCISCO AVE		43. Date of revisions:
ST LOUIS MO 63115		

FOR SHPO USE:

Date entered in inventory:	Level of survey:	Additional research needed?
National Register Status: ☐ listed ☐ in listed district	☐ reconnaissance ☐ intensive	☐ yes ☐ no
Name: ☐ pending listing ☐ eligible (individually) ☐ eligible(district) ☐ not eligible ☐ not determined	Other:	

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Light brown brick, with limestone base. All openings missing windows and doors and first floor openings boarded. First floor openings have jack arches and dark brick soldier headers. Second floor openings have terra cotta sills and light brick soldier course headers. Outer bays are entrances, and white glazed terra cotta bases at the second floor support brick pilasters with terra cotta capitals around outer windows at second floor. A white terra cotta cornice with dentil course under projecting crown runs continuous on the elevation above second floor. Pilasters on end bays rise above cornice to flank segmental arch rises in the parapet wall, which have terra cotta roundels inset. Parapet has terra cotta coping and masonry details marking bay divisions. A polychomratic green and white plaque above first floor's four central bays reads "ENTERPRISE CLEANING CO."

38.(cont.) History::

1925 permit to owner Enterprise Cleaning. 1951 permit to repair fire damage with new 2nd story concrete slab floor and new roof; see Sanborn map for fire damaged area. Some rear sections of the buidling predate the front by up to three years.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ENTERPRISE

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	225	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4228 W DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Romanesque	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open porch/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Walz, August	
		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
ANDERS, KYLE & MUNEEERA, NASEER			Lynn Josse, Michael Allen, CRO	3/15/2010
1148 WALTER AVE				43. Date of revisions:
ST LOUIS	MO	63138		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Front elevation clad in brown brick at base and left bay to mid-second floor, with red brick elsewhere. Metal cornice partly missing. Pyramidal roof clad in slate at top of left bay, with shaped parapet (terra cotta coping) at right. Stone steps to brick porch at right, where knee walls have stone caps. Wooden columns support flat roof of porch that forms balcony at second floor. Entrance boarded. Second floor opening on balcony has Roman arch with vertical header course and tracing course; arch-top Jefferson window inside. Leftside has raked water table and two bays of window openings; jack arches on first floor and Roman arches with vertical header course, keystones and tracing courses on second floor. One-over-one wooden windows. Stone capitals on pilasters that frame window openings; two capitals at right missing. Basement window openings have metal bars.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2216	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4241 W DR MARTIN LUTHER KING DR
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Load-bearing Brick	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s)
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1922-1947		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
KORTKAMP, WILLIAM & MARILYN &	Lynn Josse, Michael Allen, CRO	3/15/2010
4243 W M L KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

Date entered in inventory: Level of ☐ ☐ ☐ Additional research needed? ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Building built in three stages with different front elevation treatment on each section. Right section has brown brick face with yellow brick band courses; three window openings high on elevation filled with glass block; one entrance under leftmost window. Center section is painted with entrance at left, large covered window openings at center and garage entrance with metal roll-up door at right. Decorative band course above and brick rectangle formed through raised rowlock couse above. Left section is clad in red brick and have three window openings high on elevation with rowlock sills and four-pane metal sash inside; metal door in entrance under second opening from left; tall garage opening to right with metal roll-up door.

38.(cont.) History::

1951 Sanborn shows this as 4235-49 W Easton, 3 separate bldgs, now technically renumbered to 4231(single parcel). Middle bldg:1922 to owner R. Funsten, bldr McDonald Const Co., arch Coerner Eng. Co. East bldg recorded separately. The west bldg's footprint is on 1909 map but current appearance dates to 1959, $24,000 alteration to owner Sherman Manufacturing Co. (machine shop)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ACME GLASS
G Glass
Glass Co.
ACME GLASS
ACME
GLASS

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	227	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4241 W DR MARTIN LUTHER KING DR
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Load-bearing Brick	
(b)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1922-1947		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
KORTKAMP, WILLIAM & MARILYN &	Lynn Josse, Michael Allen, CRO	3/15/2010
4243 W M L KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

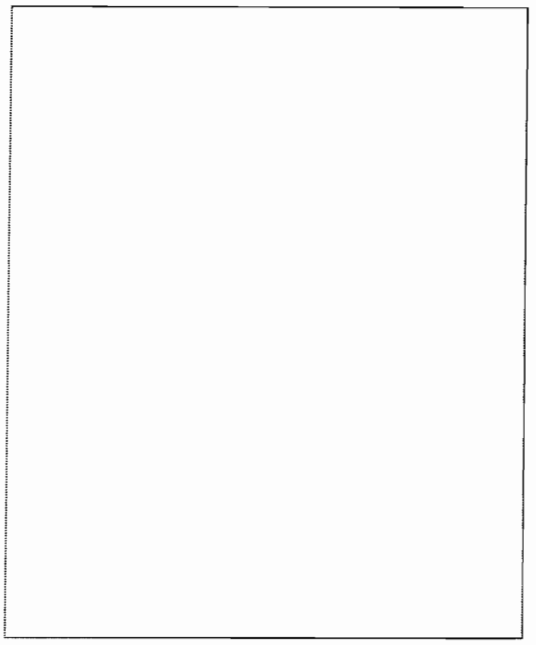

Site Map/plan (include north arrow):

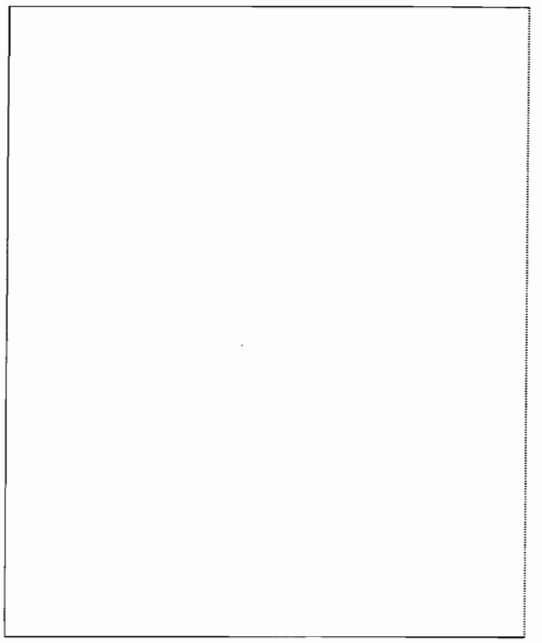

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Building built in three stages with different front elevation treatment on each section. Right section has brown brick face with yellow brick band courses; three window openings high on elevation filled with glass block; one entrance under leftmost window. Center section is painted with entrance at left, large covered window openings at center and garage entrance with metal roll-up door at right. Decorative band course above and brick rectangle formed through raised rowlock couse above. Left section is clad in red brick and have three window openings high on elevation with rowlock sills and four-pane metal sash inside; metal door in entrance under second opening from left; tall garage opening to right with metal roll-up door.

38.(cont.) History::

1951 Sanborn shows this as 4235-49 W Easton, 3 separate bldgs, now technically renumbered to 4231(single parcel). Middle bldg:1922 to owner R. Funsten, bldr McDonald Const Co., arch Coerner Eng. Co. East bldg recorded separately. The west bldg's footprint is on 1909 map but current appearance dates to 1959, $24,000 alteration to owner Sherman Manufacturing Co. (machine shop)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Unique
Beauty Salon
4257

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	228	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4257 W DR MARTIN LUTHER KING DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1909		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Morlock, L. F.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Morlock, L. F. (orig own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
RADMAN, ABE M & IDA S	Lynn Josse, Michael Allen, CRO	3/15/2010
4257 W DR MARTIN LUTHER DRIVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

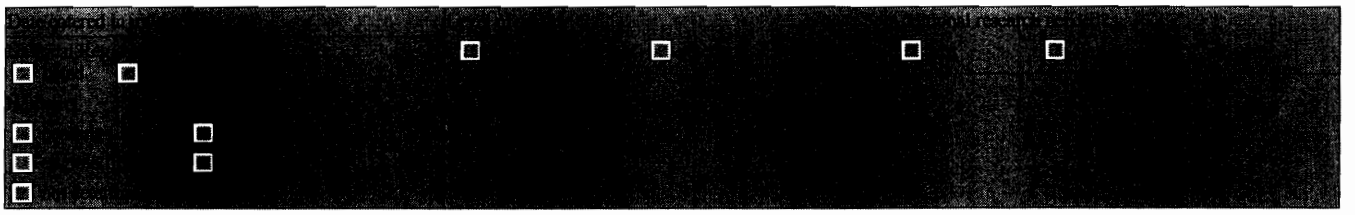

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

First floor has storefront and entrance between cast iron end columns with box headers; a decorated steel beam runs across. Second floor has three window openings (now infilled around replacement windows) with stone sills and vertical headers over jack arches. A blade sign projects. Corbelling under terra cotta cornice. Parapet has terra cotta coping, center step and end blocks.

38.(cont.) History::

Jackson Hill, Upholstery per 1943 Negro Directory. Member of St. Louis Negro Business League.
1920 census: Eisman, Alfred and Anna and son, white renters, he's an automotive machinist and she keeps a candy store.
4257W, a: May Martin and roomers, white, renter, she's a saleslady for dry goods retailer, roomers are housekeeper for private family, chauffeur, and carpenter

38. (cont.) Significance

39. Sources of information:

1943 Negro Directory; Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Golden Coin Chop Suey
GOLDEN COIN CHOP SUEY
OPEN
OPEN
Chop Suey fish
534-9170

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	229	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4259-67 W DR MARTIN LUTHER KING DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		1 Shed (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-part commercial block		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1		
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
5	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1925	Goodwin, C. B.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Goodwin, C. B.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Herriot, Dr. E. E. (orig own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TANG, LIN MAN & ZHAO LAN	Lynn Josse, Michael Allen, CRO	3/15/2010
722 ALRICK DR		43. Date of revisions:
CHESTERFIELD MO 63017		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story shed-roofed open frame shed.

28. (cont.) Further description of important architectural features:

Red brick, with painted area on western end. Brick piers divide elevation into seven jack-arch storefront openings. The central opening is configured as an entrance with recessed double doors surrounded by painted plywood behind metal security gates. The storefront openings have recessed entrances, and some are covered in plywood. Some have metal security grilles. Rectangular stone pieces provide ornament on piers and above openings. The parapet has stone coping and rises to form a pediment at center.

38.(cont.) History::

4259W per 1934 Negro Business Directory: Oak Leaf Restaurant
4259: Lola Wallace, Beautician; Beauty Shop, member of St. Louis Negro Business League. Also member St. Louis Beauticians Ass'n Local 125, per 1943 Negro Directory.
4261: Wood's Tailoring and Cleaning, cleaners, O. D. Wood per 1943 Negro Directory. Member of St. Louis Negro Business League.
4263: Walter Tobias, grocer, per 1943 Negro Directory; member of Negro Business League.

38. (cont.) Significance

39. Sources of information:

1943 Negro Directory; Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4273W

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	230	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4273 W DR MARTIN LUTHER KING DR
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Specialty Store	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 contributing garage
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1909		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Gladish, H. H.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
Ethnic Heritage	Kientzle, Frank A. (orig own.)	
Social History		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
VILLE AREA NEIGHBORHOOD ASSOC	Lynn Josse, Michael Allen, CRO	3/15/2010
4273 W DR M L KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

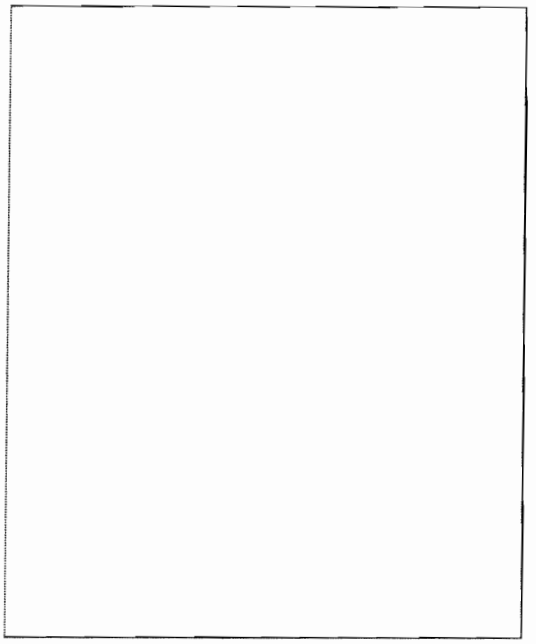

Site Map/plan (include north arrow):

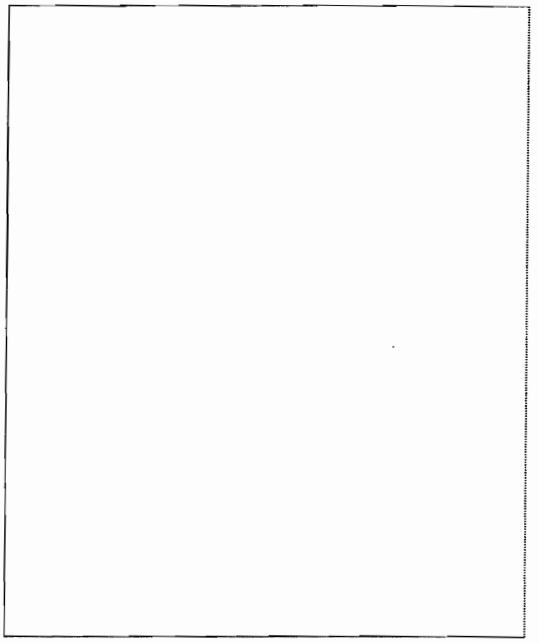

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a two-story brick flat roofed garage/outbuilding at the alley. (contributing)

28. (cont.) Further description of important architectural features:

First floor has ornamental cast iron end columns, box headers and steel arch beam. Storefront at left and entrance to second floor at right. Red brick above. Three window openings on second floor have stone sills and jack arches; center opening has wooden one-over-one window and outer openings are boarded. Brick label course runs through all three windows. Corbelling above forms four blocks with stepped bases; outer two rise through parapet and inner two rise to form pediment. Clay tile coping.

38.(cont.) History::

Kientzle, Frank A. orig. owner
Lee Bennett, Radio Shop, per 1943 Negro Directory. Member of St. Louis Negro Business League.
1920 census: Kintzel, Frank and Josephine and 2 kids, white owners, he's proprietor of photography studio
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4273N

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	231	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4275 W DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1906	McMahon, Wm. P.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Francis, A. J.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Bewig, Caroline (orig own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GODS HOLY MISSION CH OF GOD	Lynn Josse, Michael Allen, CRO	3/15/2010
4275 DR M. L. KING DR		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

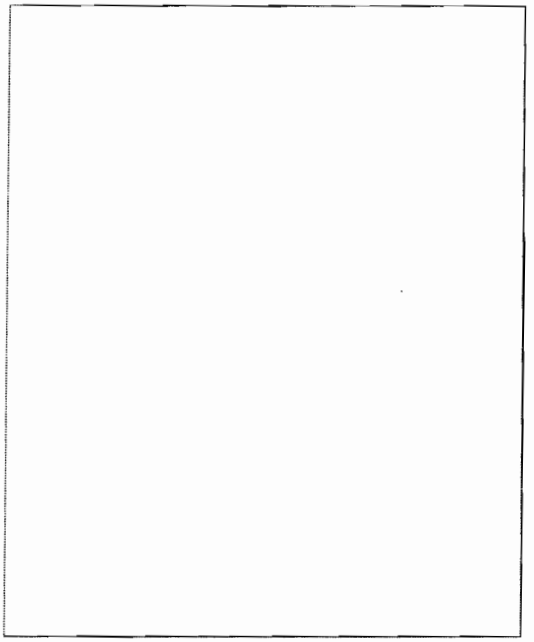

Site Map/plan (include north arrow):

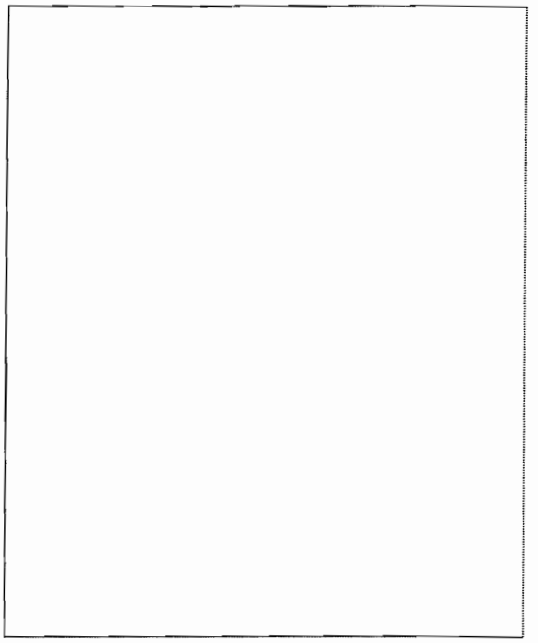

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

First floor has cast iron columns and decorated steel header. Entrance to second floor at left, storefront ribbon at right. Brown brick above. Projecting wooden cornice with brackets; parapet has end blocks and clay tile coping. Four second floor window openings share stone sill course and raised brick tracery course through Roman arch vertical headers and rowlock band course. Openings have wooden one-over-one windows behind smaller metal storm windows.

38.(cont.) History::

Harold W. Ross, Ross Furniture & Appliance Company, per 1943 Negro Directory; member of St. Louis Negro Business League. 1920 census: Christine Bewig, nat. from Denmark, owner, white, and daughter. Christine is a housekeeper, daughter Alma a bookkeeper for Board of Ed.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

1943 Negro Directory; Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	232	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4277-81 W DR MARTIN LUTHER KING DR
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☐	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 6-Family Flat		
14. Plan Shape	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
6	Full	☒ Addition(s) Date(s)
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	closed porch/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Carr & Brother	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Harrigan, Lawrence (orig own.)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GOODIN, HENRY & CHARLENE	Lynn Josse, Michael Allen, CRO	3/15/2010
1944 SEMPLE		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick, with sandstone sill course at first floor. Projecting flat-roofed entrances (doubled at the second and third bays, and a single bay projection at the fifth bay) have stone steps and full brick surrounds. Replacement doors. Basement window openings have tall vertical headers over segmental arches; two have single-pane wooden windows and others are boarded. Window openings above have six rowlock courses forming segmental arches; second floor openings have painted stone sills. Large window openings have paired wooden one-over-one windows, and small openings have wooden one-over-one windows. Two door openings to rooftop balconies over entrances are boarded, other has replacement door and covered transom. Two projecting courses of sandstone above are somewhat deteriorated; top course has ornamental brick label.

38.(cont.) History::

1920 census: Walker Murphy and Pearl, and daughter, and 9-y-o boarder, white renters. He's an auto machinist. 4277Wa: Charles and Anna Hamilton, white renters, he's a streetcar conductor. 4279W: Reilly, Edw and Sevia(?) and sons Francis and Jos., white renters; he's a house carpenter, she's nat. Irish and son is police clerk and other son is errand boy; 4279W, A: Dan'l and May Milton, white renters, he's a RR worker. 4281 W: Harry and Mamabel Hammerstadt and sone David, white retners, he's a storekeeper with a "Bycicle" store; 4281wA: City Hall clerk Edw Hicks, wf Eliz, unemployed horse shoer son, Electric Co. clerk daughter and younger son, white renters.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	233	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4283 W DR MARTIN LUTHER KING DR
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known)		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	~~closed~~ porch/balcony (reenclosed)	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Carr & Brother	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
	Harrigan, Lawrence (orig own.)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/15/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

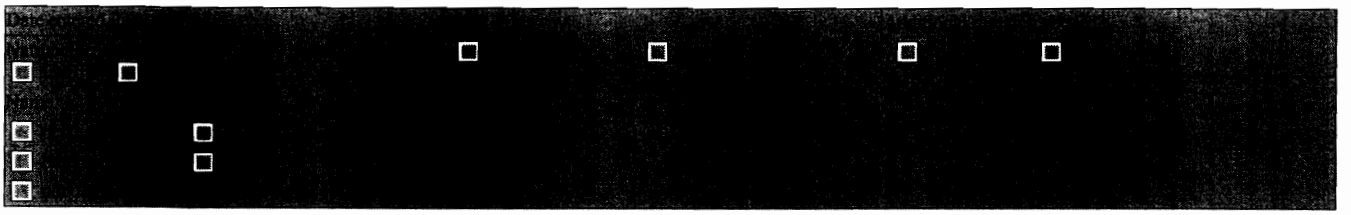

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick with sandstone sill course at first floor. Openings above basement have vertical segmental arch headers. Stone steps to enclosed porch with full brick surround and metal cornice. Entrance boarded. Basement window openings boarded with tall segmental arch vertical headers. Window openings in right bay (second floor has stone sill) have large two-over-two wooden windows. Above porch there is a small opening with wooden one-over-one window and a tall opening containing a one-over-one wooden Jefferson window. Projecting sandstone course below a course of ornamental brick on the parapet. Parged area suggests removed cornice.

38.(cont.) History::

This building was permitted separately from its attached neighbor next door, although they were built at the same time. 1920 census:white renters: E(?) Bailey, female no occupation, and Jennie Salisbury and her two "traveling actress" daughters.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

BAJAN
BAR

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	234	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4285 W DR MARTIN LUTHER KING DR
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Commerce/Trade	Commerce/Trade
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Two-part commercial block		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat		☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Other	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1895	Baker, A. M.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Carr & Brother (assumed)	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
	Harrigan, Lawrence (orig own.)	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
GOODIN, HENRY & CHARLENE	Lynn Josse, Michael Allen, CRO	3/15/2010
1944 SEMPLE AV		43. Date of revisions:
ST LOUIS MO 63112		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

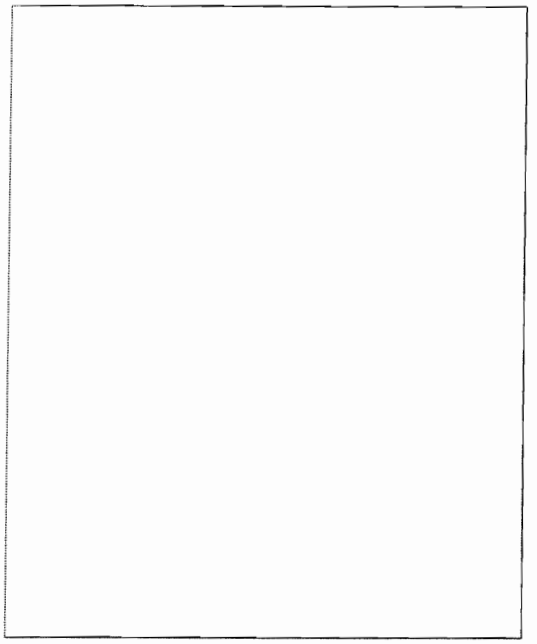

Site Map/plan (include north arrow):

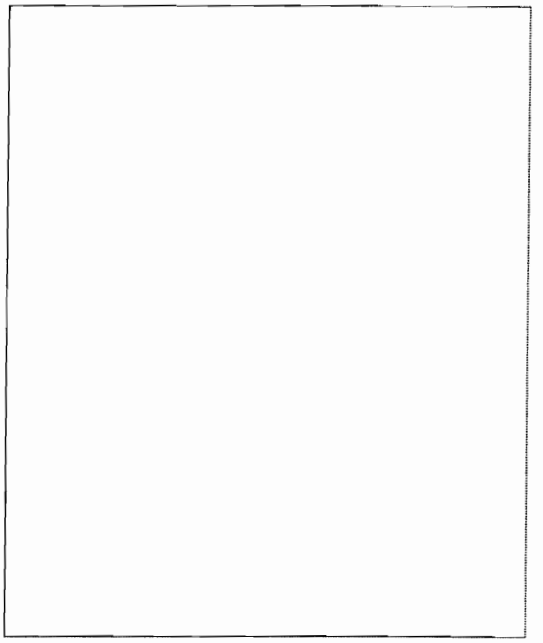

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Projecting wooden cornice above with low, long brackets. Ornamnetal brick and sandstone courses below. Second floor has three openings with segmental arches, vertical headers and a shared sandstone sill course. Wooden one-over-one windows. Storefront opening on first floor wraps corner with rounded corner column and decorated steel header. A single story rear addition along Billups stretches to the alley.

38.(cont.) History::

This building was permitted separately from its attached neighbor next door, although they were apparently built at the same tmie. 1920 census:Balducci, Arthur and Rose and three kids, renters, white, he's a saloonkeeper and one son is a bartender; als a saleslady and a clerk.
1927 Red-Blue Book:
1934 Negro Business Directory: H. A. Smith Delicatessen

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

HEAD START
Garfield Center

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	235	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4146 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Education	Education
	Sub-use:	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Undetermined	
(b) School		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1953	Leimkuehler, F. Ray	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hinrichs Const. Co.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing - Ind. elg?

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
YWCA OF GREATER ST LOUIS			Lynn Josse, Michael Allen, CRO	3/1/2010
3820 W PINE				43. Date of revisions:
ST LOUIS	MO	63108		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

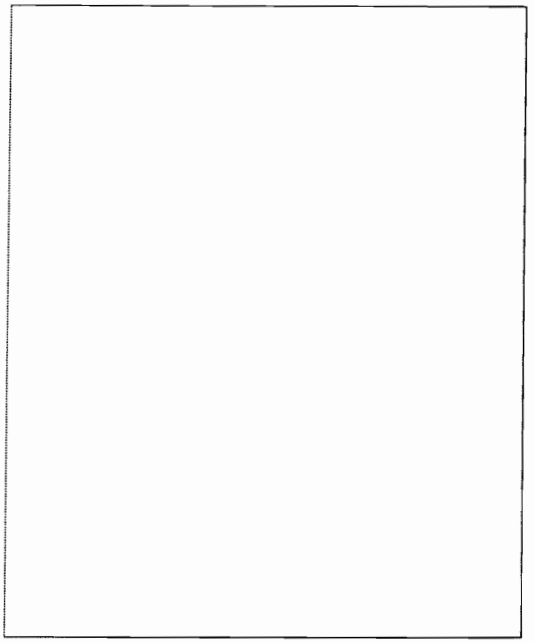

Site Map/plan (include north arrow):

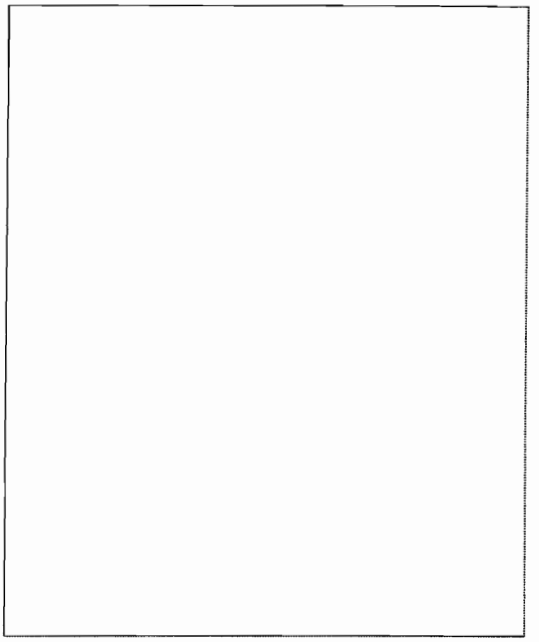

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This flat-roofed brick recreational buidling has a center entrance flanked by projecting granite piers rising up to a roof overhang. Steel double doors under glass block in entrance. Windows to the left of entrance are metal, as are others on east and west elevations. Brick is laid in alternating stretcher and header courses.

38.(cont.) History::

Riddick Branch School, original owner BoE. Constructed in 1953, during Brown vs. Board of Education litigation, as branch of segregated black Riddick School (located on Evans south of MLK).

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record,

4206
4208

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	236	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4206 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1911	White, J. T.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marade, B. (orig own)	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MILLER, ROZALIND E	Lynn Josse, Michael Allen, CRO	3/1/2010
4206 E GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

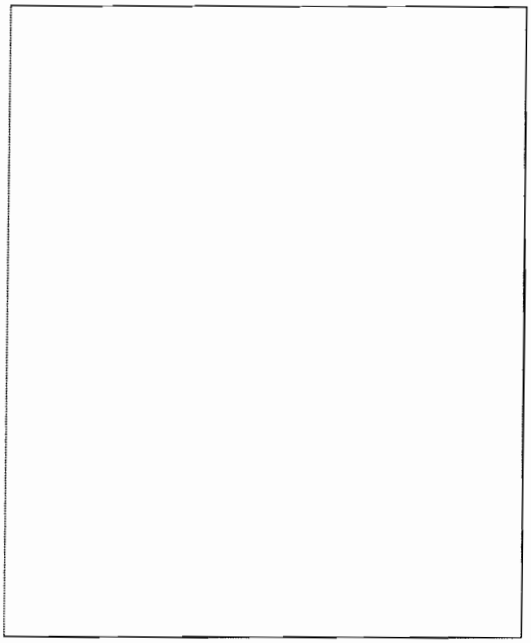

Site Map/plan (include north arrow):

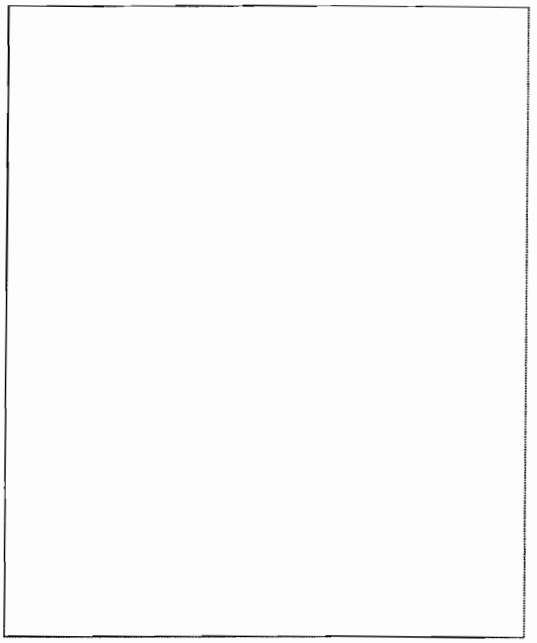

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled concrete masonry unit garage.

28. (cont.) Further description of important architectural features:

The basement is high, and there is a basement entrance on the front elevation in the left bay. To the right, a concrete block porch has concrete steps and a wooden shed-roof cover. The first floor has a window opening at left (containing a replacement one-over-one window and obscured by a metal awning) and an entrance at right (with a replacement door and covered sidelight and transom). The shaped parapet has a center step and end blocks with bakery brick accents.

38.(cont.) History::

1911 owner: Charles A. Pitman 1920 census:Ward, William and Lula and children, owners, he's a janitor
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4208
4208A
4208

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	237	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4208 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date.	32. Architect:	35. Previously surveyed? ☒
1926	Guth, H. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Liebert and Reilley	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DEES, TAMMY V & ALBERT	Lynn Josse, Michael Allen, CRO	3/1/2010
12029 CONTINENTAL DR		43. Date of revisions:
ST LOUIS MO 63138		

FOR SHPO USE:

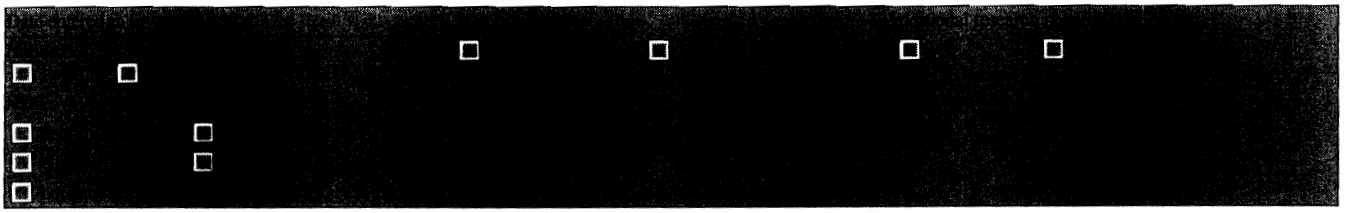

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This building is clad in rough brown brick and has a shaped parapet with white terra cotta coping. Concrete steps lead up to a porch which has berick columns rising to support a second floor balcony. The balcony has a metal railing, and wooden fascia is found under. There are two replacement doors in the entrance, and a replacement door to the balcony. The right window bays have triple replacement windows at the first and second floors and a triple wooden window at the basement. Headers over the windows are soldier course, with limestone end blocks on the second floor. The balcony door opening has a rowlock course header and stone end blocks. A solider course with stone end blocks runs across the parapet.

38.(cont.) History::

1926 owner: B. Marade
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	238	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4210 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch/balcony	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1926	Guth, H. W.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Liebert and Reilley	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
DEES, ALFRED & TAWANNA M	Lynn Josse, Michael Allen, CRO	3/1/2010
30 STEIERT DR		43. Date of revisions:
ST PETERS MO 63376		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

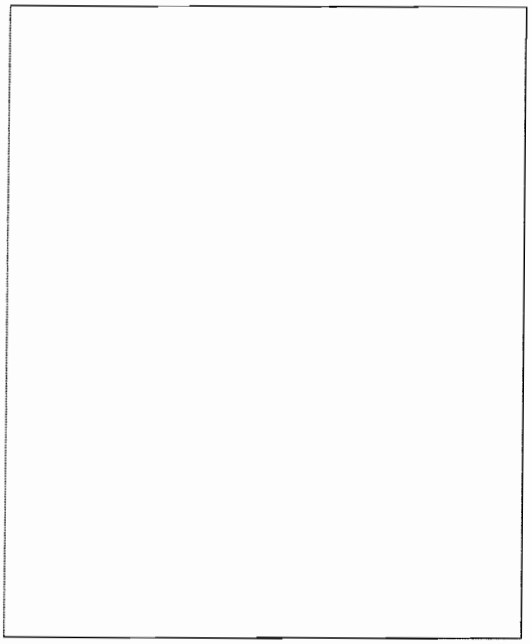

Site Map/plan (include north arrow):

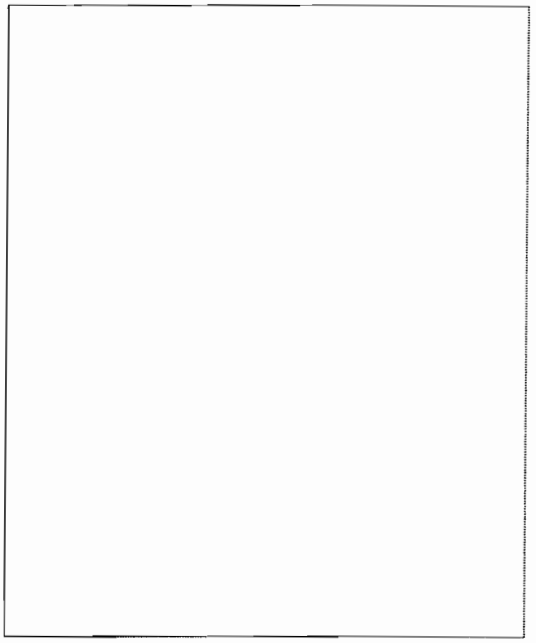

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This building is clad in rough brown brick and has a shaped parapet with white terra cotta coping. Concrete steps lead up to a porch which has brick columns rising to support a second floor balcony. The balcony has a metal railing, and wooden fascia is found under. There are two replacement doors in the entrance, and a wooden door to the balcony. The right window bays have triple windows at the first and second floors (three over one at center flanked by two over one windows) and a triple wooden window at the basement (windows have six panes). Headers over the windows are soldier course, with limestone end blocks on the second floor. The balcony door opening has a rowlock course header and stone end blocks. A solider course with stone end blocks runs across the parapet.

38.(cont.) History::

1926 owner: B. Marade
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	239	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4216 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1947		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Watson, G. W., Sons	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WF LLC	Lynn Josse, Michael Allen, CRO	3/1/2010
715 COUGAR CREEK TRAIL		43. Date of revisions:
ST LOUIS MO 63376		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

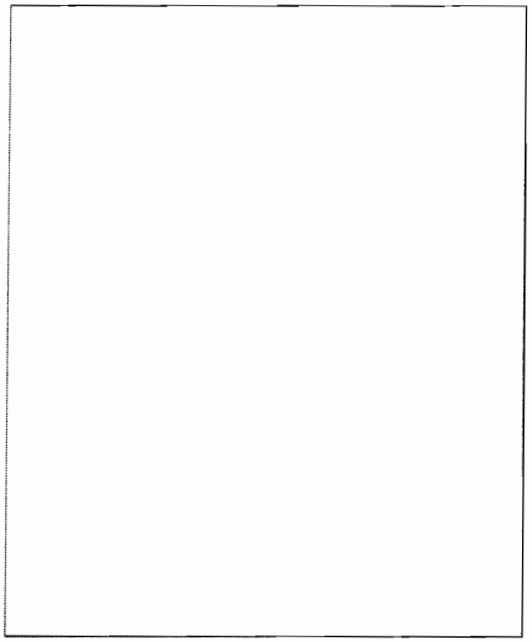

Site Map/plan (include north arrow):

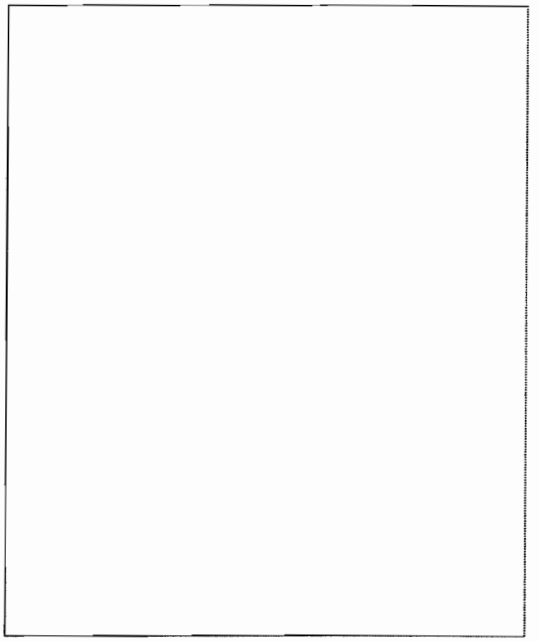

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The tapestry brick walls are laid in rows of five stretcher courses alternating with header courses. The concrete stoop has conrete-capped brick knee walls. The entrance has a replacement door. Window openings on each side carry wooden three-over-one windows.

38.(cont.) History::

1947 owner: Jeanette Kelly

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4224

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	240	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4224 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
1883		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
		Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CLARK, CHARLES L & ELIZABETH	Lynn Josse, Michael Allen, CRO	3/1/2010
7175 WHITE OAK		43. Date of revisions:
ST LOUIS MO 63130		

FOR SHPO USE:

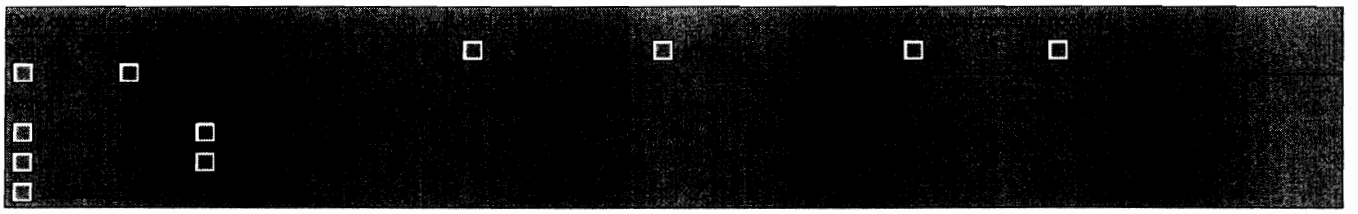

Architectural/Historic Inventory Form

Location Map (include north arrow):

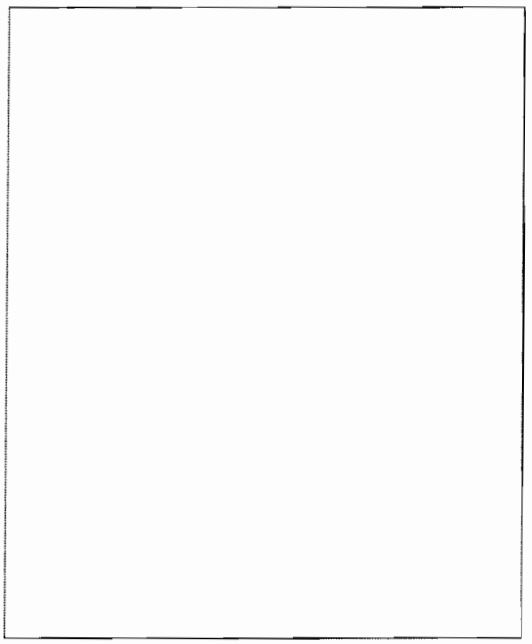

Site Map/plan (include north arrow):

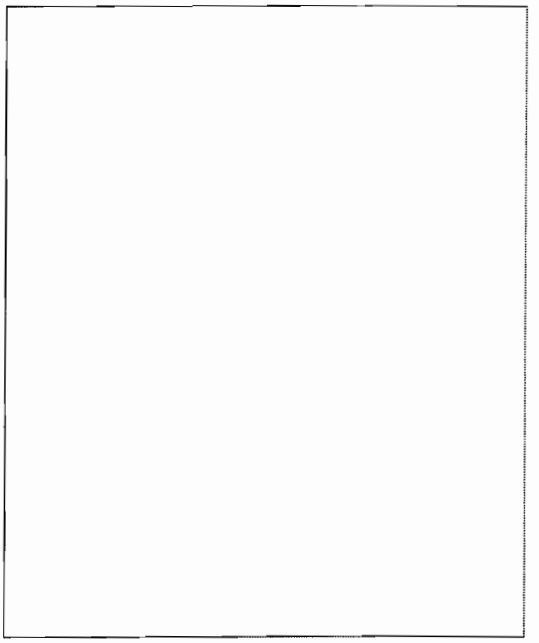

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The red brick house has a high basement. Concrete steps lead to a concrete porch, which has metal columns under a hipped roof. The wooden door and entrance surround in the doorway are original. The two window bays to the left have wooden one-over-one windows at the basement and boarded windows at the first floor. Part of the ornamental wooden cornice remains at the top of the wall under a false front roof clad in rolled asphalt roofing.

38.(cont.) History::

1883 owner: J. W. Newcomb 1920 census:Lucks, Henry and Louisa and daughter and son-in-law Welsh and grandchild; own, and they're white. Parents nat. German. Henry is self-employed tailor, daughter a seamstress in factory, son in law is a builder for a bricklayer.
1927 Red-Blue Book:Lucks
1930 census: 3/16/1956: brick and concrete block addition permitted to owner Charles and Elizabeth Clark. $900

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	241	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4226 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Brick	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Closed Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1883		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
PURLEY, WILLIE M & EARNESTENE	Lynn Josse, Michael Allen, CRO	3/1/2010
4226 E GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

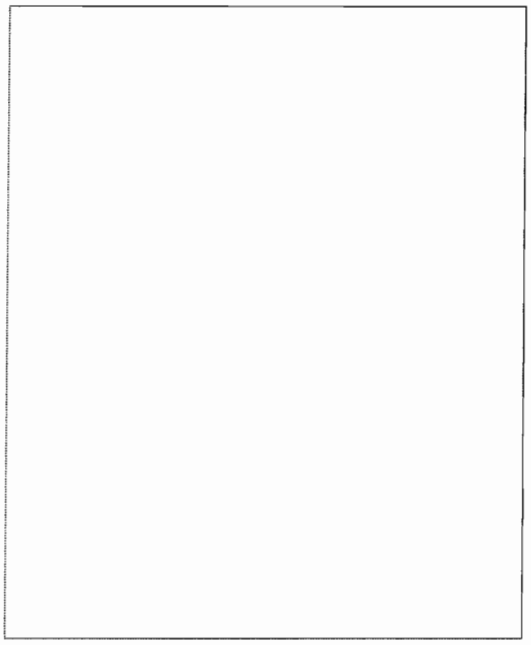

Site Map/plan (include north arrow):

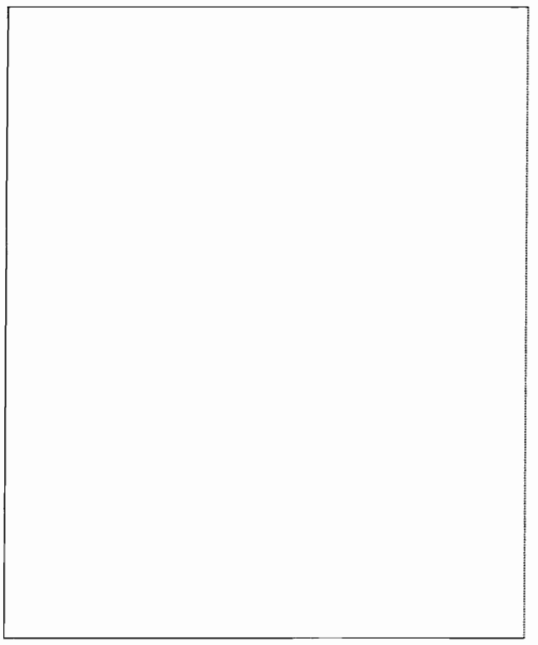

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. A simulated stone clads the high basement and porch enclosure. Concrete steps. Enclosed shed-roofed stairwell to basement to left of steps. All openings boarded, and window openings at first floor filled in at top. Parapet has creasing course.

38.(cont.) History::

1883 owner: J. W. Newcomb 1929 addition permitted to F. Lawler, 14x22 1920 census: Ritchie, William and Hattie and granddaughter, renters, black, he's a manager at a boarding stable
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	242	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4315 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Huber, C.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
JACKSON, CHRISTINE M	Lynn Josse, Michael Allen, CRO	3/2/2010
4315 GARFIEDL AVENUE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

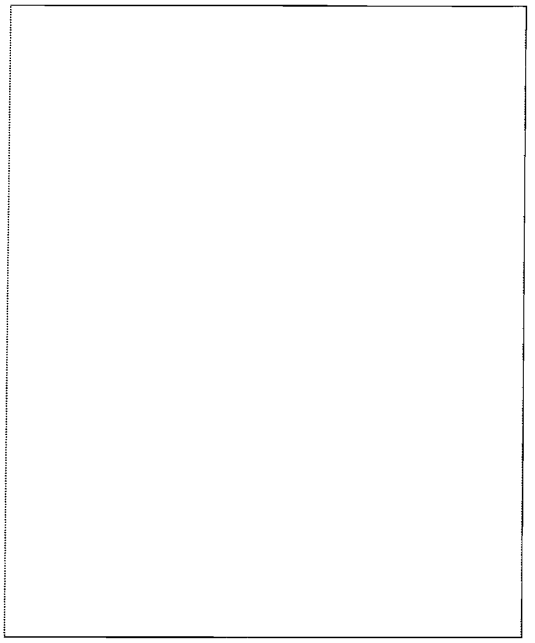

Site Map/plan (include north arrow):

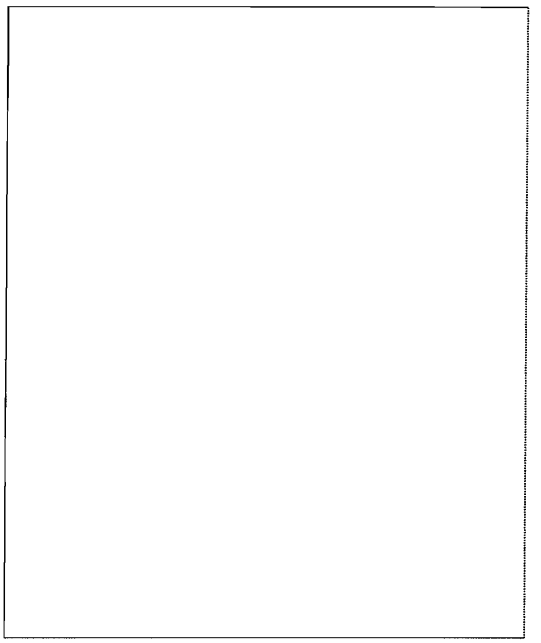

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled frame garage clad in corrugated metal siding (noncontributing)

28. (cont.) Further description of important architectural features:

This red brick 2-family building has a red brick façade. Concrete steps lead up to two new windowless replacement doors; the entrance has a reconstructed flat arch and rowlock header, and traces of a former porch roof are visible on the façade. Window openings have segemental arches consisting of double rowlock courses as well as stone sills, and contain one-over-ove replacement windows. It is likely that a shaped parapet has been sheared down to form the present flat and unornamented parapet wall.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Lancaster Oscar (Della); 4315a: Peeples Emma Mrs.
1930 census:
rear addition 14*16 permitted 1906

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	243	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4317 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TATUM, JAMES JR	Lynn Josse, Michael Allen, CRO	3/2/2010
17635 AILANTHUS DR		43. Date of revisions:
CHESTERFIELD MO 63005		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

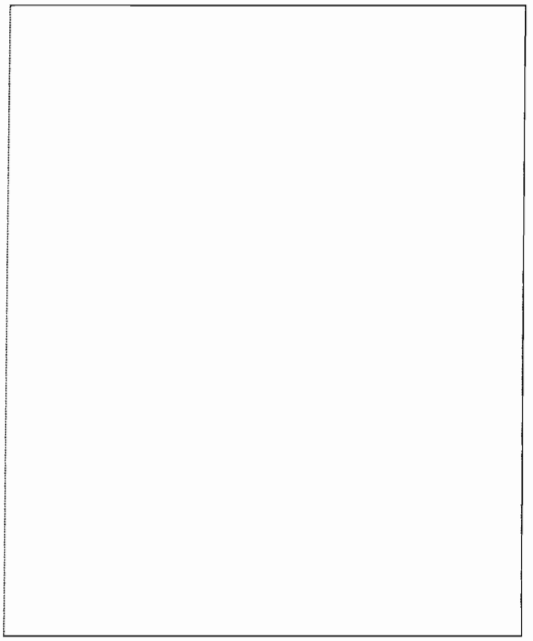

Site Map/plan (include north arrow):

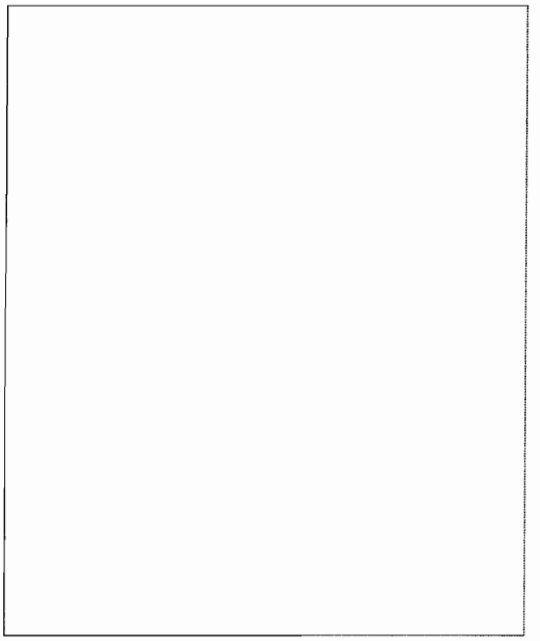

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Concrete porch clad in simulated stone masonry, with metal columns supporting metal awning. Entrance boarded. Window opening at left has stone sill and segemental arch with soldier header; two-over-two wooden window in casement with ornamental eye brow. Ornate wooden cornice above wraps sides and has carved brackets and fascia under projecting crown molding.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Johnson Arth (Alice)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

BEWARE
OF THE DOG

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	244	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4318 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
OLDHAM, ANNETTE MARIE	Lynn Josse, Michael Allen, CRO	3/2/2010
4318 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

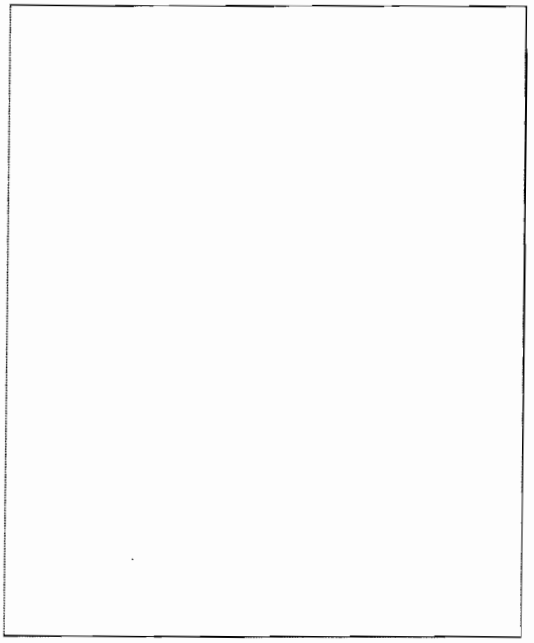

Site Map/plan (include north arrow):

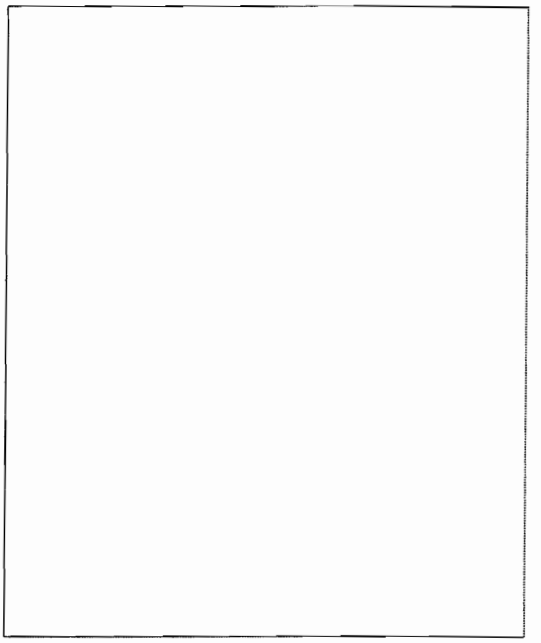

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This three bay house has a red brick façade with high basement windows. Basement has separate segmental-arch entrance with louvered door and ornamental eyebrow. Window opening at basement level has vinyl replacement window. Concrete steps to first floor recessed entrance, which is panelled in pressed wood and has a wooden replacement door. First floor window openings are significantly diminished (the top sections are bricked in and the openings slightly widened on one side), but stone sills with consoles remain. Wooden cornice with brackets and ornamental fascia remains.

38.(cont.) History::

1920 Census: rented by family of 5, headed byJames and Lulu Johnson, black; he is a 62-y-o laborer for Street Bus Co, daughter Bessie is a public school teacher.
1927 Red-Blue Book: Mrs. Josie F. Clayton.

38. (cont.) Significance

39. Sources of information:

1927 Red-Blue Bok

4322

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	245	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4322 GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1898		Survey Name:
30. Significant date/period.	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Scullin, Annie	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
AHMAD, OFFIONG RASUL	Lynn Josse, Michael Allen, CRO	3/2/2010
4322 GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☒

Architectural/Historic Inventory Form

Location Map (include north arrow):

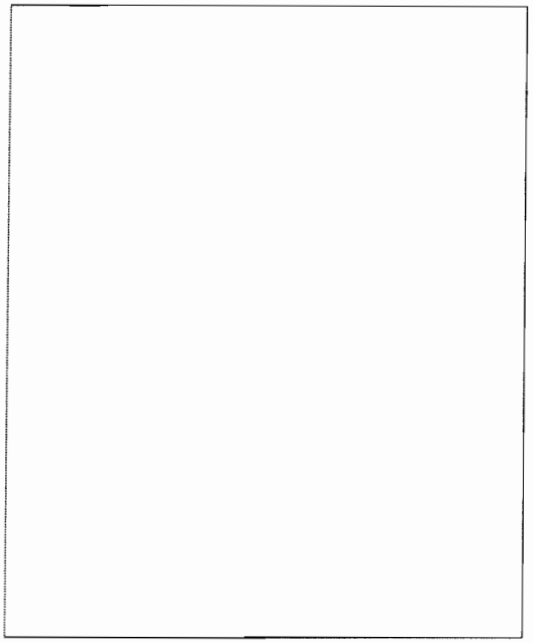

Site Map/plan (include north arrow):

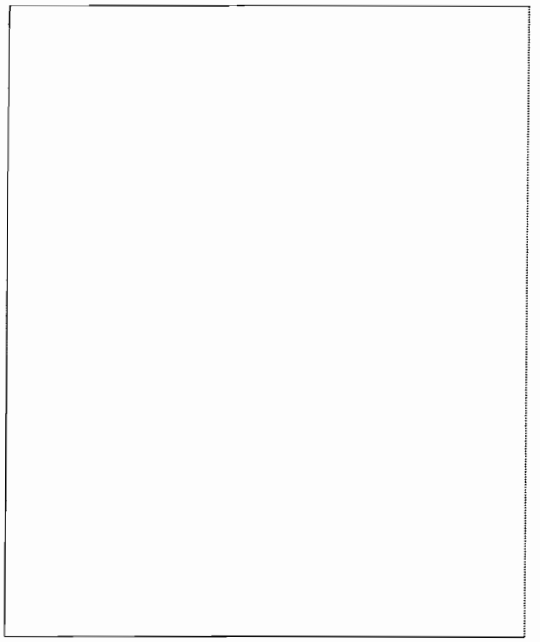

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this building is red brick, separapted from the frown brick base by a limestone course at the level of the first story sill. Two basement openings at right are filled with glass block. Concrete steps to recessed entrance at left, which has Roman arch with soldier header and tracing course. Entrance filled with storm doors and windows with T1-11 tympanum. Stone sill course at second floor. Window openings have segmental arches and full soldier surrounds with tracing courses. Windows are replcement on-over-one vinyl units. Raised course continuous above second floor. A course of red terra cotta rosette panels suffices as a cornice. Parapet has shortened center and end steps, and has clay coping tiles.

38.(cont.) History::

1920 Census: rented by black family of three: Jack Evans(?), chauffeur; wife and son.
1927 Red-Blue book: Zack and Amelia Evans downstairs, Ulysses and Anna Golden upstairs

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4323

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	246	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4323 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WINSTON, LUCILLE	Lynn Josse, Michael Allen, CRO	3/2/2010
4323 GARFIELD AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

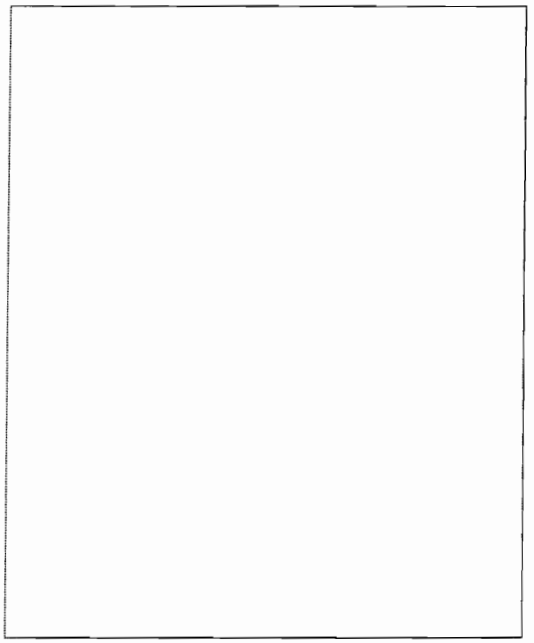

Site Map/plan (include north arrow):

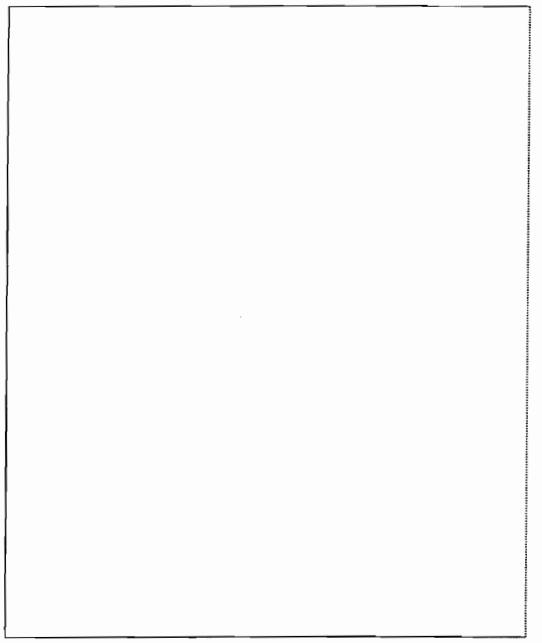

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brick house has a painted façade.. Entrance on side off of brick side porch. Two window bays; openings have segmental arches and stone sills. Basement openings retain single-pane wooden windows, while first floor openings hace replacement one-over-one metal windows. Cornice has stepped end blocks and corbelling. Tall unpainted chimney with chimney pots rises on left side of building.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Irving Cicero C (Jennie A)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	247	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4325 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s)
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
NASH, KATIE			Lynn Josse, Michael Allen, CRO	3/2/2010
4325 GARFIELD AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

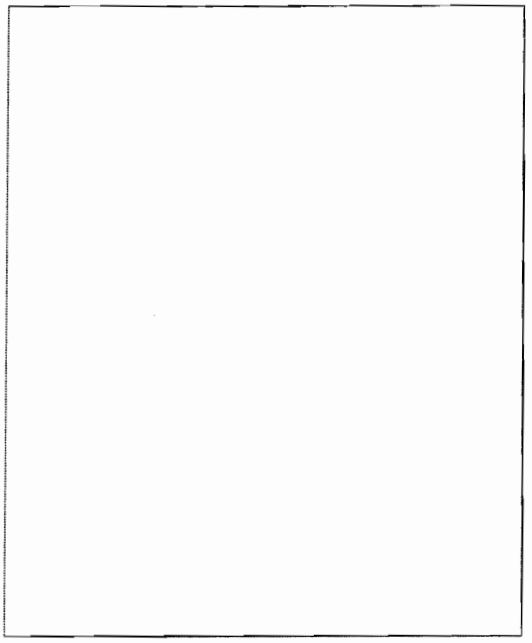

Site Map/plan (include north arrow):

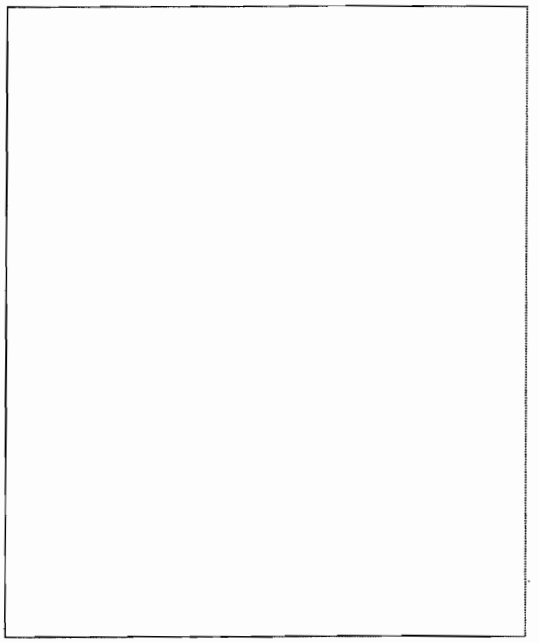

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Wooden cornice with ornate fascia board and dentillation. Concrete stoop with metal rail. Roman arch entrance at right filled with woode around replacement door. Window openings have stone sills, segmental arches and one-over-one vinyl replacement windows.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Reese John H (Mary); 4325a: Cook Jas E (Margt)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4326

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	248	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4326 GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Deck/Full-width	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1887		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Flynn, James C.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
MEEKS, TIMOTHY E			Lynn Josse, Michael Allen, CRO	3/2/2010
4328 GARFIELD AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

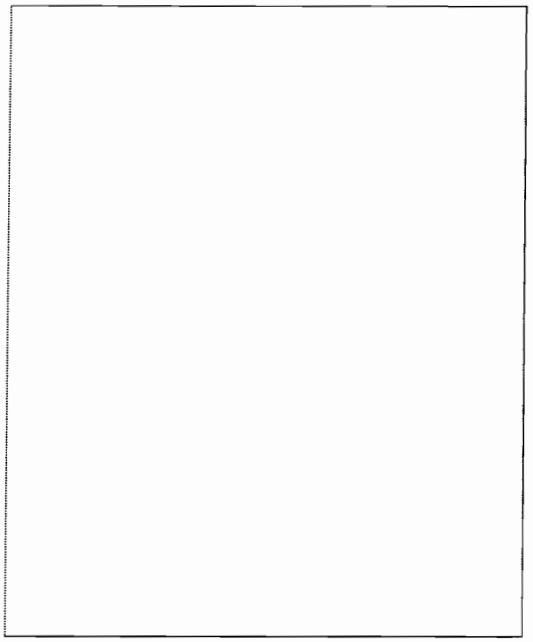

Site Map/plan (include north arrow):

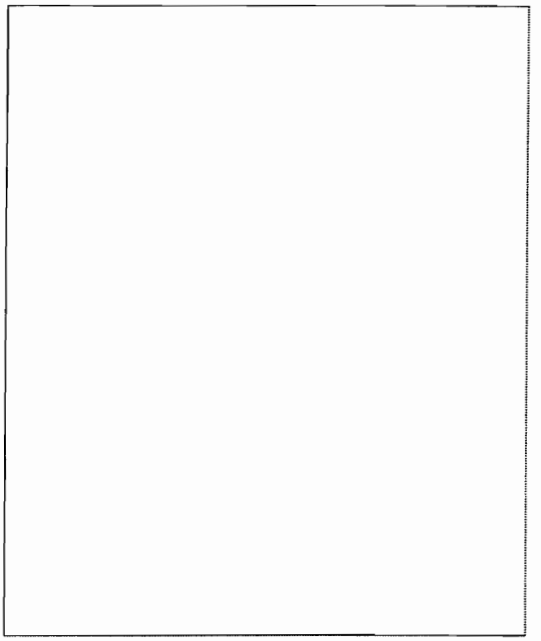

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick front elevation. A wooden deck (roofless) runs across the front elevation with stone steps. A projecting two-story bay set back at the east elevation (added post-1909) is clad in vinyl siding. The first floor entrance (paired replacement doors) and window opening (stone sill, paired vinyl replacement windows with simulated dividers) were reconstructed with flat arches. Second floor window openings retain segmental arches and stone sills, and bear and vinyl replacement windows with simulated dividers. Wooden cornice at top has a decorative fascia, dentil course and projecting crown molding which wraps the sides.

38.(cont.) History::

This house was converted to flats between 1909 and 1927, per Sanborn map and directory.
1930 census:
1920 census: not found
1927 Red-Blue book: Brown, Cordella, Mrs/ unit a: Ward, Wm (ella).

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	249	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4327 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
NASH, KATIE	Lynn Josse, Michael Allen, CRO	3/2/2010
4325 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This brick house has a painted front elevation over a rusticated coursed stone foundation. Flat arched basement openings with wooden windows to right of concrete steps and unpainted buff brick stoop. Recessed entrance retains wooden door. Two window openings have stone sills with consoles, segmental arches and wooden one-over-one windows. Parapet has high end blocks with curved taper; creasing course continuous across parapet and blocks. Corbels support projecting architrave below.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Stanton Geo F. (Alice)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4328

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	250	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4328 GARFIELD AV

5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section: Not Applicable
St. Louis, MO	☒	/	T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1887		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Flynn, James C.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MEEKS, TOM JR & MARY L	Lynn Josse, Michael Allen, CRO	3/2/2010
4328 GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

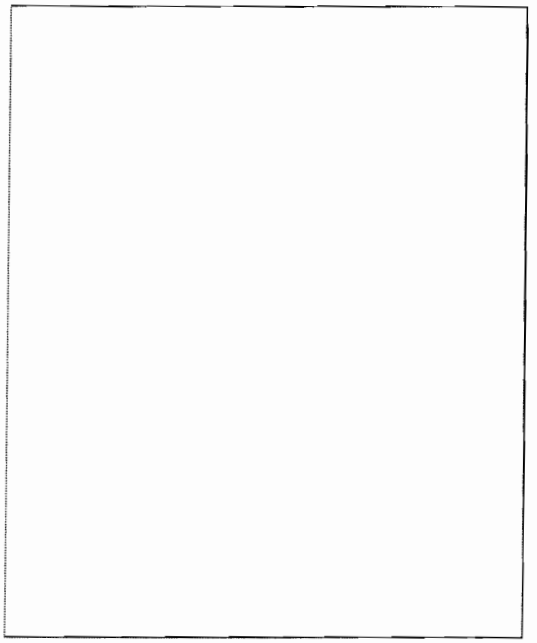

Site Map/plan (include north arrow):

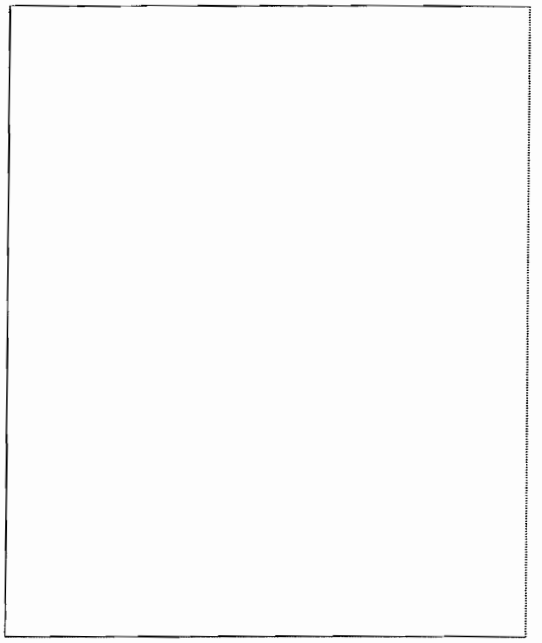

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story gabled concrete masonry unit garage with one frame wall clad in vinyl siding (NC)

28. (cont.) Further description of important architectural features:

This Italianate house is very similar to the one next door at 4326. The brick front elevation is painted. The deteriorated frame shed-roofed porch has stone steps and wooden railing. It appears that the transom area over the front door, left, is bricked in; the door is a replacement. First floor double window (one over one wooden windows) has stone sill and flat arch. Second floor window openings have stone sills, segmental arches and wooden two-over-one windows. Wooden cornice wraps sides and has decorative fascia, dentil course and projecting crown molding.

38.(cont.) History::

1920 census: owned by Rankin family: Christopher, whose occupation is listed as repair work for real estate company; wife Carie (sic) and daughter. (African American) 1927 Red-Blue Book: Lancaster, Preston (Sedalia)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4329

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	251	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4329 GARFIELD AV
E. City/State:	Vicinity: ☐	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
c. 1890		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
		Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TURNER, PETER & JULIA	Lynn Josse, Michael Allen, CRO	3/2/2010
4329 GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

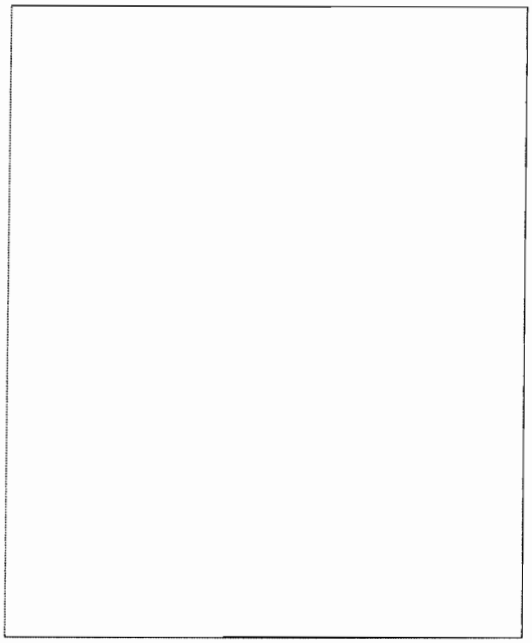

Site Map/plan (include north arrow):

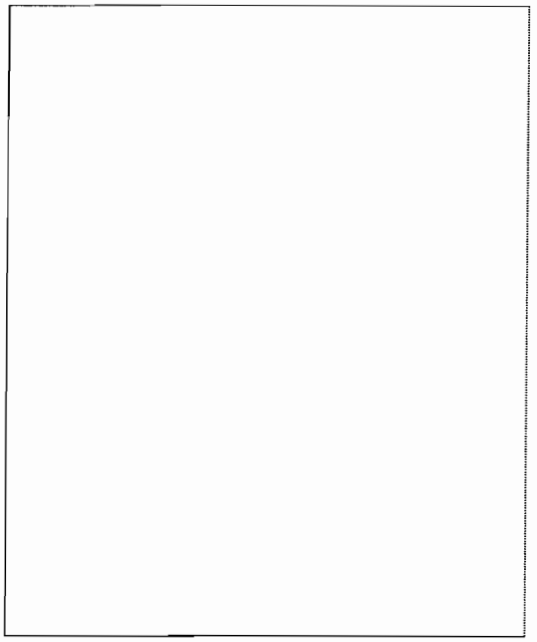

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick. Rubble stone foundation and high basement. Concrete steps to stoop with metal railing. Entrance altered to accommodate flat-arch opening for replacement door. First floor window opening altered to accommodate steel-sash window, but stone sill remains. Basement opening with stone lintel retains wooden one-over-one window. Parapet has double creasing courses and clay tile coping.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	252	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4335 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ARTHUR, CURTIS	Lynn Josse, Michael Allen, CRO	3/2/2010
4335 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

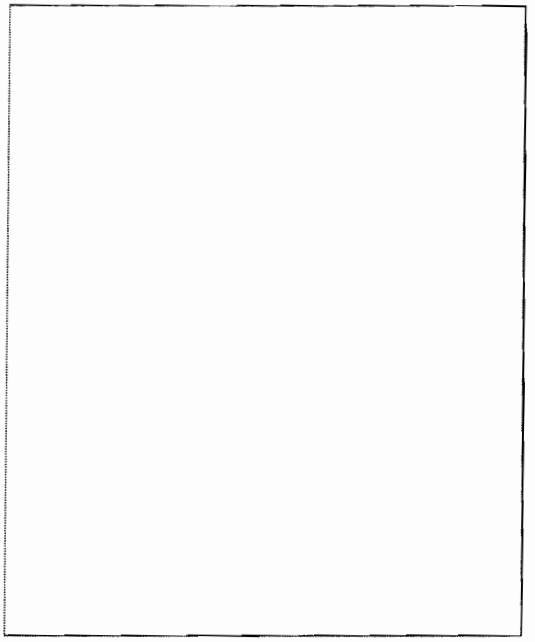

Site Map/plan (include north arrow):

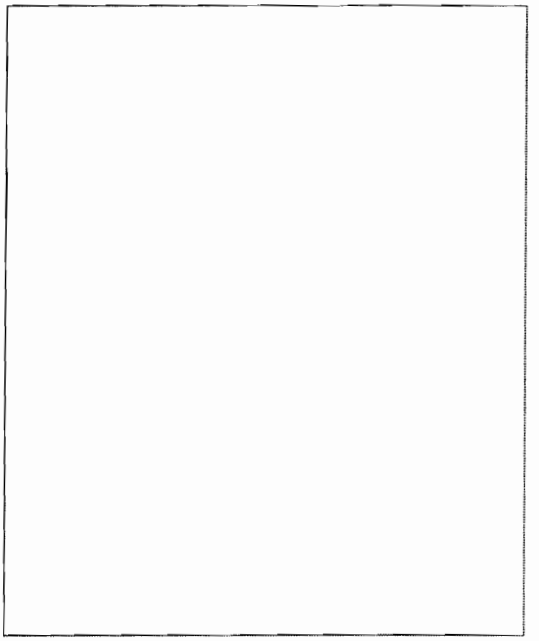

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Concrete porch with metal railings and metal awning roof. All window openings have replacement windows. Entrance at left bay has metal replacement door. There is a window opening centered above the entrance on the second floor and a window bay of centered openings at right. Two brick chimneys at roof ridge are parged. There are wooden vergeboards.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	253	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4336 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☒	
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	1 Garage (Non-Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s)
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by: Deterioration

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1895		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/2/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

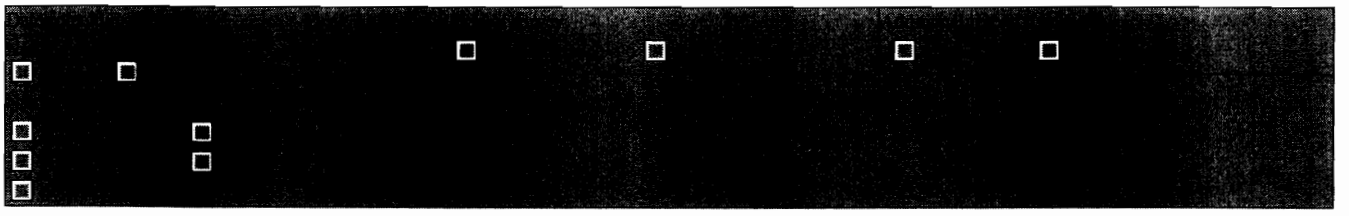

Architectural/Historic Inventory Form

Location Map (include north arrow):

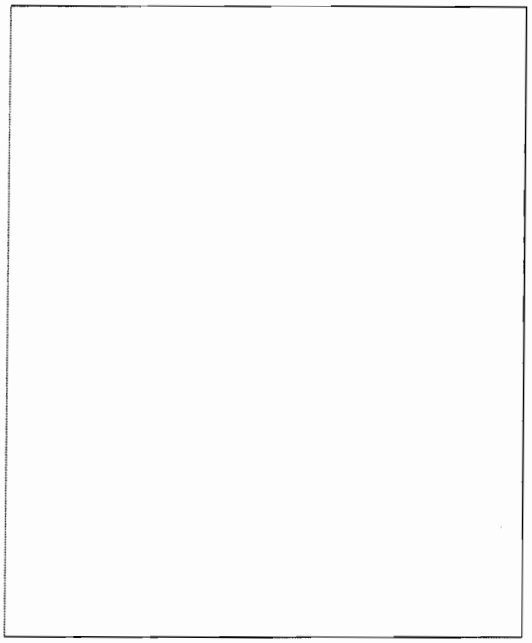

Site Map/plan (include north arrow):

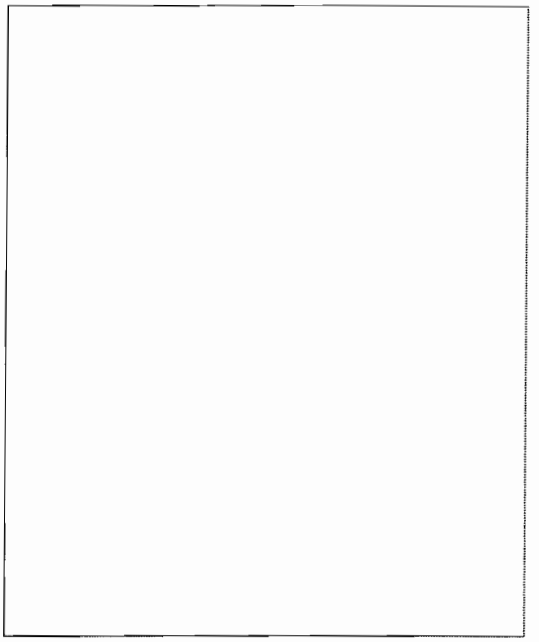

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a collapsing flat-roofed brick garage.

28. (cont.) Further description of important architectural features:

At this brick house's right bay, there is a porch with brick columns and gabled roof (wooden siding in gable end) at grade. Entrance with segmental arch boarded. Window opening with stone sill and segmental archleft, is also boarded. The parapet wall is flat. There is significant masonry deterioration on east elevatiion parapet adjacent to tall parged chimney. This section of the buidling appears to have no roof.

38.(cont.) History::

1920 Census: Rented by Frank and Lila Cooper (?) family, black, with 9 children ranging from 1 month to 19 yrs. The 19-year-old was a laundress for a private family, and the father was a foundry laborer. 1927 Red-Blue Book: Kent, Roger W (Evelyn)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	251	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4338 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Multiple Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) 2-Family Flat		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s)
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
1901		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
	Pipe, W.C.	Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0	Gordon, James.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/2/2010
1015 LOCUST 12TH FL		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

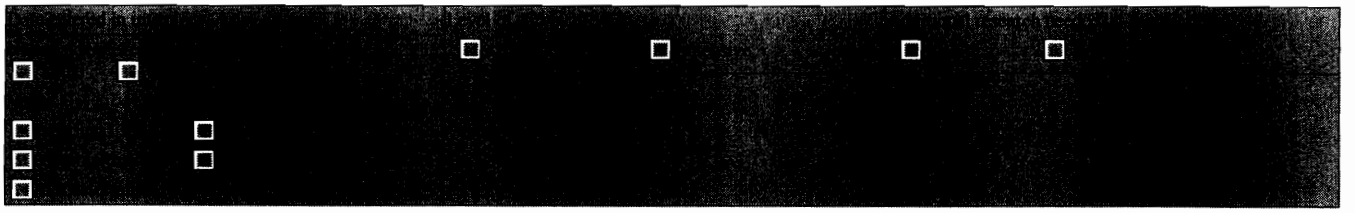

Architectural/Historic Inventory Form

Location Map (include north arrow):

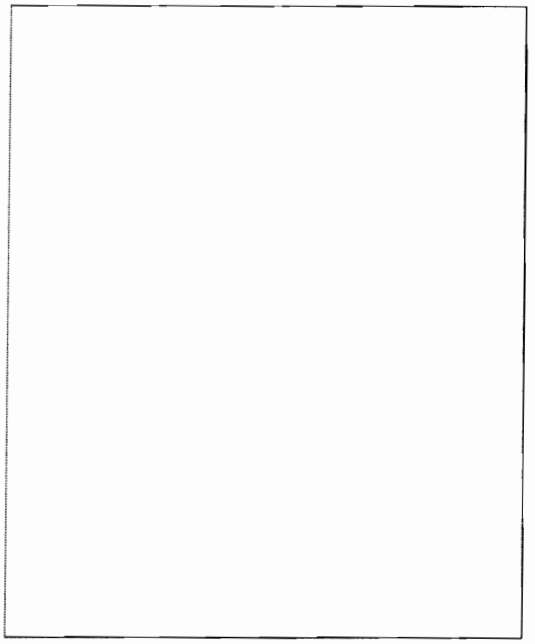

Site Map/plan (include north arrow):

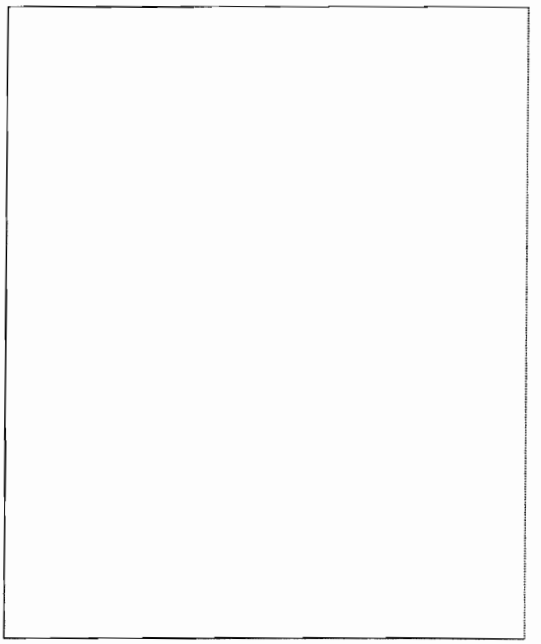

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The façade of this former two-family building is red brick with a brown brick base toped by stone course over basement window. Stone steps. Stone sills on window openings, and flat arches with splayed soldier headers above each opening. Rece3ssed porch reconfigured with plywood around a single door. First floor window opening has paired storms which cover an original 1/1; second floor openings have wooden one-over-one windows. A hipped pent roof (clad in asphalt shingles) with long, low brackets is above the second floor. The parapet has end block; the center stretch retains metal coping.

38.(cont.) History::

1920 census: downstairs: Brown, Leutha???, a black "Tailoress"(?) and her grandmother, renters. A unit: Shook, George and Hattie, black, renters, he's a porter in an office bldg.
1927 Red-Blue Book:Tripp John W (Ella)/ a: Shook Geo (Pattie)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	255	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4340 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Other: Masonite	
15. Number of Stories:	22. Foundation Material:	
1		
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
WHITE, DORIS	Lynn Josse, Michael Allen, CRO	3/2/2010
4338 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

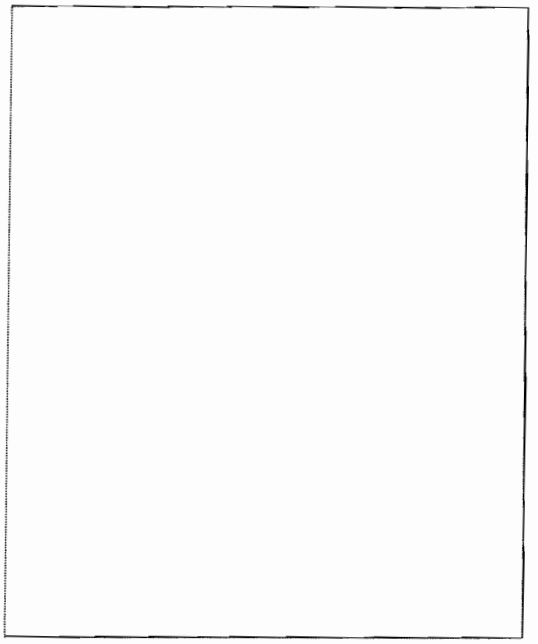

Site Map/plan (include north arrow):

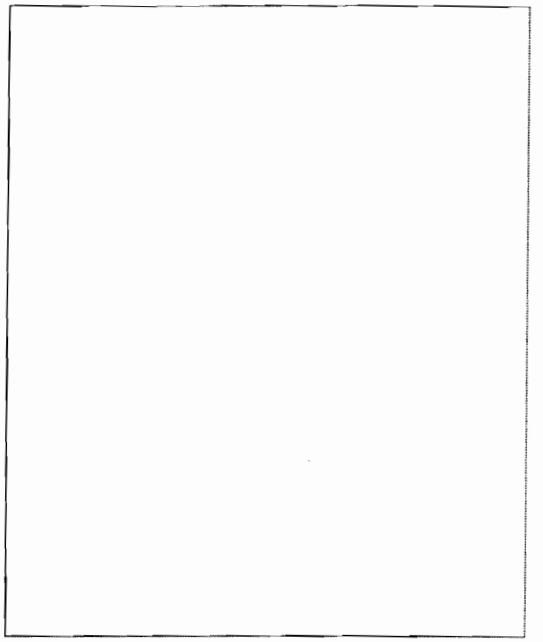

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This single story frame house has a front gabled roof. The full-width concrete porch deck has wooden posts and a metal awning roof. Asbestos tile siding. The front door, right, is new. At the left, a triple window contains wooden one-over-one windows. Wooden vergeboards retain some pickets although many are missing. No basement windows.

38.(cont.) History::

1920 census: Pillow (?) Grant and Evan (?) plus daughter and son. Head of household is a private family's chauffeur. Renters. Black. 1927 Red-Blue book: Merrell, Edw (Georgia)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2546	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4345 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Gabled Ell		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Asphalt	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Cross Gable	side	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hindle, Thomas	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MC DONALD, BERNICE	Lynn Josse, Michael Allen, CRO	3/2/2010
4345 GARFIELD AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

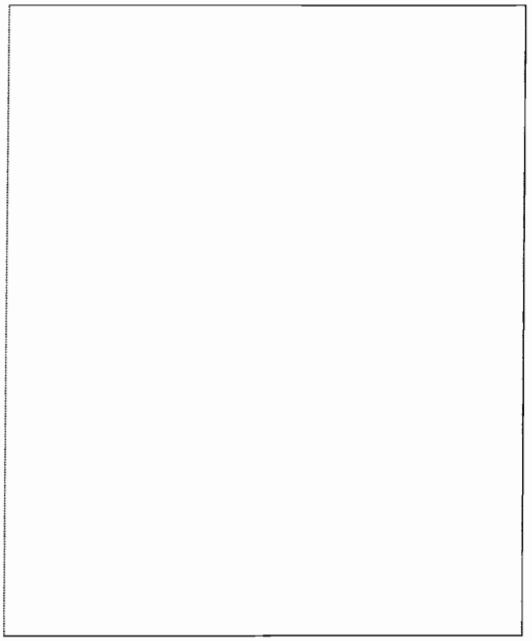

Site Map/plan (include north arrow):

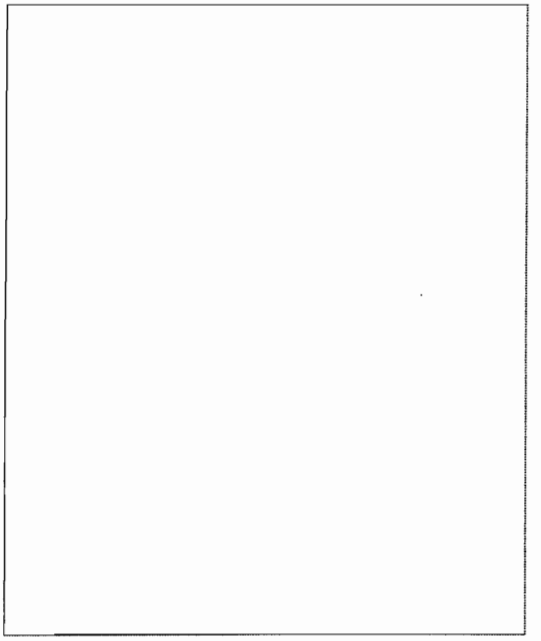

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Asphalt siding. Trapezoidal window bay at first floor contains three window openings (replacement windows); paired windows in opening above (windows replaced). Entrance recessed on side porch, which has metal columns and wooden brackets and screens under shed roof. Entrance retains wooden soor and transom window.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	251	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4349 GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ROBINSON, JOHN VANDALE III	Lynn Josse, Michael Allen, CRO	3/2/2010
1200 LAKESHORE AVE APT 8D		43. Date of revisions:
OAKLAND CA 94606		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

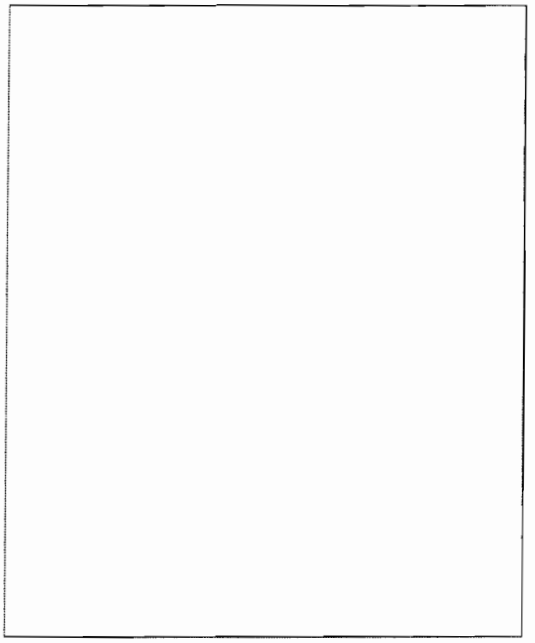

Site Map/plan (include north arrow):

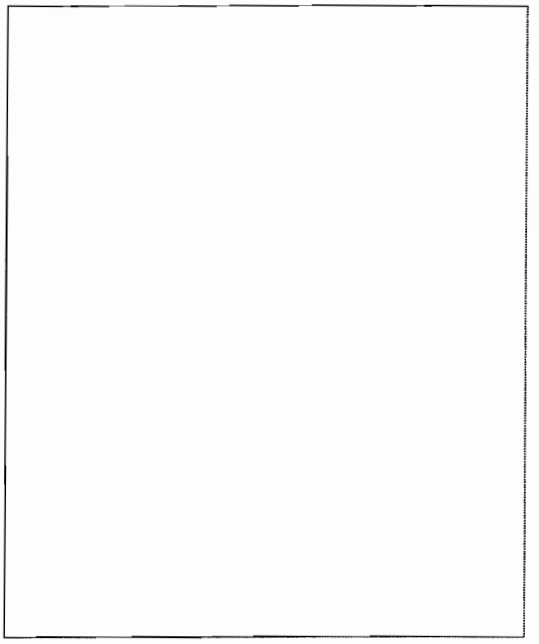

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Red brick, with simple corbelled cornice. Painted, rusticated stone foundation. Basement window openings boarded. Concrete steps to recessed entrance, partly framed in around missing storm door and transom window. First floor window openings have segmental arches, stone sills and two-over-two wooden windows. Second floor has three window openings whose length has been altered; openings have segmental arches, brick rowlock sills and replacement one-over-one windows.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4350
4352

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	258	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4350 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	
7. Township/Range/Section: Not Applicable		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1900		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MCDONALD, BERNICE & JEANETTE WA	Lynn Josse, Michael Allen, CRO	3/2/2010
4350 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

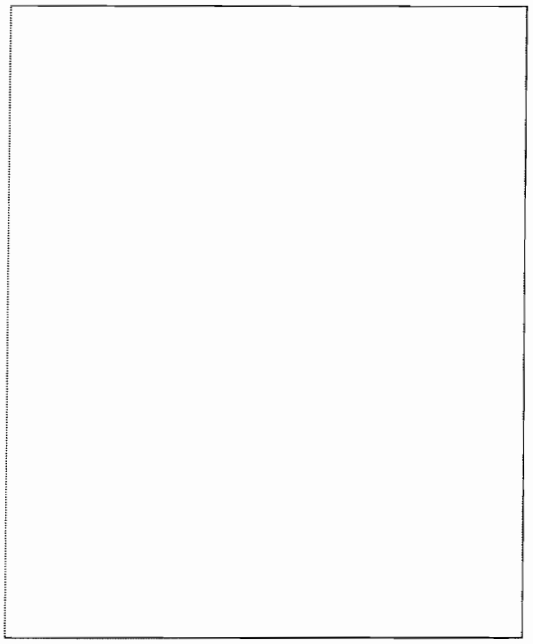

Site Map/plan (include north arrow):

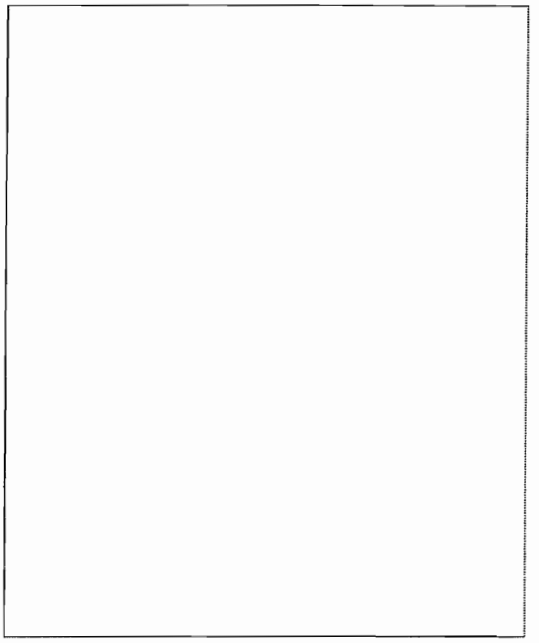

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a gabled concrete garage.

28. (cont.) Further description of important architectural features:

This shotgun house has a painted brick front elevation. There is a concrete stoop with metal rail, left. Gabled hood over entrance with open gable end, open brackets and exposed tapered rafter tails. Entrance has replacement door and transom is sided over. Window opening, right, has brick rowlock sill, segmental arch and replacement window. Corbeled brick cornice.

38.(cont.) History::

1920 census: William T. and Fannie Boykin(s?) own the house and live there with three children and the head's sister. William is a janitor and it appears his sister Wilhemina (??) is a "public reader" at home. 1927: Wilson Geo (Addie) In the 1934 Netgro Business Directory, George Wilson is listed at this address as a plasterer.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4352

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	2501	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4352 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun with additions		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Side	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LEMON, ANDRIEL D	Lynn Josse, Michael Allen, CRO	3/2/2010
4352 GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

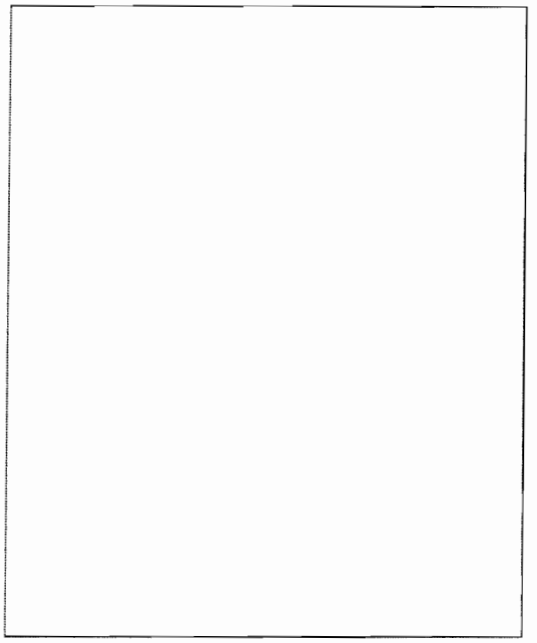

Site Map/plan (include north arrow):

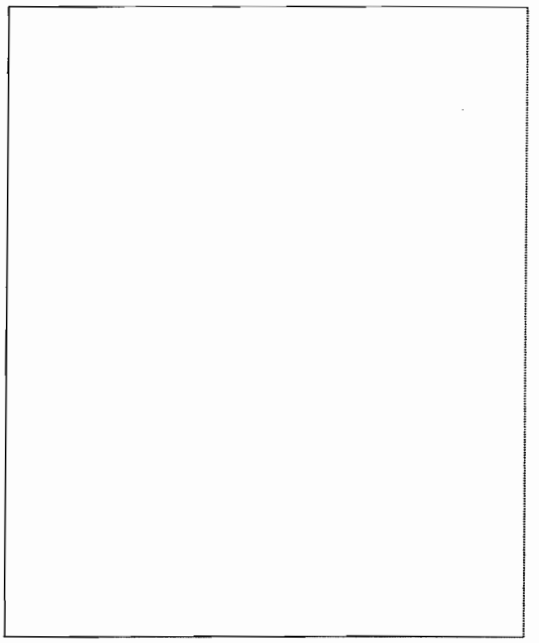

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Map evidence encourages the theory that this house started as a shotgun similar to the one next door to the east, with the c.1925 addition of a rear el and new façade. An entranceat the left bay of the variegated brick facade leads to an open side porch between the front wall and added el. The front elevation is clad in brown tapestry brick with soldier courses at base, label and cornice levels and a rowlock course at the window sill. Parapet forms center pediment with rowlock course as coping, and three buff terra cotta pieces below. Entrance filled with metal security door, and window opening contains double vinyl one-over-one window.

38.(cont.) History::

Front added later. 1920 census: Elizabeth Wear, possibly Weaver, is listed as the head of household along with her husband Theodore. His job appears to be "coal passer" at the waterworks. They are black and they own the house. 1927: Weaver, Willis (Jane) coal

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSI
NO LOITERIN

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	260	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4353 GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full/balcony	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/2/2010
1015 LOCUST ST STE 1200		43. Date of revisions:
ST LOUIS MO 63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Lean-to frame addition on east side is cald in asphalt siding and has shed roof. Brick porch with side entrance has brick piers and knee walls and forms second floor balcony with metal rail. Openings have segmental arches and are all boarded. Wooden cornice at top partially intact.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	261	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4355 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Other	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
LRA			Lynn Josse, Michael Allen, CRO	3/2/2010
330 N 15TH ST				43. Date of revisions:
ST LOUIS	MO	63103		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Badly deteriorated. Masonite siding. Entrance and window opening boarded, but historic wooden door and casement evident. Ornamental vergeboard retains saw-tooth pattern.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

NO TRESPASSING
NO LOITERING

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	2662	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4356 GARFIELD AV		
5. City/State:	Vicinity:	6. UTM:	7. Township/Range/Section:	Not Applicable
St. Louis, MO	☐	/	T: R: S:	
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Public	Domestic		Vacant/Not in Use	
	Sub-use: Single Dwelling		Sub-use:	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Asphalt	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1880		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/2/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

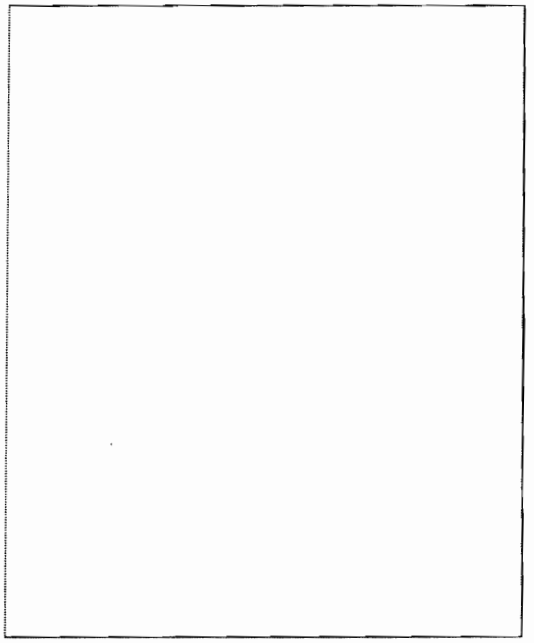

Site Map/plan (include north arrow):

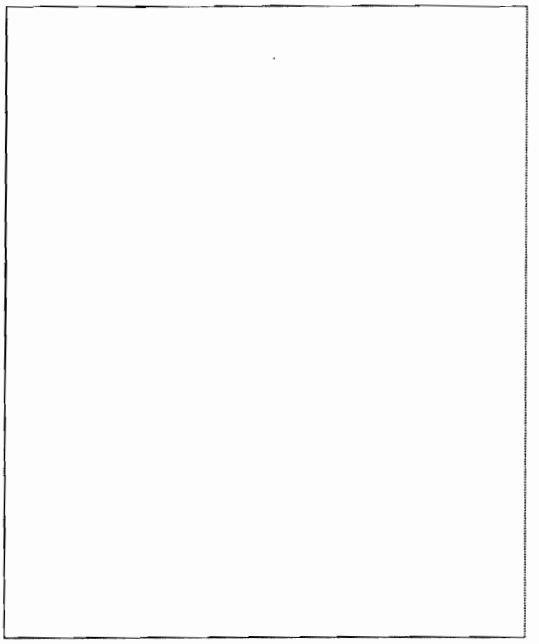

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This front gabled shotgun house is noncontributing due to its asphalt roll siding (imitating brick). The front door, right, is boarded, although the traonsom light is still visible. Vines obscure the right bay's window opening, which appears to be barred. Side openings are boarded. There is no front porch. This is a good example of a frame shotgun house.

38.(cont.) History::

Appears on Hopkins. 1920 Census: rented by the Alex Dawson family (black), wife Elizabeth and three children at home. Dawson is a driver for a laundry. 1927: Allen, Willis (Lottie)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	263	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4359 GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Wood undetermined	
(b) Upright-Wing (Lazy-T Hse)		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Asphalt	
15. Number of Stories:	22. Foundation Material:	
2½	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Low Gable	Full	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1880		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Conway, James	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WHITLOCK, TONYA L			Lynn Josse, Michael Allen, CRO	3/2/2010
5960 EMMA AVE				43. Date of revisions:
ST LOUIS	MO	63136		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

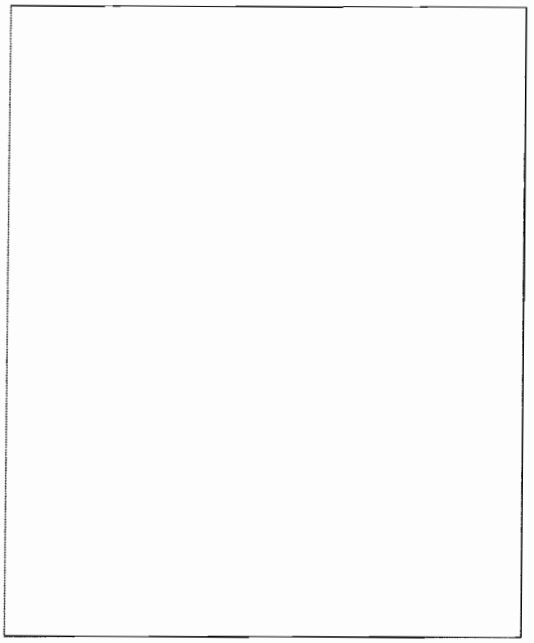

Site Map/plan (include north arrow):

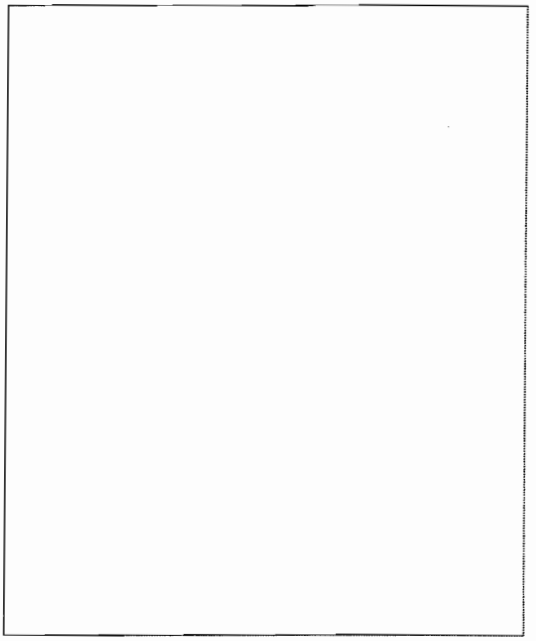

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

The roof of the front volume of the house is side-gabled with two hipped-roof dormers on the front side. The dormers have openings containing windows with center panes and multi-light borders. There is a shed-roof porch (asphalt rolled roofing) with wooden columns. Asphalt siding. Replacement front door and windows. There is also a single story rear wing which may predate the front of the house.

38.(cont.) History::

Although a building certificate dates the house to 1885, a frame house exists on this lot on the 1883 Hopkins map (but not on the Compton & Dry view published in 1876)

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:		
SLCAS036	204	Architectural Survey of The Ville		
3. County:		4. Address:		
St. Louis [Independent City]		4363 GARFIELD AV		
E. City/State:	Vicinity:	6. UTM:		7. Township/Range/Section: Not Applicable
St. Louis, MO	■	/		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):		
10. Ownership:	11. Historic Use (if known):		11. Present Use:	
Private	Domestic		Domestic	
	Sub-use: Single Dwelling		Sub-use: Single Dwelling	

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1½	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Medium Gable	open Porch	■ Moved Date(s)
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
c. 1925		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
WEST, ELMER & ALBERT WEST			Lynn Josse, Michael Allen, CRO	3/2/2010
4363 GARFIELD				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐

☐ ☐

☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

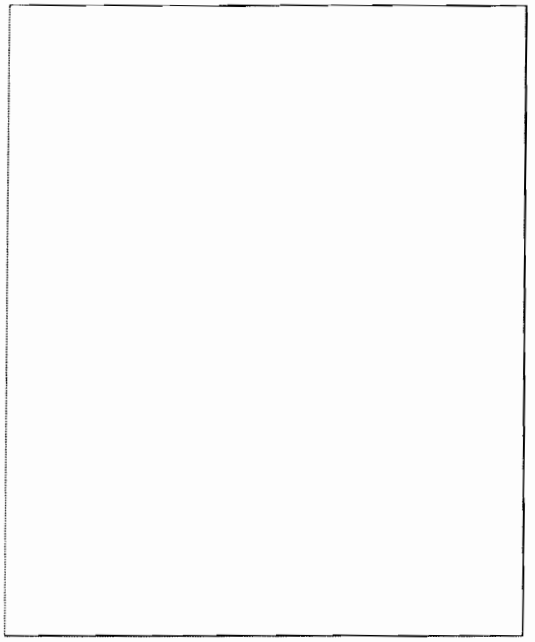

Site Map/plan (include north arrow):

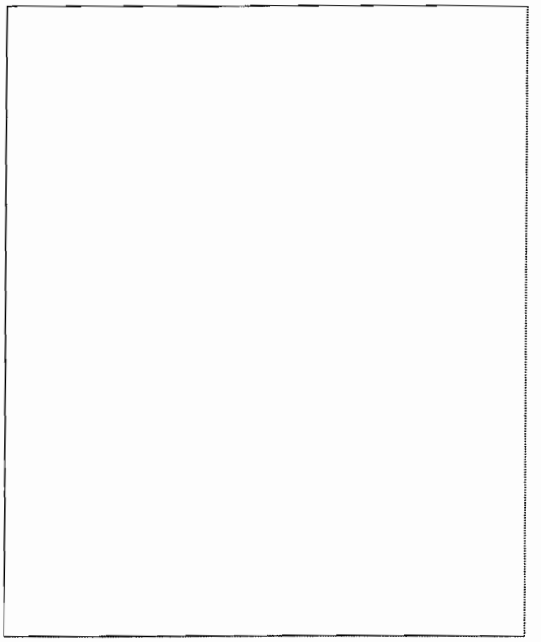

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Tapestry brick. Concrete block porch with wooden railings, concrete steps and wooden front-gabled roof. Masonite siding in porch gable end. Flat-arched entrance with replacement door. Window openings have soldier course headings on flat aches and rowlock sills. Basement opening boarded and first floor opening contains triple replacement window. Gable end is clad in timbered stucco, all painted white. Paired window openings in gable end have replacement windows.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2605	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4364 GARFIELD AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Wood undetermined	
(b) Gabled Ell (with front hip instead)		
14. Plan Shape:	21. Ext. wall cladding:	
Irregular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	■ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	■ Altered Date(s):
Hipped, Cross Gable	Open Porch	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	■ Other Date(s):
Asphalt	Visible from public road? ■	Endangered by:

28. Further description of building features and associated resources on continuation page. ■

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1879		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0	Boeppler, Sophie E.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ■

39. Sources of information on continuation page. ■

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
MIDDLEWEST PROPERTIES INC	Lynn Josse, Michael Allen, CRO	3/2/2010
4364 GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

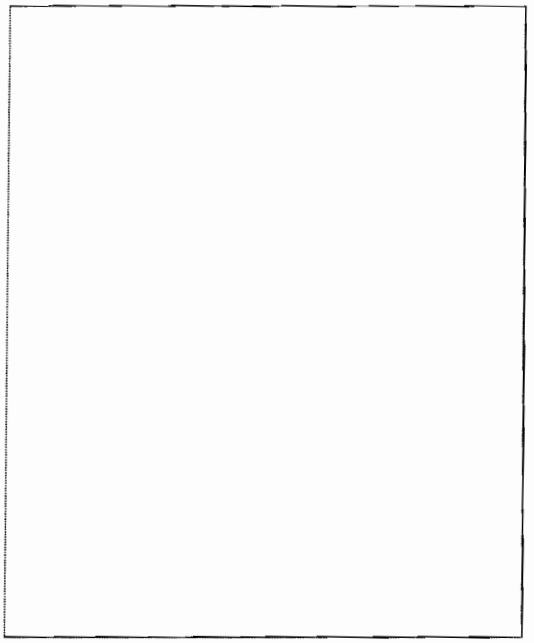

Site Map/plan (include north arrow):

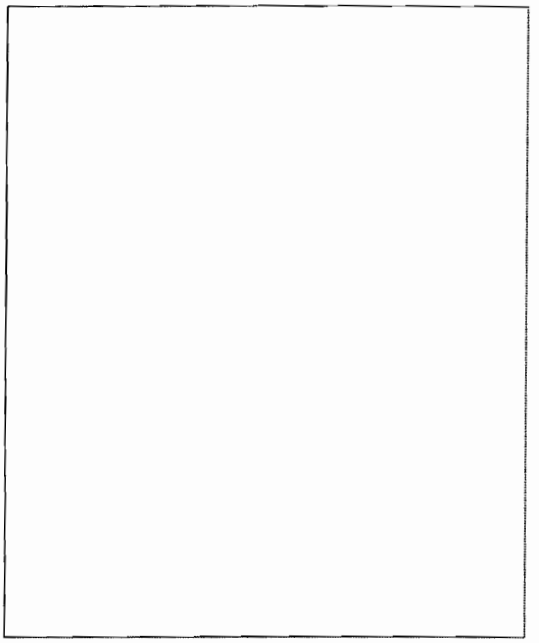

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story frame house's rusticated stone foundation is painted. The corner porch, located at the left in the elbow between front and side wings, has shed roof and wooden columns, cornice and balustrade. Entrance is boarded. At the forward wing, right, the two first floor openings have wooden two-over-two windows and second floor openings have wooden three-over-one windows. Wooden eaves are clad in metal panels that are partially missing. The vinyl siding is relatively compatible.

38.(cont.) History::

1920 census: Head: Alfred Moore (looks like Moon), drugstore porterp; sister Dora public school teacher; brother Oscar is a shipping dept. clerk; mother Mary Riddle no job. Black family; owns house. 1927: Moore Alfred R.

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2606	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4210 W GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, both	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Walk-Up (four family)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1925		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Reilley, R. P.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Floun, Pearl	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
COLLINS, ROBERT & LUELLA			Lynn Josse, Michael Allen, CRO	3/1/2010
4522 RED BUD AV				43. Date of revisions:
ST LOUIS	MO	63115		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Clad in variegated brown brick. High basement with entrance at grade. Symmetrical front elevation. Stone surround at entrance conncets to first floor sill course. Entrance has center door and sidelights, with a wooden one-over-one window in the opening centered above. Side bays have triple windows with center six over one windows flanked by two over one windows. Soldier course headers on openings, with stone end blocks on the stairwell window at center. Flase side-gabled roof overhangs and has intersecting center gable with timbered gable end.

38.(cont.) History::

1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4217 N

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	267	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4217 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Italianate	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Welch, Cornelia A.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
CLARK, ESSIE M	Lynn Josse, Michael Allen, CRO	3/1/2010
4217 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

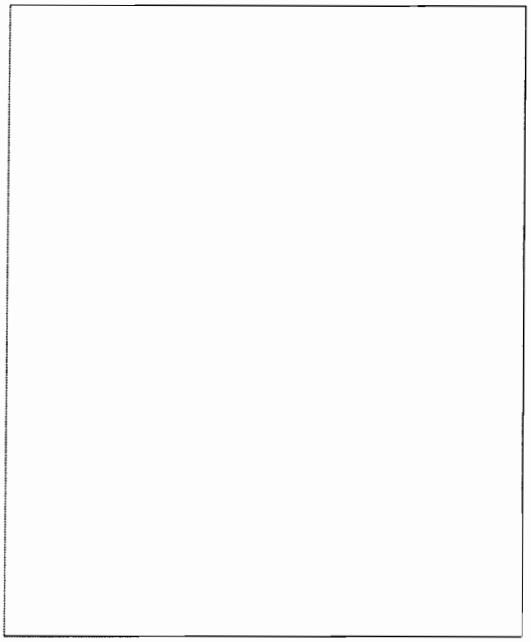

Site Map/plan (include north arrow):

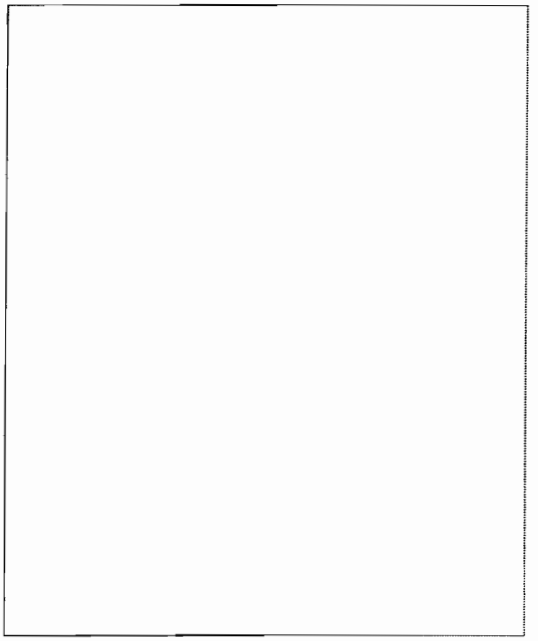

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Roman arch over recessed entrance squared off through brick infill. Wooden door in entrance. Window bays to right have stone sills and contain wooden one-over-one windows behind aluminum storm windows. Bracketed wooden cornice above with intact fascia under a shingle-clad false mansard between brick parapets.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4221

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	Z108	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4221 W GARFIELD AV
5. City/State:	Vicinity: ☐	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1884		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance	34. Original or significant owner:	Nomination: ☒ district
0	Rutherford, Mary M.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HUNT, MARTHA	Lynn Josse, Michael Allen, CRO	3/1/2010
4246 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

Cut stone front retaining wall is from historic period.

28. (cont.) Further description of important architectural features:

Painted brick single story building. Parapet (a historic alteration) has center step and is clad in coping tiles. Recessed entrance at left with door opening behind metal security grill. To the right are two window openings with stone sills and replacement windows. All three openings have segmental arches under metal awning.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4225.W
NO LOITERING

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2609	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4225 W GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/1/2010
1015 LOCUST ST SUITE 1200		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick two-bay single story house. Corbelling under metal cornice between brick end blocks. Raised basement with entrance at left and solider-course segmental arch window opening at right; both openings boarded. Evidence of removed porch under soldier-course Roman arch first floor entrance; arch is partly boarded and door opening inside boarded. Wide, boarded window opening at right has stone sill and evidence of bricking in a former arch.

38.(cont.) History::

1920 census: extended family, renters, Mu, looks like 2 foundry workers (illegible)
1927 Red-Blue Book: Hall Jos (Bertha)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	270	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4226 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Wood undetermined	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Open porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hucks, Edw W.	
0		37. National Register eligible?
		Contributing - D/C

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ALLEN, JEROME R	Lynn Josse, Michael Allen, CRO	3/1/2010
4228 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

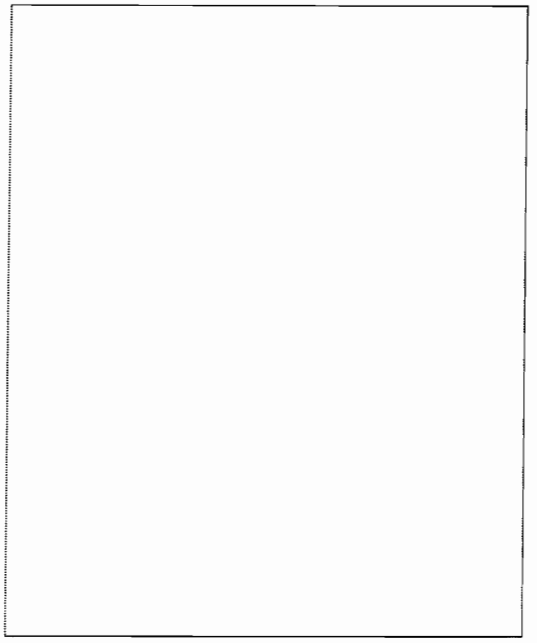

Site Map/plan (include north arrow):

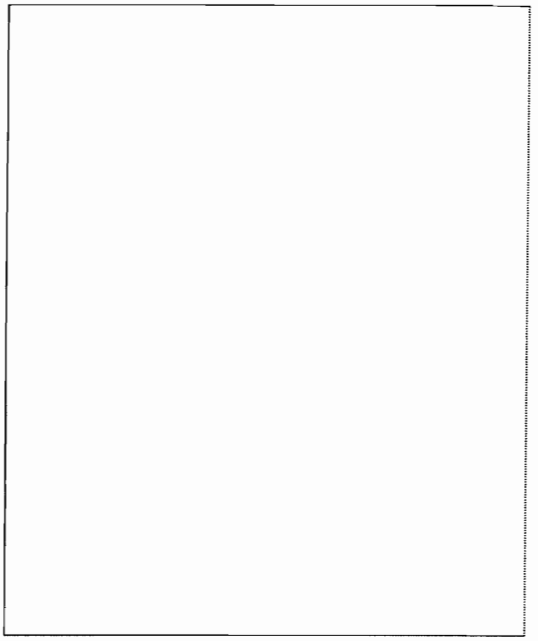

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Vinyl siding. Wooden steps to concrete block porch, which has wooden columns supporting a gabled roof (vinyl siding in gable end). Entrance has original wooden casement and transom window but replacement door. Window on front elevation is replacement vinyl one-over-one window, as are all other windows on the house.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	271	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4227 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Recessed 1-story and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BURNEY, FLOYD	Lynn Josse, Michael Allen, CRO	3/1/2010
3909 KOSSUTH		43. Date of revisions:
ST LOUIS MO 63107		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

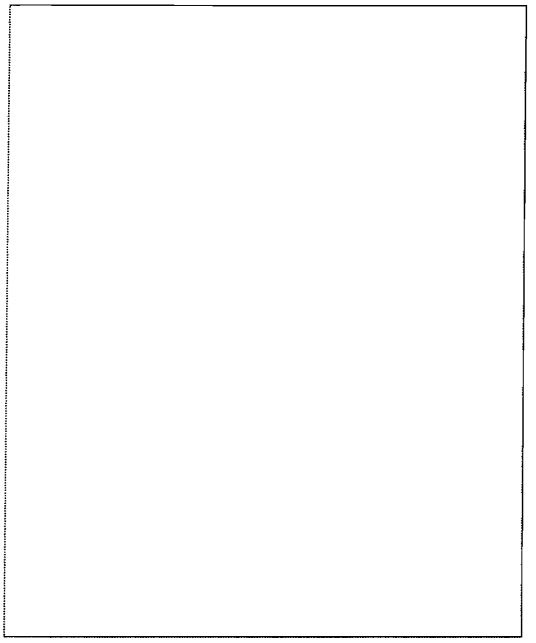

Site Map/plan (include north arrow):

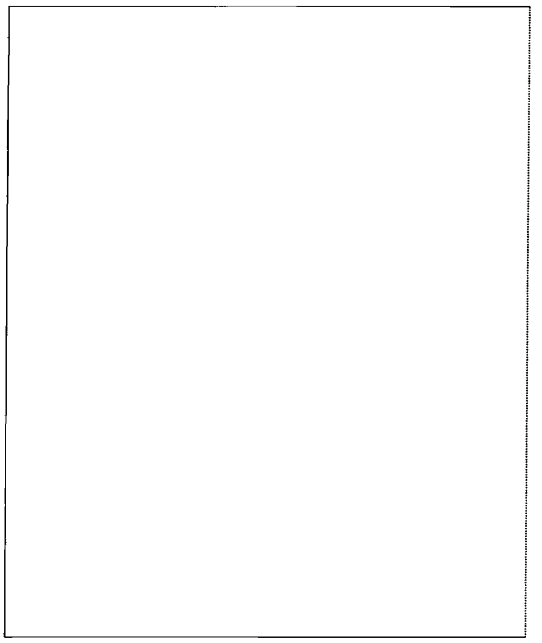

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Segmental arches on openings. Basement opening retains wooden mullion and carved eyebrow; glass block in place of sash. Concrete steps lead to recessed entrance with replacement door. Bracketed, open gabled shelter over opening. Window opening has stone sill, double one-over-one wooden windows. Brick corbelling under metal cornice. Parapets rise unevenly at each end, suggesting that a false mansard may have once topped the front elevation.

38.(cont.) History::

1920 census: Ray, David, Adele, daughter, owners, Black, foundry laborer
1927 Red-Blue Book: Ray Adele Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	272	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4228 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late 19th & 20th c. Revivals	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch in front of recessed porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1901	Douglass, J. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hammonds & Douglass	36. On National Register? ☒ individual
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hicks, E. W.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
ALLEN, JEROME R			Lynn Josse, Michael Allen, CRO	3/1/2010
4228 GARFIELD				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Concrete block stoop with metal columns, rails and awning. Stone lintels over window openings. Stone sill course continuous across first floor. First floor window replaced. Roman arch opening with patterned label course leads to recessed entrance; wooded siding surrounds door opening with wooden replacement door. Dentillated wooden cornice under projecting wooden eave and metal gutter pan. False sloped roof above rises above parapets and is clad in asphalt shingles.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Boswell Kath Mrs. And a) Hayward Terry (Bessie)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ESPASSING
OITERING

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	273	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4229 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Public	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1		
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Side	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Gaffey, Marg.	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
LRA	Lynn Josse, Michael Allen, CRO	3/1/2010
1015 LOCUST ST		43. Date of revisions:
ST LOUIS MO 63101		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

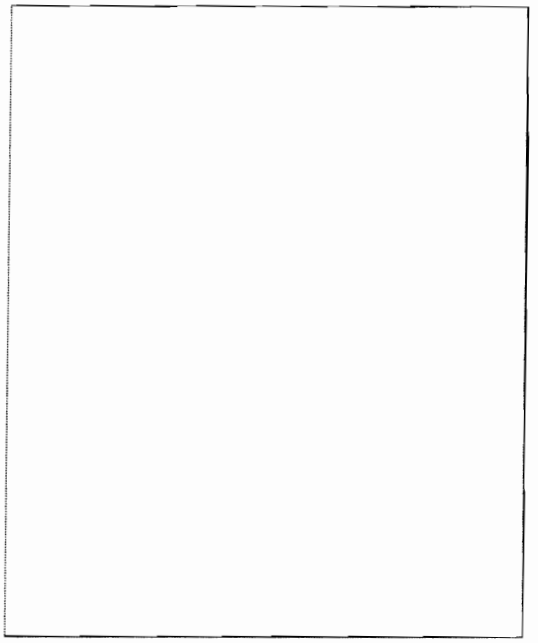

Site Map/plan (include north arrow):

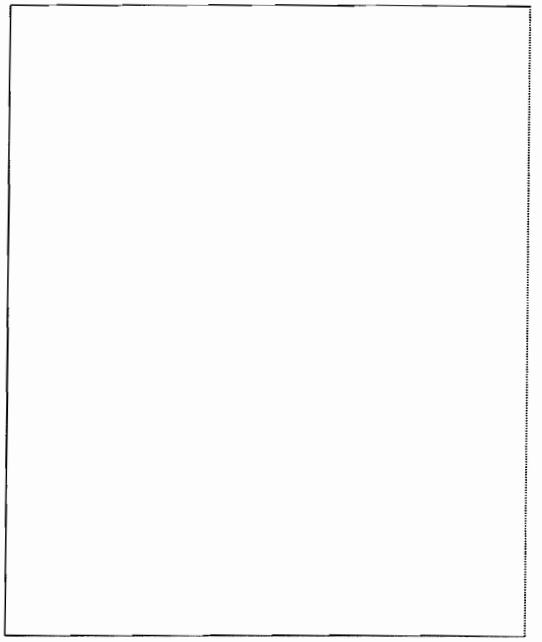

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Wooden vergeboards remain. Two windows in openings on front elevation are wooden two-over-two windows. Entrance (boarded) is recessed at right on street-facing side of shed-roofed addition. Concrete steps to entrance.

38.(cont.) History::

1920 census: Hiara(?), Hugh and Mary, white owners, he's a general laborer of Irish parentage
1927 Red-Blue Book: Frierson Wm (Malinda sic)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4231

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	274	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4231 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Straddle Ridge	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Side	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Gaffey, Marg.	
0		37. National Register eligible?
		Non-Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
STEWART, ROSE & JEROME ALLEN	Lynn Josse, Michael Allen, CRO	3/1/2010
4228 W GARFIELD AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Vinyl siding, replacement windows, parged foundation. Entrance on side porch with shed roof.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4232W

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	275	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4232-4 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	■	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Multiple Dwelling	Sub-use: Multiple Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Modern Movements	Undetermined	
(b) Duplex(Double House)		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
4	Full	■ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	■ Altered Date(s):
Gable Hip or Gablet	Stoop	■ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ■	■ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ■		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ■
1963		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Kirkland, P. L.	36. On National Register? ■ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ■ district
0		
0		37. National Register eligible?
		Less than 50 Years
38. History and significance on continuation page. ■		
39. Sources of information on continuation page. ■		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
KIRKLAND, FINIS T & GWENDOLYN CO	Lynn Josse, Michael Allen, CRO	3/1/2010
902 IRON		43. Date of revisions:
ST LOUIS MO 63111		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:
Buff brick with limestone sills. Concrete steps and stoops lead to entrances on each side; metal doors. Aluminum framed windows in window openings above openings for air conditioning units.

38.(cont.) History::
permit has 3 Rhetta family members as 1963 owner; Daily Record says Kirkland, GK.

38. (cont.) Significance

39. Sources of information:
Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4235

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2760	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4235 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	1 Garage (Contributing)
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: shaped parapet 1-story		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1892		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Lastofka, Jno. M.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BLAINE, GLADYS C	Lynn Josse, Michael Allen, CRO	3/1/2010
4235 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

There is a one-story flat-roofed brick garage. There is no vehicle door on the alley face. Buff brick retaining wall at sidewalk.

28. (cont.) Further description of important architectural features:

The foundation is painted. Concrete block porch with concrete steps at east side and metal railings. Red brick walls, with segmental arches over openings. Entrance is recessed with replacement door. Window opening has stone sill and souble replacement window; brickmold is wrapped in metal. Tiers of decorative courses form a cornice that runs between two stepped end blocks. Parapet above has side and center blocks and is topped by clay coping tiles.

38.(cont.) History::

1920 census: Jones Peter and Madeline and 11yr-old stepdaughter, Mu, owners, looks like he's a chemist for a medecine co.
1927 Red-Blue Book:Jones Peter W (Madeline sic)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4237

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	277	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4237 W GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: /
St. Louis, MO		7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Imitation stone veneer	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1901	Douglass, J. J.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hammonds & Douglass	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Becktold, Sarah	
0		37. National Register eligible?
		Non-Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BLAINE, GLADYS C	Lynn Josse, Michael Allen, CRO	3/1/2010
4237 W GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Front wall and base of porch clad in simulated stone masonry. Concrete steps. Replacement door and original single-pane transom window in entrance; small window opening to left boarded. Window opening at right boarded. Double basement window opening below retains wooden windows and center mullion.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	278	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4242 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Second Empire Mansard	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Stone	
15. Number of Stories:	22. Foundation Material:	
1	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
1890		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
Architecture		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BROOKS, WILLIE L & ANN L	Lynn Josse, Michael Allen, CRO	3/1/2010
4242 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

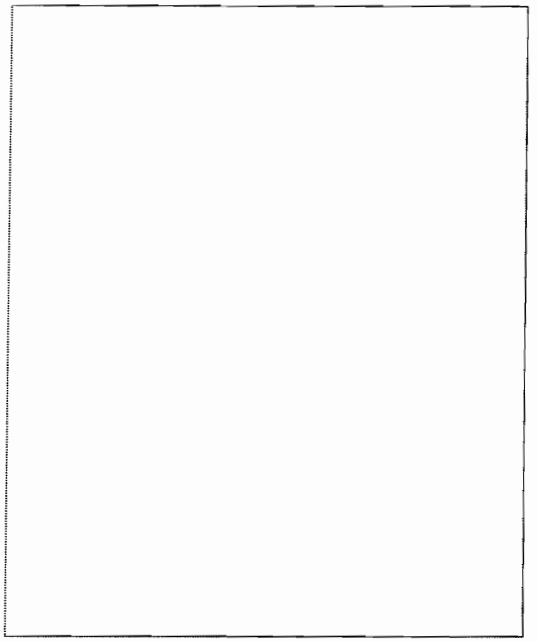

Site Map/plan (include north arrow):

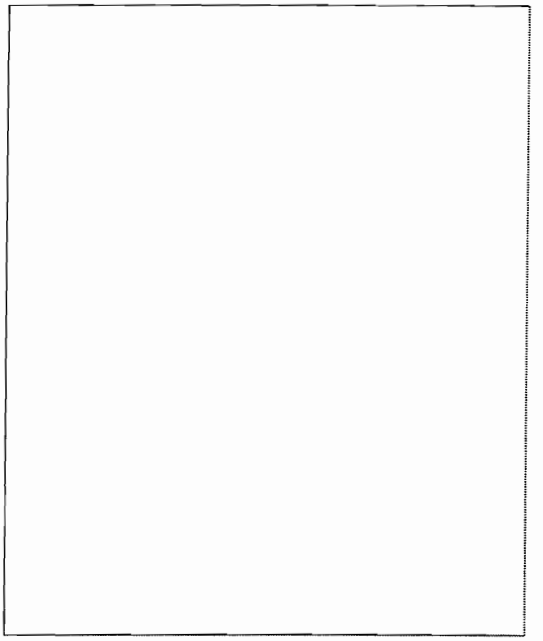

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

One-story on raised basement with painted stone front. Small false mansard with slate shingles and crown molding over bracketed cornice with dentils. There are stone sills with consoles, a concrete stoop with wrought iron rails and a door with transom and sidelight. Metal awnings over openings. Basement entrance under steps.

38.(cont.) History::

1920 census:Walter and Mary Tonkins, black, owners with mortgage, he is a Pullman porter and she is a Janitoress at the Post Office.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4243
W 4243

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	279	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4243 W GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S.
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Single dw: one-story narrow front		
14. Plan Shape:	21. Ext. wall cladding:	
L-shape	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Side	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1914		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Scharff, Gertrude	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Scharff, Gertrude	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BLANDIN, ALBERT	Lynn Josse, Michael Allen, CRO	3/1/2010
4243 WEST GARFIELD AVE		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Entrance (boarded) off of wooden side porch in ell, which is missing its steps. Face of house features two one-over-ove wooden windows in brick-silled openings centered over a single basement window opening which retains wooden brickmold. Steped corbels under plain brick cornice. Clay coping tiles on top of parapets.

38.(cont.) History::

1920 census: Murphy, Charles and Beattrice (sic), Mu renters, he is a post office clerk
1927 Red-Blue Book:Schafer Emma Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4245

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	280	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4245 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1905		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Herr, Geo.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Marginus, Chas.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
BUTLER, CORNELIA			Lynn Josse, Michael Allen, CRO	3/1/2010
4245 GARFIELD AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

[redacted]

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted. Flat-roofed porch has brick columns and knee walls. Openings have flat arches. Entrance has replacement door. Window openings carry replacement vinyl one-over-one windows. Parapet unarticulated.

38.(cont.) History::

Permit#E2944 3-11-1905 2-story brick dwelling, $3,500. Owner: Chas. Marginus; Architect: Geo Herr Permit#B7867 3-11-1905 1-story frame shed, $50. Owner: Chas. Marginus; Architect: Geo Herr
1920 census: both households rent: Toney, S, B female, visiting nurse, and Spring(?), Martha and 4 children, Mu, packer and a laundress
1927 Red-Blue Book: Washington Martha Mrs.; 4245Wa: Getter Corinne Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	281	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4246 W GARFIELD AV
5. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Second Empire Mansard	Load-bearing Brick	
(b) One-story with raised basement		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Painted Stone	
15. Number of Stories:	22. Foundation Material:	
1	Limestone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☐ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☐ Altered Date(s):
Flat	stoop and awning	☐ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☐	☐ Other Date(s): Endangered by:

28. Further description of building features and associated resources on continuation page. ☐

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☐
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☐ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☐ district
Architecture		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☐

39. Sources of information on continuation page. ☐

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HUNT, MARTHA	Lynn Josse, Michael Allen, CRO	3/1/2010
4246 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

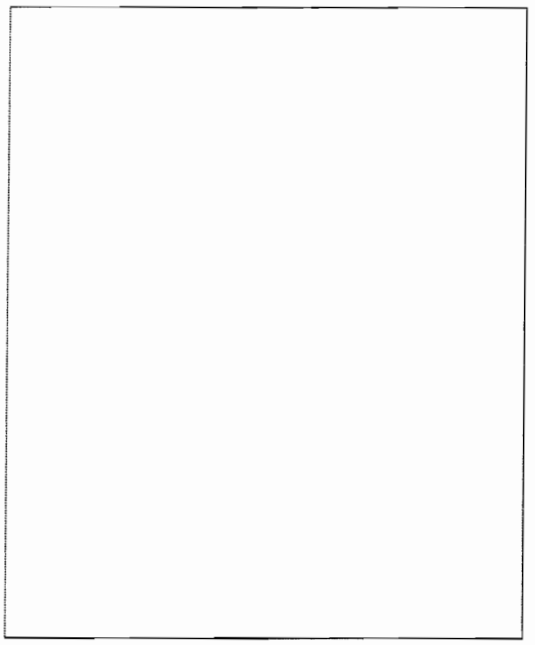

Site Map/plan (include north arrow):

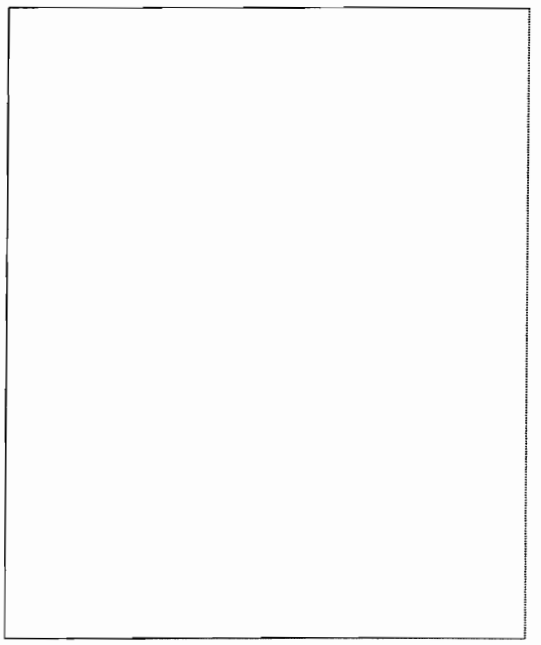

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

One-story on raised basement with painted stone front. Small false mansard; bracketed cornice w/ dentils; stone sills w/ consoles; concrete stoop w/ wrought iron rails; door w/ transom and sidelight; metal awnings over openings. Entrance to basement inder porch.

38.(cont.) History::

1920 census: Walter Ralph (owner/no mortgage) and his sisters Anna and Helena and brother Charles. Ralph is a porter in an office bldg, Helena a laundress and Charles a teamster at Express Co.
1927 Red-Blue Book:
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

ST. MATTHEWS
Outreach Ministry
ORDER OF SERVICE
Sunday School - 10:00
Morning Worship - 11:00
Wed. Bible Study - 7:30

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	282	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4249-55 W GARFIELD AV
E. City/State	Vicinity:	6. UTM: /
St. Louis, MO	☐	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known): St. Matthew's Outreach Ministry

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Religion	Religion
	Sub-use: Religious Facility	Sub-use: Religious Facility

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Wood undetermined	
(b) Gabled End Church		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Vinyl	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
3	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Smith, Fannie A.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
ST MATTHEW OUTREACH MINISTRY	Lynn Josse, Michael Allen, CRO	3/1/2010
4249 W GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Window openings are filled with glass block but retain lancet arches. The projecting front vestibule has a center lancet-arched entrance containing double doors, with two small window openings high on the wall to each side. Concrete steps and stoop with metail railings. Rectangular louvered vent above entrance, and louvered vent at top of gable end on the sanctuary.

38.(cont.) History::

This was still a dwelling on the 1909 Sanborn map.
1920 census: at least partially a residence: George and Lucy Benton; he's a minister, and the R/O field is something other than R or O.
1927 Red-Blue Book:Church of God. 4249a vacant
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No		2. Survey Name:
SLCAS036	283	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4257 W GARFIELD AV
5. City/State:	Vicinity: ☒	6. UTM: / 7. Township/Range/Section: Not Applicable
St. Louis, MO		T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒ Survey Name:
c. 1885		St. Louis African-American History Sites
30. Significant date/period:	33. Builder:	36. On National Register? ☒ individual.
		Nomination: ☒ district
31. Area(s) of significance:	34. Original or significant owner:	
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
KEY, DORIS	Lynn Josse, Michael Allen, CRO	3/1/2010
4261 W GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

This two-story two-bay house has a painted brick façade. Concrete porch at right with metal columns supporting hipped roof that is clad in asphalt shingles. Flat arches on basement and first floor openings, and segmental arches on second floor. Entrance has wooden door and transom window in casement, and window openings have wooden two-over-two windows. Basement opening covered with hinged wooden door. Parapet steops up slightly at center and lacks coping; this is likely a historic alteration.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Gearin Wm (Lavina) at 4257
1930 census:
1943 Negro Directory: 4257 W Garfield: Elsie Ivearn Gearin, Turner School, and Mae Gearin, Banneker School

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4264

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	284	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4264 W GARFIELD AV
E. City/State	Vicinity:	6. UTM: /	7. Township/Range/Section: Not Applicable T: R: S:
St. Louis, MO	☒	
8. Historic Name (if known):		9. Present Name (if known):
10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Late Victorian	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Parged stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2		☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	Open Porch	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
c. 1890		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:			41. Form prepared by (name and organization):	42. Survey date:
STEVENS, SYLVESTER & LYVELL LYES			Lynn Josse, Michael Allen, CRO	3/1/2010
4264 W GARFIELD AV				43. Date of revisions:
ST LOUIS	MO	63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐ ☐
☒

Architectural/Historic Inventory Form

Location Map (include north arrow):

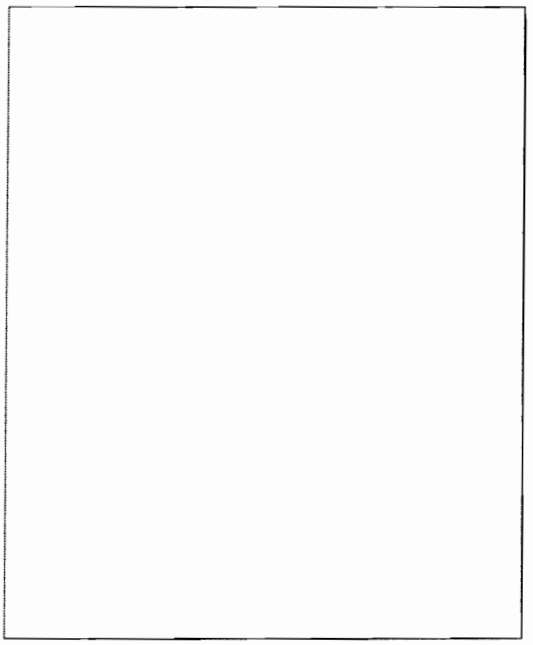

Site Map/plan (include north arrow):

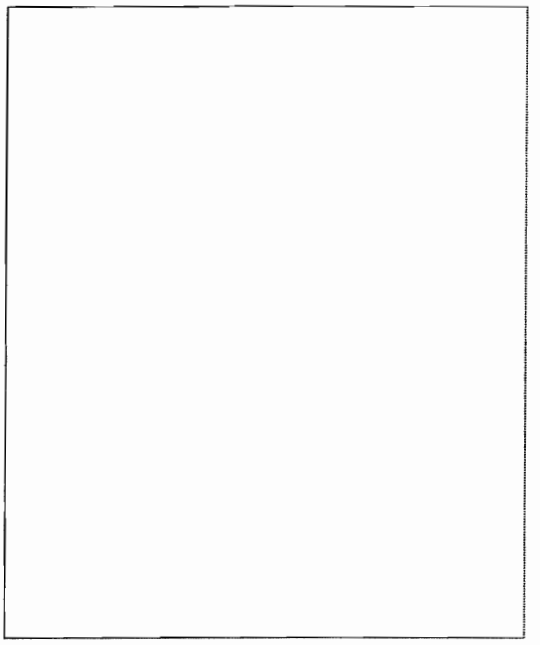

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick. Projecting slate-clad bay on second floor of west elevation. Frront elevation has flat-arch window openings with wooden one-over-one sash and a boarded flat-arch door opening at right bay. A wooden shed-roof porch (rolled asphalt roofing) with wooden openwork balustrade sits on a concrete base.

38.(cont.) History::

1920 census shows 3 households at this address: Catherine Marsoy?, black renter, cook in institution and two children; Jennie Holliday, property owner, black, semstress in shirt factory, and John & Mattie Bell, he a laborer in shirt factory, also black.
1927 Red-Blue Book:Green, Otto V; 4264Wa: Holiday Jennie Mrs.
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	285	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4268 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Concrete Block	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
Asphalt		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1948		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hubbard, Brooks M.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hubbard, Brooks M.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TURNER, JOSEPHINE	Lynn Josse, Michael Allen, CRO	3/1/2010
4268 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐
☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:
Tapestry brick with every seventh course laternating headers and stretchers. Wooden vergeboards. Concrete stoop with metail rail at entrance. Entrance has metal replacement door and gabled wooden hood with supporting open brackets and wood siding in the gable end. Window opening to left carries paired three-over-one wooden windows divided by center mullion; brick rowlock sill. Louvered vent at gable end in opening with rowlock sill and header.

38.(cont.) History::
Concrete block/brick faced; shown 4266 on 1951 Sanborn map

38. (cont.) Significance

39. Sources of information:
Sanborn maps, building permits, St. Louis Daily Record

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	2846	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4270 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building		
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Undetermined	
(b) One-story simple massed plan		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Concrete	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Full	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Medium Gable	Stoop and hood	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
Asphalt	Visible from public road? ☒	Endangered by:

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
1955	Lee, Wm. E.	Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
	Hubbard, E. D.	36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Hubbard, Brooks M.	
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40: Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
TURNER, CYNTHIA M	Lynn Josse, Michael Allen, CRO	3/1/2010
4268 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Tapestry brick in stretcher bond. Wooden vergeboards. Concrete stoop with metal railings at entrance, which has wooden door and wooden gabled hood with wooden siding in gable end and supported by open brackets. Window opening at left has thin concrete sill and contains a triple window with a center single-pane sash flanked by three-sash windows. Wooden louvered vent at top of gable end.

38.(cont.) History::

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record,

4273

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	287	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4273 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a)	Load-bearing Brick	
(b) Townhouse		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
2	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type	24. Front Porch Type:	☒ Altered Date(s):
Flat	Full, closed	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s):
		Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1885		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BROWN, FREDERICK & DAISIE M	Lynn Josse, Michael Allen, CRO	3/1/2010
4273 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Enclosed full porch has hipped metal roof and is clad in vinyl siding with a mitered window at left and entrance at right. Front elevation's brick is painted. Second floor window openings have segmental arches, wooden sills and short wooden one-over-one windows. Masonry work below windows suggest opening wer eonce longer. Wooden dentillated cornice retuns slightly to side elevations, with projecting wooden architrave above.

38.(cont.) History::

1920 census:
1927 Red-Blue Book:Dunbar Harry (Anna)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	Z88	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4275 W GARFIELD AV
E. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	7. Township/Range/Section: Not Applicable T: R: S:
8. Historic Name (if known):		9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Domestic
	Sub-use: Single Dwelling	Sub-use: Single Dwelling

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Left	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	Stone	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	Undetermined	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	stoop and awning	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural): Visible from public road? ☒	☒ Other Date(s): Endangered by:
28. Further description of building features and associated resources on continuation page. ☒		

HISTORICAL DATA

29. Construction date:	32. Architect:	35. Previously surveyed? ☒
1899		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0	Simpson, Jeptha H.	
0		37. National Register eligible?
		Contributing
38. History and significance on continuation page. ☒		
39. Sources of information on continuation page. ☒		

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
BROOKS, ALICE & ANNIE & MARY & RO	Lynn Josse, Michael Allen, CRO	3/1/2010
4275 W GARFIELD AV		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐

☐ ☐
☐ ☐
☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

Site Map/plan (include north arrow):

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted front elevation. Brick stoop with concrete slab and metal railings. Entrance has wooden door and transom window behind metal storm door; metal awning above. Window opening to left has stone sill, segmental arch, and wooden two-over-two window behind metal storm window. Parapet has stone segmental coping. Chimneys at west elevation have tall clay pots.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Jackson Edw (Margt)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)

4279

Missouri Department of Natural Resources
State Historic Preservation Office

Architectural/Historic Inventory Form

1. Survey No.		2. Survey Name:
SLCAS036	289	Architectural Survey of The Ville
3. County:		4. Address:
St. Louis [Independent City]		4279 W GARFIELD AV
5. City/State:	Vicinity:	6. UTM: /
St. Louis, MO	☒	

7. Township/Range/Section: Not Applicable
T: R: S:

8. Historic Name (if known):	9. Present Name (if known):

10. Ownership:	11. Historic Use (if known):	11. Present Use:
Private	Domestic	Vacant/Not in Use
	Sub-use: Single Dwelling	Sub-use:

ARCHITECTURAL INFORMATION

12. Category of Property:	19. Chimney placement:	26. Outbuildings (list, describe in Box 26 cont'd):
Building	Side, Right	
13. Architectural style/vernacular type (a)/(b):	20. Structural system:	
(a) Lt 19th/Ea 20th c Amer. Mvmnts	Load-bearing Brick	
(b) Shotgun		
14. Plan Shape:	21. Ext. wall cladding:	
Rectangular	Brick	
15. Number of Stories:	22. Foundation Material:	
1	not visible	
16. No. of bays (1st floor)	23. Basement type:	27. Changes:
2	None	☒ Addition(s) Date(s):
17. Roof Type:	24. Front Porch Type:	☒ Altered Date(s):
Flat	none	☒ Moved Date(s):
18. Roof Material:	25. Acreage (rural):	☒ Other Date(s):
	Visible from public road? ☒	Endangered by: neglect

28. Further description of building features and associated resources on continuation page. ☒

HISTORICAL DATA

29. Construction date	32. Architect:	35. Previously surveyed? ☒
c. 1899		Survey Name:
30. Significant date/period:	33. Builder:	St. Louis African-American History Sites
		36. On National Register? ☒ individual.
31. Area(s) of significance:	34. Original or significant owner:	Nomination: ☒ district
0		
0		37. National Register eligible?
		Contributing

38. History and significance on continuation page. ☒

39. Sources of information on continuation page. ☒

OTHER

40. Current Owner/address:	41. Form prepared by (name and organization):	42. Survey date:
HILL, ERNEST H & LOUISE	Lynn Josse, Michael Allen, CRO	3/1/2010
4279 W GARFIELD		43. Date of revisions:
ST LOUIS MO 63113		

FOR SHPO USE:

☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐

Architectural/Historic Inventory Form

Location Map (include north arrow):

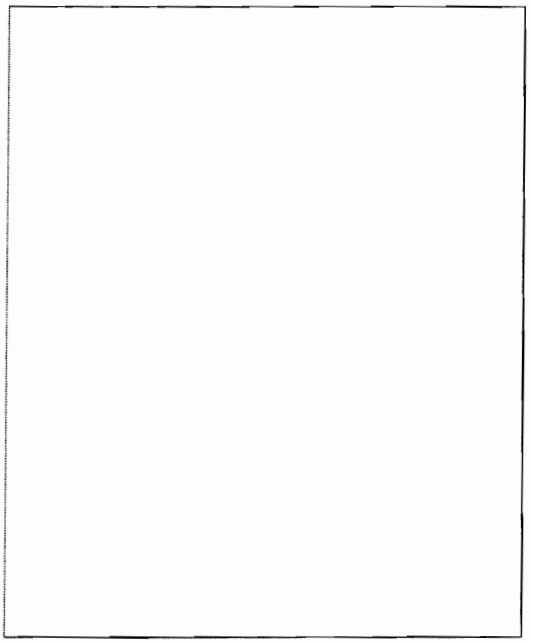

Site Map/plan (include north arrow):

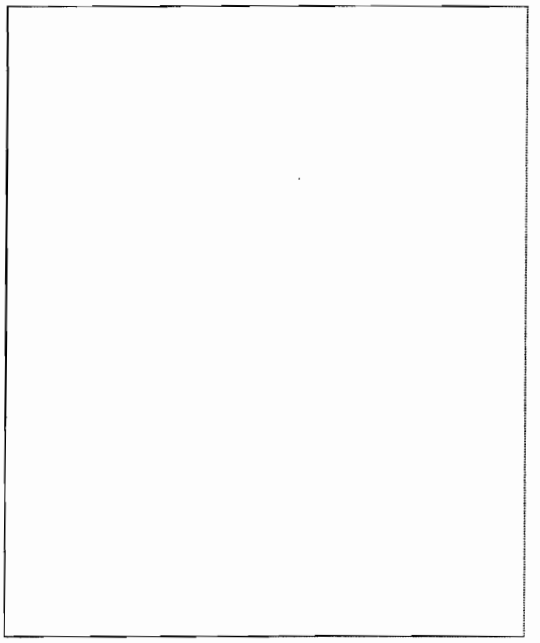

ADDITIONAL INFORMATION:

26. (cont.) Description of environment and outbuildings

28. (cont.) Further description of important architectural features:

Painted brick. Concrete step to entrance. Openings have been altered to have flat arches. Door opening missing its door. Window opening significantly widened and filled with modern triple window. Tapered bases of end blocks remain at top of parapet, which suggests alteration. Clay coping tiles on parapets.

38.(cont.) History::

1920 census:
1927 Red-Blue Book: Green Saml (Emma)
1930 census:

38. (cont.) Significance

39. Sources of information:

Sanborn maps, building permits, St. Louis Daily Record, US census, Metropolitan Negro Directory (1943), Gould's Red-Blue book (1927), Negro Business and Trade Directory (1934)